
# Vol. 3 of 5 FEP-02/457/2013/C Central Kowloon Route Yau Ma Tei East Contract No. HY/2014/08 December 2019



AM by mh.leung am\Drawing\Use 26-Sep-19 11:47:42 S:\6. Drauahtina Te 5 Printed



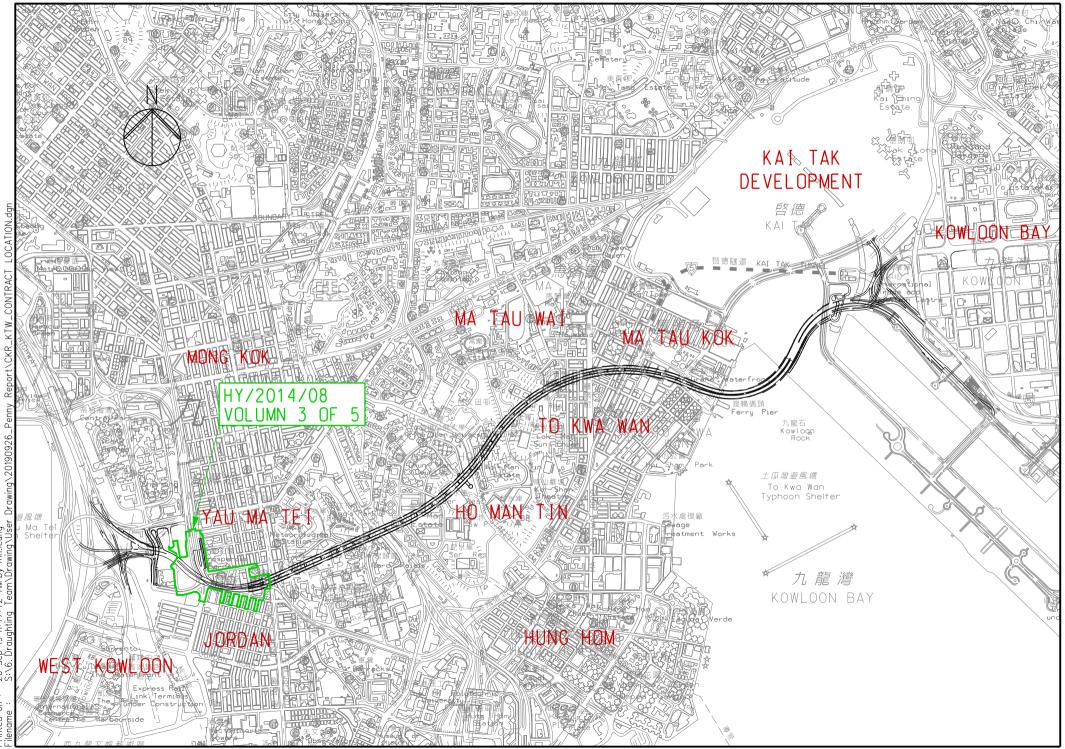

#### Environmental Permit No. EP-457/2013/C

#### **Central Kowloon Route**

#### **Independent Environmental Checker Verification**

Works Contract:	Yau Ma Tei East (HY/2014/08)

#### **Reference Document/Plan**

Document/Plan to be-Certified/ Verified:	Monthly EM&A Report No.21 (December 2019)
Date of Report:	10 January 2020 (Rev.1)
Date received by IEC:	10 January 2020

#### **Reference EP Condition**

Environmental Permit Condition:

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

3.4

#### **IEC Verification**

I hereby verify that the above referenced document/<del>plan</del> complies with the above referenced condition of EP-457/2013/C.

Mandy 20.

Ms Mandy To Independent Environmental Checker Date:

10 January 2020

Our ref: 0436942\_IEC Verification Cert\_YMTE\_Monthly EM&A Rpt No.21.docx





Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan Kowloon, Hong Kong Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

# Build King - SKEC Joint Venture

### Central Kowloon Route Contract HY/2014/08

### Section of Yau Ma Tei East

Monthly EM&A Report No. 21

(Period from 1 to 31 December 2019)

### Rev. 1

(10 January 2020)

		Name	Signature
Prepared by		Karen K. Y. Cheung	d
Checked Reviewed by	&	Nelson T. H. Tsui	7
Approved Certified by	&	Kevin W. M. Li (Environmental Team Leader)	K.

#### TABLE OF CONTENTS

#### **EXECUTIVE SUMMARY**

1.	BASIC PROJECT INFORMATION	7
2.	ENVIRONMENTAL STATUS	. 10
3.	MONITORING RESULTS	. 12
4.	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	. 20
5.	EM&A SITE INSPECTION	. 22
6.	FUTURE KEY ISSUES	. 23
7.	CONCLUSION AND RECOMMENDATIONS	. 24

#### LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/08
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month
- Q. Interim Report for the Complaint

#### **EXECUTIVE SUMMARY**

- A.1 Build King SKEC Joint Venture ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/08 – Section of Yau Ma Tei East ("The Project") on 20 April 2018. This is the 21<sup>st</sup> monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 December 2019 to 31 December 2019.
- A.2 A summary of the construction works that undertaken for the Project during the reporting month is listed below.

#### **Construction Activities undertaken**

- Architectural Builders Works and Finishes (ABWF) and Building Services (BS) Works, including FSD Inspection & Substantial Completion for Phase 2 at Methadone Clinic
- D-Wall Construction at Zone E Access Shaft
- Excavation from Ground Slab to Roof Slab at Zone E Access Shaft
- Micro Piling and proof drilling at Yau Ma Tei Police Station (YMTPS)
- Micro Pile Stitching (62 nos.) & Install Jack-up System at YMTPS
- Construction of Super Structure from 1/F to 2/F at TPLBJHB
- Construction of Super Structure from 3/F to R/F at TPLBJHB
- ABWF works and BS Works incl. Lift Installation, FSD Inspection and Substantial Completion at Temporary Maternal and child health Centre (TMCHC)
- Construction of capping beam and roof slab at Zone A
- Excavation from Roof Slab to Ceiling Slab at Zone A
- Construction of Stage 1 D-wall panels at Zone C
- Construction of Stage 1 D-wall panels at Zone B
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

<b>Regular construction noise monitoring during normal working hours</b>				
W-N1A, W-N18, W-N25A, W-P11	6 times			
Construction dust (24-hour TSP) monitoring				
W-A1	6 times			
W-A6	6 times			
Construction dust (1-hour TSP) monitoring				
W-A1,W-A6	18 times			

- A.4 No construction work was conducted during time period other than normal working hours during this reporting month.
- A.5 Inert construction and demolition (C&D) materials and non-inert C&D materials were the wastes that generated from this Project. During December 2019, 26465.8 tonnes inert C&D material was generated from the Project. 21262.7 tonnes inert C&D material was sent to public fill, 4485.4 tonnes inert C&D material was reused in other projects and 717.7 tonnes

inert C&D material was reused in the Contract. No plastics, metal and paper/cardboard packaging was generated and sent to recyclers for recycling during reporting period. About 81.5 tonnes of non-recyclable non-inert C&D materials, such as general refuse, were disposed of at landfill. No chemical waste was generated during this reporting month.

- A.6 Bi-weekly inspection of the implementation of landscape and visual mitigation measures was conducted on 12, 24 December 2019. Details of the audit findings and implementation status are presented in Section 5.
- A.7 Joint weekly site inspections were conducted by representatives of the Contractor, Engineer and Contractor's ET on 5, 12, 20, 24 December 2019. One joint site inspection with IEC also undertaken on 20 December 2019. Details of the audit findings and implementation status are presented in Section 5.
- A.8 No change has been made from the described in the approved EM&A, such as construction method, mitigation proposals and design changes.
- A.9 No exceedance of the Action and Limit Levels of 24-hour TSP, 1-hour TSP and construction noise monitoring were recorded during the reporting month.
- A.10 One complaint was received in the reporting month on 11 December 2019. After investigation with Contractor and conclusion on 12 December 2019, precautionary measure had been implemented and the complaint on petrol odour is concluded as non-project related. The interim report for the complaint is shown in Appendix Q.
- A.11 No non-compliance was received in the reporting month.
- A.12 No summon or prosecution was received in this reporting month.
- A.13 No reporting changes were revised in this reporting month.
- A.14 A summary of the construction activities to be undertaken in the in the next reporting month is listed below:

#### **Construction Activities to be undertaken**

- Outstanding and defect for Drainage, ABWF and BS works for Phase 2 of Methadone Clinic
- Excavation of below ground slab (-0.5mPD) Zone E
- Complete remaining 1 no. D-wall panels at Zone E
- Works substantially completed with the Statutory Inspections (EMSD & FSD) and FSD inspection carried during the reporting month. The outstanding and defect works in progress for TMCHC.
- Complete the pumping test (stage 2), excavation to ceiling level and commence construction of ceiling slab at Zone A
- Predrilling works, guide wall construction, D-wall construction and utility diversion at Zone B.
- Utility diversion works at Zone A
- Stitching and jacking works of pile caps at YMTPS

#### **Construction Activities to be undertaken**

- Pipe pile wall construction at YMTPS
- Guide wall construction, predrilling works and D-wall construction at Zone C
- Super Structure works (columns, beams, wall slab) at TPLCJHB. 1/F to 3/F were completed. Construction lift shaft at TPLCJHB.
- Monitoring of instrumentation for all areas

#### **1. BASIC PROJECT INFORMATION**

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 July 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/C) was issued by EPD on 16 January 2017. A Further EP (FEP-02/457/2013/C) was issued by EPD on 5 March 2018.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/08 Section of Yau Ma Tei East (YMTE) covers part of the construction activities located at Yau Ma Tei under the EP and FEP which includes:
  - Section of Yau Ma Tei East
  - i. Construction of Cut-and-Cover Tunnel in compliance with all statutory requirements and the requirements specified under the Contract while maintaining the traffic with all necessary provisions
  - ii. Construction and subsequent handover of Yau Ma Tei Access Shaft for facilitating the access and use by the contractor of Central Kowloon Route Central Tunnel contract
  - Demolition of existing buildings including Yau Ma Tei Multi-storey Carpark Building, Yau Ma Tei Specialist Clinic Extension Building and Yau Ma Tei Jade Hawker Bazaars
  - iv. Demolition and re-provisioning of Gascoigne Road Flyover(GRF) and the underpinning works for the existing Ferry Street Flyover and Yau Ma Tei Police Station New Wing Building
  - v. Construction of civil provisions and coordination with the contractor of Central Kowloon Route - Tunnel Electrical & Mechanical contract
  - vi. Design and construction of Noise Barrier Works
  - vii. Prepare TTA proposals, discuss at TMLG meeting and obtain its agreement and approval/ endorsement from relevant authorities at suitable times to enable the execution of the Works

The alignment and works area for the Contract No. HY/2014/08 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the construction Activities Undertaken during the Reporting Month.

#### **Construction Activities undertaken**

- Architectural Builders Works and Finishes (ABWF) and Building Services (BS) Works, including FSD Inspection & Substantial Completion for Phase 2 at Methadone Clinic
- D-Wall Construction at Zone E Access Shaft
- Excavation from Ground Slab to Roof Slab at Zone E Access Shaft
- Micro Piling and proof drilling at Yau Ma Tei Police Station (YMTPS)
- Micro Pile Stitching (62 nos.) & Install Jack-up System at YMTPS
- Construction of Super Structure from 1/F to 2/F at TPLBJHB
- Construction of Super Structure from 3/F to R/F at TPLBJHB
- ABWF works and BS Works incl. Lift Installation, FSD Inspection and Substantial Completion at Temporary Maternal and child health Centre (TMCHC)
- Construction of capping beam and roof slab at Zone A
- Excavation from Roof Slab to Ceiling Slab at Zone A
- Construction of Stage 1 D-wall panels at Zone C
- Construction of Stage 1 D-wall panels at Zone B
- 1.5. There are no updates on the scope of works and construction methodologies.
- 1.6. The project organisational chart specifying management structure and contact details are shown in Appendix C.
- 1.7. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2

Table 1.2 Summary of the Status of Valid Environmental Licence,

Permit/ Licences/ Notification	Reference	Validity Period
Environmental Permit	EP-457/2013/C	Throughout the Contract
<b>Further Environmental Permit</b>	FEP-02/457/2013/C	Throughout the Contract
Notification of Construction Works under		
the Air Pollution Control (Construction	429806	Throughout the Contract
Dust) Regulation (Form NA)		
Wastewater Discharge Licence	WT00030660-2018	31 March 2023
Chemical Waste Producer Registration	WPN5213-225-B2526-01	Throughout the Contract
	GW-RE0479-19	18 June 2019 to
Construction Noise Permit at Zone C		12 December 2019
Construction Noise Permit at Zone C	GW-RE1010-19	17 December 2019 to
		16 June 2020
		21 December 2019 to
Construction Noise Permit at Zone E	GW-RE1054-19	19 February 2020

Notification, Permit and Documentations

Permit/ Licences/ Notification	Reference	Validity Period
Construction Noise Permit at Zone A & MCHC	GW-RE0888-19 (Superseded by GW-RE1068-19)	11 November 2019 to 9 May 2020
	GW-RE1068-19	31 December 2019 to 30 June 2020
Construction Noise Permit at Temporary Library	GW-RE0776-19	8 October 2019 to 7 January 2020
Construction Noise Permit at Methadone Clinic	GW-RE0830-19	19 October 2019 to 18 April 2020
Construction Noise Permit at Zone A & MCHC	GW-RE0888-19	10 November 2019 to 9 May 2020
Construction Noise Permit at Zone B (Resurfacing)	GW-RE0972-19	3 December 2019 to 30 January 2020
Billing Account for Disposal of Construction Waste	7029997	Throughout the Contract
Dumping at Sea Permit (Type 1 – Open Sea Disposal)	EP-MD-20-095	7 December 2019 to 6 June 2020
Dumping at Sea Permit (Type 1 – Open Sea Disposal) & (Type 2 – Confined Marine Disposal)	EP-MD-20-102	15 December 2019 to 14 January 2020

#### 2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/C) and FEP (FEP-02/457/2013/C) as of the reporting period for the Project are summarised in Table 2.1

EP/FEP Condition (EP-457/2013/C) (FEP-02/457/2013/C)	Submission	Submission date
Condition 1.12	Notification of Commencement Date of Construction of the Project	20 Mar 2018
Condition 2.3	Community Liaison Group	23 Nov 2017
Condition 2.4	Management organisation of the main construction companies	9 Feb 2018
Condition 2.5	Construction Programme and EP Submission Schedule	26 Feb 2018
Condition 2.6	Design Drawing	26 Feb 2018
Condition 2.7	Cultural Heritage Mitigation Plan	5 Oct 2019
Condition 2.8	Landscape Mitigation Plan	9 Mar 2018
Condition 2.9	Construction Noise Mitigation Measure Plan (CNMMP)	28 Nov 2019
Condition 3.3	Baseline Monitoring Report	6 Apr 2018
Condition 3.4	Monthly EM&A Report (Nov 2019)	13 Dec 2019

Table 2.1 Summary of Status of Required Submission for EP-457/2013/C and FEP-02/457/2013/C for the Project

2.2. Details of the major construction activities undertaken in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the construction Activities Undertaken during the Reporting Month.

Construction activities undertaken	Remarks on progress
Architectural Builders Works and Fin	shes (ABWF) and Building •Completed
Services (BS) Works, including FSD	nspection & Substantial
Completion for Phase 2 at Methadone	Clinic
D-Wall Construction at Zone E Acces	•Completed
Excavation from Ground Slab to Roof	Slab at Zone E Access Shaft•25% completion
• Micro Piling and proof drilling at Yau	Ma Tei Police Station •Completed
(YMTPS)	
• Micro Pile Stitching (62 nos.) & Insta	l Jack-up System at YMTPS •67 % completion
Construction of Super Structure from	/F to 2/F at TPLBJHB•67% completion

Co	nstruction activities undertaken	<b>Remarks on progress</b>
•	Construction of Super Structure from 3/F to R/F at TPLBJHB	•5% completion
•	ABWF works and BS Works incl. Lift Installation, FSD Inspection	•Completed
	and Substantial Completion at Temporary Maternal and child health	
	Centre (TMCHC)	
•	Construction of capping beam and roof slab at Zone A	• Completed
•	Excavation from Roof Slab to Ceiling Slab at Zone A	•18% completion
•	Construction of Stage 1 D-wall panels at Zone C	•5% completion
•	Construction of Stage 1 D-wall panels at Zone B	• 2% completion

2.3. The drawing showing the project layout and the location of the monitoring station and environmental sensitive receivers are attached in Appendix A and Appendix K. Co-ordinates of the monitoring location is shown in below:

Monitoring Location	Location ID	Latitude	Longitude
Yau Ma Tei Catholic Primary School (Hoi Wang Road)	W-A1/W-N1A	22.313357	114.16409
Man Cheong Building	W-A6	22.308185	114.166033
Hydan Place	W-N18	22.30858	114.170185
Prosperous Garden Block 1	W-N25A	22.309846	114.168072
The Coronation Tower 1	W-P11	22.309824	114.165616

Table 2.3 Summary for the location of the monitoring station

#### **3. MONITORING RESULTS**

3.1. Monitoring Parameters

#### Air Quality

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

#### <u>Noise</u>

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level ( $L_{eq}$ ). Leq (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, Leq (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as  $L_{10}$  and  $L_{90}$  shall also be obtained for reference.
- 3.2. Monitoring Equipment

#### Air Quality

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificate of dust monitoring equipment is attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
1-hour TSP	LD-5R Digital Dust Indicator	992818	3 Sep 2019
1-hour TSP	LD-5R Digital Dust Indicator	851820	23 Aug 2019
24-hour TSP	TE-5170X High Volume	1049	13, 28 Dec 2019
	Sampler		
	TE-5170X High Volume	1050	13, 28 Dec 2019
	Sampler		
	TE-5025A Calibration Kit	3465	22 Jan 2019

Table 3.1 Construction Dust Monitoring Equipment

#### <u>Noise</u>

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO.
- 3.2.6. An acoustic calibrator and sound level meter using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

888						
Monitoring Equipment	Serial Number	Date of Calibration				
Nti XL2 Sound Level Meter	A2A-13548-E0	10 Jan 2019				
Pulsar 105 Acoustic Calibrator	63705	28 Sep 2019				

Table 3.2 Monitoring Equipment Used in Monitoring

3.3. Monitoring Methodology and QA/QC results

#### **Air Quality**

- 3.3.1. The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R) was used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.
- 3.3.2. The 24-hour TSP monitor, High Volume Samplers (Tisch TE 5170 High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- The HVS was set at the monitoring location, with electricity supply connected and secured;
- HVS was calibrated before commencing the 1<sup>st</sup> measurement;
- The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
- The airflow over time during sampling process was recorded by the HVS.
- 3.3.3. HVSs were free-standing with no obstruction. The following criteria were considered in the installation of the HVS:
  - Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
  - A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
  - No furnace or incinerator flues was nearby;
  - Airflow around the sampler was unrestricted; and
  - Permission could be obtained to set up the samplers and gain access to the monitoring station.
- 3.3.4. Preparation of Filter Papers
  - Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
  - ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
  - Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

#### 3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- The filter holder and area surrounding the filter were cleaned;
- The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- The shelter lid was closed and secured with an aluminum strip;
- The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- A new flow rate record sheet was inserted into the flow recorder;
- ◆ The flow rates of the HVS was checked and adjusted to between 1.22-1.37 <sup>m³min-³</sup>, which was within the range specified in the EM&A Manual (i.e. 0.6- 1.7 <sup>m³min-³</sup>);

- The programmable timer was set for a sampling period of 24 hours ±hour, and the starting time, weather condition and filter number were recorded;
- The initial elapsed time was recorded;
- At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.
- 3.3.6. Maintenance and Calibration
  - The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
  - ◆ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.
- 3.3.7. Wind Data Monitoring
  - The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up if malfunction occurred or data was not recorded from HKO

#### <u>Noise</u>

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level ( $L_{eq}$ ) in decibels dB(A).  $L_{Aeq(30min)}$  was used as the monitoring metric for the time period between 0700 –1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB(A).
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms<sup>-1</sup> or wind with gusts exceeding 10 ms<sup>-1</sup>. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms<sup>-1</sup>.
- 3.4. Monitoring Locations

#### Air Quality

3.4.1. During the site visit, both of the original proposed dust monitoring locations were rejected due to the condition at The Coronation was not favorable for monitoring and the

access was declined by the management office of Hong Kong Community College (HKCC) of PolyU. Two alternative air monitoring stations Yau Ma Tel Catholic Primary School (Hoi Wang Road) and Man Cheong Building had been proposed by ET and approved by IEC. 2 designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 3.3. The location plan of air quality monitoring stations is shown in Appendix K.

Air Quality Monitoring Station	Dust Monitoring Station
W-A1	Yau Ma Tei Catholic Primary School (Hoi Wang Road)
W-A6	Man Cheong Building

Table 3.3 Location	of the	Dust ]	Monitoring	Stations
--------------------	--------	--------	------------	----------

#### <u>Noise</u>

3.4.2. During the site visit, one of the original proposed noise monitoring locations Tak Cheong Building was rejected by the president of the owner's corporation. Alternative noise monitoring station Hydan place had been proposed by ET and approved by IEC. 4 noise sensitive receivers designated noise monitoring locations were identified and agreed with IEC and EPD. The designated monitoring stations are identified and access was granted by the premises. The details of noise monitoring station are described in Table 3.4 and the location plan of noise monitoring station is shown in Appendix K.

······································						
Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement				
W-N1A	Yau Ma Tei Catholic Primary School (Hoi Wang Road)	Façade				
W-N18	Hydan Place	Façade				
W-N25A	Prosperous Garden Block 1	Façade				
W-P11	The Coronation Tower 1	Façade				

 Table 3.4 Noise Monitoring Stations

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.5.

Impact Monitoring	Duration	Sampling Parameter	Frequency
Dust	1-hour continuous measurement	1-hour TSP	3 times per six days
Dust	24-hour continuous sampling	24-hour TSP	Once per six days
Noise	30-minute continuous measurement	$L_{eq 30 min}$ , $L_{10}$ and $L_{90}$ as reference.	Once L <sub>eq 30 min</sub> from 0700 – 1900 per seven days

Table 3.5: Summary of Impact Monitoring Programme

#### 3.6. Result Summary

#### Air Quality

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring station in the reporting month are summarised in Table 3.6

Monitoring Station	Major Dust Source
$M = \Delta$	Nearby traffic, construction work from West Kowloon Government Offices
W-A6	Nearby traffic

Table 3.6 Observation at Dust Monitoring Station

- 3.6.2. Air quality impact monitoring for the reporting month was carried out on 2, 7, 13, 19, 23, 28 December 2019 at W-A6 and W-A1.
- 3.6.3. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.7 and Table 3.8. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

ggg						
<b>Monitoring Location</b>	Monitoring LocationRange(µg/m³)Action Level(µg/m3)		Limit Level(µg/m3)			
W-A1	43-66	319	500			
W-A6	46-67	306	500			
Table 3.8 Summary of 24-hour TSP Monitoring Results						
Monitoring Location Range(µg/m <sup>3</sup> ) Action		Action Level(µg/m3)	Limit Level(µg/m3)			
W-A1	36-56	167	260			

166

260

27-81

W-A6

#### <u>Noise</u>

3.6.4. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.9:

Monitoring Station	Major Noise Source	
W-N1A	Nearby traffic, construction work from West	
vv-1N1/X	Kowloon Government Offices, school activities	
W-N18	Nearby traffic	
W-N25A	Nearby traffic	
W-P11 Nearby traffic		

 Table 3.9 Observation at Noise Monitoring Stations

3.6.5. The construction noise impact monitoring for the reporting month was carried out on 2, 7, 13, 19, 23, 28 December 2019. The measurement data are shown in Appendix M and summarized in Tables 3.10:

Time	Monitoring			Range, dB(A)			
Period	location	Parameter	$\mathbf{L}_{\mathbf{eq}}$	L <sub>eq</sub> L <sub>10</sub> L <sub>90</sub>		Action Level	Limit Level#
	W-N1A		59.8-64.5	61.5-66.5	57.8-61.4		70dB(A) or 65 dB(A) during examination**
Normal working hour	W-N18	T	66.2-68.6	68.1-71.1	63.8-66.9	When one documented	
from 0700-19 00	W-N25A	Leq 30min	65.2-71.4	67.4-72.7	63.2-70.1	complaint is received	75dB(A)#
W-P	W-P11		63.4-69.6	66.0-72.2	60.9-65.9		

Table 3.10 Summary of Noise Monitoring Results

Remarks: 1. # If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit by the Noise Control Authority have to be followed.

#### Waste management

3.6.6. The waste generated from this Project includes inert C&D materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.11. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

		-	(	Quantity	•	
				Non-inert C&	D Materials	
			Others, e.g.	Recy	ycled material	s
Reporting period	Inert C&D	Chemical	General Refuse			
	Materials (in 'tonnes)	Waste (in'000 Kg)	disposed			
	(in toines)	(m ooo ng)	at	Paper/card board	Plastics	Metals
			Landfill	(in '000 Kg)	(in '000 Kg)	(in '000 Kg)
			(in			
			'tonnes)			
Dec-2019	26465.8	0.0	81.5	0.0	0.0	0.0

Table 3.11 Quantities of waste generated from the Project

### 4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

	ble 4.1 Environmental Co	Simplaint Handling Procedur	e	
Complaint Received via Project Hotline		Complaint Received via	a 1823 or from other	
		government departments		
		0 1		
Contractor notify ER, ET	L and IEC	ER notify Contractor, ET	and IEC	
Contractor notify EK, ET		EK notify Contractor, E1		
[				
Contractor log complair	nt and date of receipt onto	o the complaint database. Co	ontractor, ER and ET to	
	conduct investig	gation of complaint		
If complaint is considere	d not valid	If complaint is found valid	d	
1		1		
ET or ER to reply the con	mnlainant if necessary	Contractor to identify a	nd implement remedial	
ET OF ER to repry the con	inplainant if necessary		-	
		measures in consultation	with the IEC, E1 and	
	Γ	ER.		
		The ER, ET and IEC to a	review the effectiveness	
		of the Contractor's reme	edial measures and the	
		updated situation; ET t	o undertake additional	
		monitoring and audit to	verify the situation if	
		necessary, and oversee that	at circumstances leading	
		to the complaint do not recur. ER to conduct		
		further inspection as nece	ssary.	
If the complaint is refer	red by the EPD, the Con	tractor to prepare interim rep	port on the status of the	
complaint investigation	and follow-up actions sti	ipulated above, including the	e details of the remedial	
	-	or already taken, for submiss		
	-	igned by the EPD		
		1. 0.1 1	, , <b>, , , , ,</b> ,	
	-	ults of the investigation, sub	•	
address the complaint and updated situation including the effectiveness of the remedial measures,				
supported by regular and additional monitoring results in the monthly EM&A reports				

#### Table 4.1 Environmental Complaint Handling Procedure

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. No exceedance of the Action and Limit Levels of construction noise, 24-hour TSP and 1-hour TSP monitoring were recorded during the reporting month.
- 4.4. One complaint was received in the reporting month on 11 December 2019. After investigation with Contractor and conclusion on 12 December 2019, precautionary measure had been implemented and the complaint on petrol odour is concluded as non-project related. The interim report for the complaint is shown in Appendix Q.
- 4.5. No non-compliance was received in the reporting month.
- 4.6. No notification of summons and prosecution was received in the reporting period.
- 4.7. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

#### 5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, four (4) site inspections were carried out on 5, 12, 20, 24 December 2019, along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 12, 24 December 2019.
- 5.2. One joint site inspection with IEC also undertaken on 20 December 2019. Minor deficiencies were observed during weekly site inspection. Key observations during the site inspections are summarized in Table 5.1.

Date	<b>Environmental Observations</b>	Follow-up Status
5 December 2019	No major observation was found during	-
	site inspection.	
12 December 2019	1. Chemical container should be stored	1. Chemical container was
	properly in Zone E (temporary library).	removed in Zone E (temporary
		library).
20 December 2019	1. Material should not be stored in tree	1. Material was removed from the
	protection zone in Zone A.	tree protection zone in Zone A.
	1. Chemical container should be stored and	1. Chemical container was stored
24 December 2019	labelled properly in Zone E.	and labelled properly in Zone
		E.

Table 5.1 Site Observations

- 5.3. The Contractor had rectified all observation identified during environmental site inspection in the reporting period.
- 5.4. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.


#### 6. **FUTURE KEY ISSUES**

- 6.1. Work to be undertaken in the next reporting month are:
- Outstanding and defect for Drainage, ABWF and BS works for Phase 2 of Methadone Clinic
- Excavation of below ground slab (-0.5mPD) Zone E
- Complete remaining 1 no. D-wall panels at Zone E
- Works substantially completed with the Statutory Inspections (EMSD & FSD) and FSD inspection carried during the reporting month. The outstanding and defect works in progress for TMCHC.
- Complete the pumping test (stage 2), excavation to ceiling level and commence construction of ceiling slab at Zone A
- Predrilling works, guide wall construction, D-wall construction and utility diversion at Zone B.
- Utility diversion works at Zone A
- Stitching and jacking works of pile caps at YMTPS
- Pipe pile wall construction at YMTPS
- Guide wall construction, predrilling works and D-wall construction at Zone C
- Super Structure works (columns, beams, wall slab) at TPLCJHB. 1/F to 3/F were completed. Construction lift shaft at TPLCJHB.
- Monitoring of instrumentation for all areas
- 6.2. Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.
- 6.3. The tentative schedule of regular construction noise monitoring, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.4. The construction programme for the Project for the next reporting month is presented in Appendix B.

#### 7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 21<sup>st</sup> monthly EM&A Report presents the EM&A works undertaken during the period from 1 December 2019 to 31 December 2019 in accordance with the EM&A Manual and the requirement under EP- 457/2013/C and FEP-02/457/2013/C.
- 7.2. Air quality (including 1-hour TSP and 24-hour TSP) and noise impact monitoring were carried out in the reporting period. No exceedance of the Action and Limit Level was recorded for construction noise and air quality impact monitoring during the reporting month.
- 7.3. Weekly environmental site inspections were conducted during the reporting period. Joint site inspection with IEC were carried out on 20 December 2019. Minor deficiency was observed during site inspection and was rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.
- 7.4. One complaint was received in the reporting month on 11 December 2019. After investigation with Contractor and conclusion on 12 December 2019, precautionary measure had been implemented and the complaint on petrol odour is concluded as non-project related. The interim report for the complaint is shown in Appendix Q.
- 7.5. No non-compliance situation was received in the reporting month.
- 7.6. No notification of summons or prosecution was received since commencement of the Contract.
- 7.7. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

# Appendix A Alignment and Works Area For the Contract No. HY/2014/08

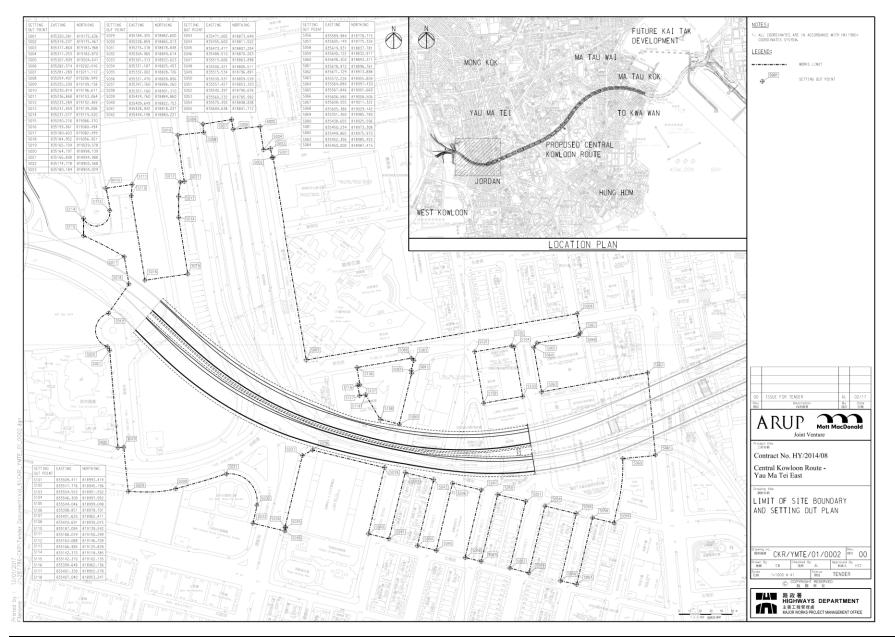


Acuity Sustainability Consulting Ltd.

# Appendix B Construction Programme

			Constru
Activity Name	Duration	Start	Finish
HY/2014/08 Central Kowloom Route - Yau Ma Tei East	2875	17-Jan-18	30-Nov-25
Construction Works	2875	17-Jan-18	30-Nov-25
Temporary Traffice Management in Underground (Perior, 11 & 12)			
Borks on PMTRC Est, and Construct Accessible Ramy and Refuse Collection Area for Methadone Clinic			
Investion of Mathadams Clasic	787	17-Jan-18	
Construction of New East Building and Resonation of YMTRCP Building of Mothadone Class:			8 13-Mar-20
Firsts on Northern & Southern Dars of YMINESCP	538		
LE Works within TMTEC, Mantemator Depot Area, Pathic Square Sofkansie St Rest Gaudes, Access Road	2238	17-Jan-18	
Preservation and Protection of Educing Trees	2500	17-Jan-18	
Establishment Works			4 25-Nov-25
CE Write in Understand			
Completion of Noise Endosate			
Construction of Yea Ma Tei Acams Stath	728	1-Feb-18	
El Remaining Works not Covered in Other Section		17-Jan-18	
Tempenny Yuu Mu Tei Fahin Libnay and Jade Hawker Banan	900	17-Mar-18	
Temperary Maternal and Child Health Course	685	17-Jan-18	
Construction of CAC Transf Einsteinad		17-lan-18	
Construction of C&C Turnel Westhound		17-Jan-18	
O&C Tunnel Works within Pertire 13 & 204, Out-de-say of Fortier 200 & 24		7-Apr-18	
Densition of Northern Part of Ex. TMT Multi-Storey Car Park Bdg.			
Demolition of Southern Part of Ex. YMT Multi-Sterry Car Park Edg.			
CRD Reprovisioning			
Invaluency howen CER-IMT East and West Connact			
Completion of Diophnagen Walls and Roof States of C&C Tannels within Porton 37 and 28	1	17-Aug-20	0 17-Aug-20

# Appendix C Project Organization Chart

## Project O-Chart

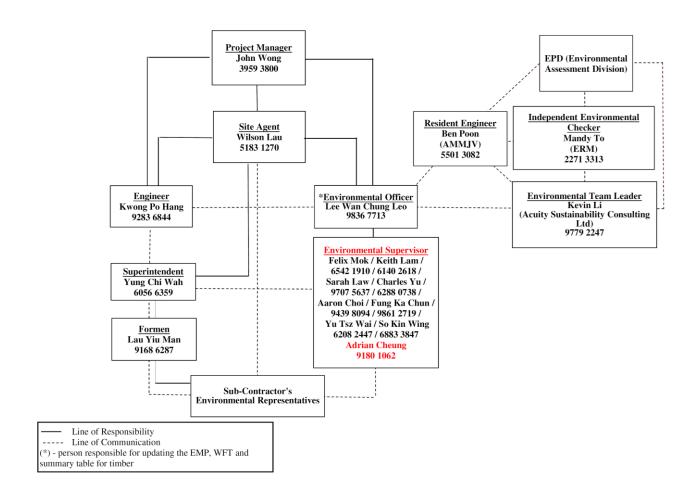

# Appendix D Dust Event-Action Plan (EAP)

#### Contract No. HY/2014/08 Environmental Monitoring & Auditing

DADNA	ACTION								
EVENT	ET	IEC	ER	CONTRACTOR					
ACTION LEVEL									
1.Exceedance for one sample	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform IEC and ER;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	1. Notify Contractor.	<ol> <li>Rectify any unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>					
2.Exceedance for two or more consecutive samples	<ol> <li>Identify source;</li> <li>Inform IEC and ER;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ET on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Ensure remedial measures properly implemented.</li> </ol>	<ol> <li>Submit proposals for remedial to ER within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>					
LIMIT LEVEL									
1.Exceedance for one sample	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform ER, Contractor and</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC</li> </ol>					

#### Contract No. HY/2014/08 Environmental Monitoring & Auditing

EVENT	ACTION							
	ET	IEC	ER	CONTRACTOR				
	<ul> <li>EPD;</li> <li>3. Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ul>	<ol> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Supervise implementation of remedial measures.</li> </ol>	3. Ensure remedial measures properly implemented.	<ul> <li>within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>4. Amend proposal if appropriate.</li> </ul>				
2.Exceedance for two or more consecutive samples	<ol> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>				

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

Acuity Sustainability Consulting Ltd.

# Appendix E Noise Event-Action Plan (EAP)

EVENT		ACTIO	)N	
	ET	IEC	ER	CONTRACTOR
Action Level	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Notify IEC and Contractor;</li> <li>Report the results of investigation to the IEC, ER and Contractor;</li> <li>Discuss with the Contractor and formulate remedial measures;</li> <li>Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol> <li>Review the analysed results submitted by the ET;</li> <li>Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures are properly implemented</li> </ol>	<ol> <li>Submit noise mitigation proposals to IEC;</li> <li>Implement noise mitigation proposals.</li> </ol>
Limit Level	<ol> <li>Identify source;</li> <li>Inform IEC, ER, EPD and Contractor;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency;</li> <li>Carry out analysis of Contractor's working procedures to determine</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of</li> </ol>

EVENT		ACTIO	DN	
	ET	IEC	ER	CONTRACTOR
	possible mitigation to be		properly implemented;	works as determined by the ER
	implemented;		5. If exceedance continues,	until the exceedance is abated.
	6. Inform IEC, ER and EPD the		consider what portion of the	
	causes and actions taken for the		work is responsible and	
	exceedances;		instruct the Contractor to	
	7. Assess effectiveness of		stop that portion of work	
	Contractor's remedial actions		until the exceedance is	
	and keep IEC, EPD and ER		abated.	
	informed of the results;			
	8. If exceedance stops, cease			
	additional monitoring.			

Note:

ET – Environmental Team

IEC – Independent Environmental Checker

ER – Engineer's Representative

# Appendix F Environmental Mitigation Implementation Schedule (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Constru	ction Dust Impact				
\$4.3.10	D1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	<ul> <li>APCO</li> <li>To control the dust impact To meet HKAQO and TM-EIA criteria</li> </ul>	Implemented
S4.3.10	D2	<ul> <li>Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of no less than 1.3 L/m<sup>2</sup> to achieve the dust removal efficiency.</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	<ul> <li>APCO</li> <li>To control the dust impact To meet HKAQO and TM-EIA criteria</li> </ul>	• Implemented
\$4.3.10	D3	<ul> <li>Proper watering at exposed spoil should be undertaken throughout the construction phase;</li> <li>Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading;</li> <li>Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads;</li> <li>A stockpile of dusty material should not be</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	<ul> <li>APCO</li> <li>To control the dust impact To meet HKAQO and TM-EIA criteria</li> </ul>	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>extended beyond the pedestrian barriers, fencing or traffic cones;</li> <li>The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle.</li> <li>Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores;</li> <li>When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;</li> <li>The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials;</li> <li>Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$4.3.10	D6	<ul> <li>continuously;</li> <li>Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet;</li> <li>Any skip hoist for material transport should be totally enclosed by impervious sheeting;</li> <li>Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides;</li> <li>Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system</li> <li>Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies.</li> <li>Implement regular dust monitoring under EM&amp;A programme during the construction stage.</li> </ul>	Monitoring of dust impact	Contractor	Selected rep. dust monitoring station	Construction stage	• TM-EIA	• Implemented
	1		Construct	tion Noise (Airborn		1	1	1

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S5.4.1	N1	<ul> <li>Implement the following good site practices:</li> <li>Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme;</li> <li>Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs;</li> <li>Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works;</li> <li>Mobile plant should be sited as far away from NSRs as possible and practicable;</li> <li>Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities.</li> </ul>	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented
S5.4.1	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	Implemented
S5.4.1	N3	Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with 25mm thick internal sound absorptive lining), acoustic mat or full enclosure,	Sreen the noisy plant items to be used at all	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		screen the noisy plants including air compressors, generators and handheld breakers, etc.	sites					
S5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented
\$5.4.1	N5	Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/ unloading activities	Contractor	Mucking out locations	Construction stage	• Annex 5, TM-EIAO	Implemented
S5.4.1	N6	Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented
\$5.4.1	N7	Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected rep. noise monitoring station	Construction stage	• TM-EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.1	W1	<ul> <li>In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following:</li> <li>Construction Runoff <ul> <li>At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction;</li> <li>The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be incorporated in the permanent drainage channels to enhance deposition rates;</li> <li>The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under</li> </ul> </li> </ul>	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	<ul> <li>Water Pollution Control Ordinance</li> <li>ProPECC PN 1/94</li> <li>TM-EIAO</li> <li>TM-DSS</li> </ul>	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of 0.1 m3/s a sedimentation basin of 30 m3 would be required and for a flow rate of 0.5 m3/s the basin would be 150 m3. The detailed design of the sand/ silt traps shall be undertaken by the contractor prior to the commencement of construction;</li> <li>All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. Exposed slope surfaces should be covered by tarpaulin or other means;</li> <li>The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows, and all traffic areas and access roads protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during prolonged periods of inclement weather and the reduction of surface sheet flows;</li> <li>All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas;</li> <li>Measures should be taken to minimize the ingress</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>of site drainage into excavations. If the excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;</li> <li>Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50m3 should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system;</li> <li>Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers;</li> <li>Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes;</li> <li>All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and site wheel washing</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>facilities should be provided at every construction site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains;</li> <li>Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain;</li> <li>Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts;</li> <li>All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby;</li> <li>Adopt best management practices;</li> <li>All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		season (April to September) as far as practicable.						
S6.9.1.2	W2	<ul> <li>Tunneling Works and Underground Works</li> <li>Cut-&amp;-cover tunneling work should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable.</li> <li>Uncontaminated discharge should pass through sedimentation tanks prior to off-site discharge;</li> <li>The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater;</li> <li>Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.</li> </ul>	To minimize construction water quality impact from tunneling works	Contractor	All tunneling portion	Construction stage	<ul> <li>Water Pollution Control Ordinance</li> <li>ProPECC PN 1/94</li> <li>TM-DSS</li> <li>TM-EIAO</li> </ul>	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S6.9.1.3	W3	<ul> <li>Sewage Effluent</li> <li>Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.</li> </ul>	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	<ul> <li>Water Pollution Control Ordinance</li> <li>TM-DSS</li> </ul>	Implemented
\$6.9.1.5	W4	<ul> <li>Groundwater from Potential Contaminated Area:</li> <li>No direct discharge of groundwater from contaminated areas should be adopted.</li> <li>A discharge license under the WPCO through the Regional Office of EPD for groundwater discharge should be applied. Prior to the excavation works within these potentially contaminated areas, the groundwater quality should be reviewed during the process of discharge license application. The compliance to the Technical Memorandum on Standards for Effluents Discharged into Drainage on Sewerage Systems, Inland and Coastal Waters (TM-DSS) and the existence of prohibited substance should be confirmed. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, the contaminated groundwater should be either properly treated in compliance with the requirements of the TM-DSS or properly</li> </ul>	To minimize groundwater quality impact from contaminated area	Contractor	Excavation areas where contamination is found	Construction stage	<ul> <li>Water Pollution Control Ordinance</li> <li>TM-DSS</li> <li>TM-EIAO</li> </ul>	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>recharged into the ground.</li> <li>If wastewater treatment is deployed, the wastewater treatment unit shall deploy suitable treatment process (e.g. oil interceptor / activated carbon) to reduce the pollution level to an acceptable standard and remove any prohibited substances (e.g. TPH) to undetectable range. All treated effluent from wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be discharged into the foul sewers.</li> <li>If groundwater recharging wells are deployed, recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in the Section 2.3 of TM-DSS. The baseline groundwater quality shall be determined prior to the selection of the recharge wells, and submit a working plan (including the laboratory analytical results showing the quality of groundwater at the proposed recharge location(s) as well as the pollutant levels of groundwater at the recharge well. Prior to recharge, any prohibited substances such as TPH products should be removed as necessary by installing the petrol</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		interceptor.						
\$6.9.1.6	W6	<ul> <li>Accidental Spillage</li> <li>In order to prevent accidental spillage of chemicals, the following is recommended:         <ul> <li>All the tanks, containers, storage area should be bunded and the locations should be locked as far as possible from the sensitive watercourse and stormwater drains;</li> <li>The Contractor should register as a chemical waste producer if chemical wastes would be generated. Storage of chemical waste arising from the construction activities should be stored with suitable labels and warnings.</li> <li>Disposal of chemical wastes should be conducted in the Waste Disposal (Chemical Waste) (General) Regulation.</li> </ul> </li> </ul>	To minimize water quality impact from accidental spillage	Contractor	All construction site where practicable	Construction stage	<ul> <li>Water Pollution Control Ordinance</li> <li>ProPECC PN 1/94</li> <li>TM-EIAO</li> <li>TM-DSS</li> </ul>	• Implemented
			Waste Manage	ement (Construction	Waste)			
\$7.4.1	WM1	<ul> <li>On-site sorting of C&amp;D material</li> <li>Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite</li> </ul>	Separation of unsuitable rock from ending up at concrete batching plants and be turned into concrete for	Contractor	All construction sites	Construction stage	• DEVB (W) No. 6/2010	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		dyke rock should be separated at the source sites as far as practicable and stored at designated stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored.	structural use					
\$7.5.1	WM2	<ul> <li><u>Construction and Demolition Material</u></li> <li>Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement;</li> <li>Carry out on-site sorting;</li> <li>Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate;</li> <li>Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to</li> </ul>	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the	Contractor	All construction sites	Construction stage	<ul> <li>Land (Miscellaneo us Provisions) Ordinance</li> <li>Waste Disposal Ordinance</li> <li>ETWB TCW No. 19/2005</li> </ul>	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM3	<ul> <li>recovering broken concrete effectively for recycling purpose, where possible;</li> <li>Implement a trip-ticket system for each works contract to ensure that the disposal of C&amp;D materials are properly documented and verified; and</li> <li>Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&amp;D materials and to minimize their generation during the course of construction.</li> </ul>	amount for final disposal Good site	Contractor	All	Construction stage	• Land	• Implemented
		<ul> <li>Standard formwork or pre-fabrication should be used as far as practicable in order to minimize the arising of C&amp;D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage;</li> <li>The Contractor should recycle as much of the C&amp;D materials as possible on-site. Public fill and C&amp;D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed</li> </ul>	generation and recycle the C&D materials as far as practicable so		construction sites		<ul> <li>(Miscellaneo us Provisions) Ordinance</li> <li>Waste Disposal Ordinance</li> <li>ETWB TCW No. 19/2005</li> </ul>	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.						
\$7.5.1	WM5	<ul> <li>Land-based Sediment</li> <li>All construction plant and equipment shall be designed and maintained to minimize the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location;</li> <li>All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash;</li> <li>Before moving the vessels which are used for transporting dredged material, excess material shall be cleaned from the decks and exposed fittings of vessels and the sea except at the approved locations;</li> <li>Adequate freeboard shall be maintained on barges to ensure that decks are not washed by wave action.</li> <li>The Contractors shall monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The Contractor shall keep and produce logs and other records to demonstrate compliance and that journeys are consistent with designated locations</li> </ul>	To control pollution due to marine sediment	Contractor	Along CKR alignment	Construction stage	• ETWB TCW No. 34/2002	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>and copies of such records shall be submitted to the engineers;</li> <li>The Contractors shall comply with the conditions in the dumping licence.</li> <li>All bottom dumping vessels (Hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material;</li> <li>The material shall be placed into the disposal pit by bottom dumping;</li> <li>Contaminated marine mud shall be transported by spit barge of not less than 750m3 capacity and capable of rapid opening and discharge at the disposal site;</li> <li>Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Material adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site.</li> <li>For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping designated mud pit would be a possible arrangement. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal.</li> </ul>						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S7.5.1	WM6	<ul> <li><u>Chemical Waste</u></li> <li>Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes;</li> <li>Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation;</li> <li>The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and arranged so that incompatible materials are adequately separated;</li> <li>Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical</li> </ul>	Control the chemical waste and ensure proper storage, handling and disposal	Contractor	All construction sites	Construction stage	<ul> <li>Waste Disposal (Chemical Waste) (General) Regulation</li> <li>Code of Practice on the Packaging, Labelling and Storage of Chemical Waste</li> </ul>	• Implemented, rectified after observation.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD.						
\$7.5.1	WM7	<ul> <li><u>General Refuse</u></li> <li><u>General refuse generated on-site should be stored</u> in enclosed bins or compaction units separately from construction and chemical wastes;</li> <li>A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law.</li> <li>Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible;</li> <li>Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor.</li> </ul>	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	• Waste Disposal Ordinance	• Implemented
	1		Land Contamin	ation	1	·		
S8.9 & Appendix 8.4	LC2	<ul> <li>Excavation of the Contaminated Soil</li> <li>Prior to commencement of the excavation works at the contamination zone, the zone should be clearly marked out on site and the surface levels recorded. Excavation of contaminated material should be undertaken using dedicated earth-moving plant.</li> </ul>	The contaminated soil will be excavated for on-site reuse	Contractor	PBH4	Prior to commencement of construction works within the contaminated area	<ul> <li>Practice Guide (PG) for Investigation and Remediation</li> </ul>	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S8.9 & Appendix 8.4	LC3	<ul> <li>The excavated contaminated soils would be stockpiled at designated area on site and covered by sheet to prevent dispersion of contamination during stockpiling.</li> <li>The Contractor should pay attention to the selection of suitable groundwater lowering schemes and discharge points if the groundwater table is higher than the contaminated soils during excavation. The Contractor should also obtain a valid Water Pollution Control Ordinance (WPCO) discharge licence from EPD where applicable.</li> <li>Following completion of the excavation to the specified depth, at least one sample from the base of the excavation and four samples evenly distributed along the boundary of the excavation shall be taken for a closure assessment testing. The acceptance criterion is shown below:</li> <li>Locations Testing Acceptance Criteria</li> <li>PBH4 PCBs RBRGs (Public Park)</li> <li>If the results of analysis below the RBRGs (Public Park), no further excavation will be required.</li> <li>If the analysis indicates presence of contamination (i.e. noncompliance of the acceptance criteria), further excavation shall be carried out in 0.5m increment vertically and/or horizontally depending on</li> </ul>					of Contaminate d Land • Guidance Notes for Contaminate d Land Assessment and Remediation • Guidance Manual for Use of Risk-Based Remediation Goals (RBRGs) for Contaminate d Land Management	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		the location(s) of the sample(s) which has exceeded the acceptance criteria. Further sampling shall also be conducted for compliance testing. The process of excavation, sampling and compliance testing should continue until all contaminated materials are removed and should be supervised by a Land Contamination Specialist.						
Appendix 8.4	LC4	A Remediation Report (RR) to demonstrate adequate clean-up shall be prepared and submitted to EPD for endorsement prior to the commencement of any construction/development works within the sites. No construction/development works shall be carried out prior to the endorsement of the RR by EPD.						Implemented
				Hazard to Life				
S9.18	H1	Blasting activities regarding transport and use of explosives should be supervised and audited by competent site staff to ensure full compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives handling and transport would be acceptable	Contractor	Works areas at which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A
S9.6, para.4	H2	Detonators shall not be transported in the same vehicle with other Category 1 Dangerous Goods.	To reduce the risk of explosion during the transport of cartridged emulsion	Contractor	-	Construction stage	<ul> <li>Dangerous Goods Ordinance</li> </ul>	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.6, para.8	H3	The explosives delivery trucks should be approved by Mines Division and should meet the regulatory requirements for transport of explosives.	To comply with the requirements for approval of an explosives delivery vehicle	Contractor	-	Construction stage	Dangerous Goods Ordinance	• N/A
S9.10, para.7 and S9.18	H4	Blast cover should be provided for shaft at HMT, and kept closed during blasting. Provision of blast doors or heavy duty blast curtains should be implemented at the shaft to prevent flyrock and control the air overpressure.	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
S9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	Implemented
\$9.18	H9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H10	Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H11	Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H12	Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms and thunderstorms.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status			
					used						
S9.18	H13	For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A			
S9.18	H14	Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A			
S9.18	H22	It is recommended to explore to minimize the use of the cartridged emulsion explosives and maximize the use of bulk emulsion explosive as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A			
S9.18	H24	It is recommended to explore to use smaller explosive charges such as 'cast boosters' or 'mini-cast booster' instead of cartridged emulsion as primers for bulk emulsion. This option reduces the quantity of explosives required for transportation for the sections where bulk emulsion will be used.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A			
	Landscape & Visual										

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S10.10.1 Table 10.11	LV3	<ul> <li><u>Good Site Management</u></li> <li>Large temporary stockpiles of excavated material shall be covered with unobtrusive sheeting to prevent dust and dirt spreading to adjacent landscape areas and vegetation, and to create a neat and tidy visual appearance.</li> <li>Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance.</li> </ul>	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV4	<ul> <li><u>Screen Hoarding</u></li> <li>Decorative screen hoarding should be erected to screen the public from the construction area. It should be designed to be compatible with the existing urban context.</li> </ul>	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV5	<ul> <li>Lighting Control during Construction</li> <li>All lighting in the construction site shall be carefully controlled to minimize light pollution and night-time glare to nearby residencies and GIC. The Contractor shall consider other security measures, which shall minimize the visual impacts.</li> </ul>	Minimize visual impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV6	<ul> <li><u>Erosion Control</u></li> <li>The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil.</li> </ul>	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	<ul> <li>Tree Protection &amp; Preservation</li> <li>Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval</li> </ul>	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	<ul> <li>'Guidelines for Tree Risk Management and Assessment</li> </ul>	<ul> <li>Implemented, rectified after observation.</li> </ul>

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		in due course in accordance with ETWB TC no. 3/2006.					Arrangement on an Area Basis and on a Tree Basis', Greening, Landscape and Tree Management (GLTM) Section, DEVB • Latest recommende d horticultural practices from GLTM Section, DEVB	
S10.10.1 Table 10.11	LV8	<ul> <li>Tree Transplantation</li> <li>For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006.</li> </ul>	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	<ul> <li>ETWB TCW 3/2006</li> <li>Latest recommende d horticultural practices from Greening, Landscape and Tree</li> </ul>	• N/A


EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							Management (GLTM) Section, DEVB • ETWB TCW 2/2004	
S10.10.1 Table 10.11	LV9	<ul> <li><u>Compensatory Planting</u></li> <li>For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006.</li> <li>Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process.</li> </ul>	Minimize visual impact and also enhance landscape	Contractor	Within Project site	Construction stage	<ul> <li>ETWB TCW 3/2006</li> <li>Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB</li> <li>ETWB TCW 2/2004</li> </ul>	• N/A
			Cultural Heritage	Impact (Constructi	ion Phase)			

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S11.4.4	CH1	The contractor should be alerted during the construction on the possibility of locating archaeological remains and as a precautionary measure, AMO shall be informed immediately in case of discovery of antiquities or supposed antiquities in the subject sites.	To preserve any cultural heritage items which may be removed and damaged by the excavation	Contractor	During construction works for cut and cover tunnels	Construction stage	AMOs     requirements	Implemented
S12.6.1	СНЗ	<ul> <li>Protective covering should be provided for the buildings in the form of plastic sheeting;</li> <li>Buffer zones should be provided between the construction works and the external walls of the buildings and should be as large as site restrictions allow and be marked out by temporary fencing or hoarding;</li> <li>An underpinning scheme is required to transfer the existing column loadings to a deeper rock stratum. The supporting system includes cutting the existing ground floor slab to expose the existing pile caps and then construct transfer beams at both sides of the pile caps. The transfer beams will tie up with the existing caps. Loadings of the transfer beams will be transferred to the rock socket piles installed at the two ends of the beams;</li> <li>The AAA settlement and tilting limit should be 6/8/10 mm and1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;.</li> <li>Regular site inspections and monitoring works will</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	<ul> <li>Guidelines for Cultural Heritage Impact Assessment</li> <li>EIAO-TM Annex 10 and Annex 19</li> <li>AMO Proposed Vibration Limits</li> </ul>	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.						
\$12.6.1		<ul> <li>Adopting diaphragm wall construction method;</li> <li>Grout curtain should be provided in front of the building;</li> <li>Recharging system should be installed as a contingency measure to mitigate the fluctuation of water table;</li> <li>the AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;.</li> <li>Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	<ul> <li>Guidelines for Cultural Heritage Impact Assessment</li> <li>EIAO-TM Annex 10 and Annex 19</li> <li>AMO Proposed Vibration Limits</li> </ul>	• Implemented
S12.6.1 Table 12.2		<ul> <li>The Alert, Alarm and Action (AAA) vibration limit will be set at 3/4/5 mm/s and a condition survey shall be carried out by the project proponent prior to the construction phase to confirm this assessment</li> <li>Vibration monitoring of the structure shall be employed during the construction phase to ensure that the level is not exceeded. The monitoring proposal should be sent to AMO for comment.</li> </ul>	Protect the building from damage from construction works	Contractor	Tin Hau Temple (CKR-02)	Prior to commencement of and during the construction phase	<ul> <li>Guidelines for Cultural Heritage Impact Assessment</li> <li>EIAO-TM Annex 10 and Annex 19</li> <li>AMO</li> </ul>	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommended Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							Proposed Vibration Limits	
				EM&A Project				
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual	Control EM&A Performance	Highways Department	All construction sites	Construction stage	<ul> <li>EIAO Guidance Note No. 4/2010</li> <li>TM-EIAO</li> </ul>	Implemented
\$13.2-13.4	EM2	<ul> <li>An Environmental Team needs to be employed as per the EM&amp;A Manual;</li> <li>Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures;</li> <li>An environmental impact monitoring needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&amp;A Manual are fully complied with.</li> </ul>		Highways Department/ Contractor	All construction sites	Construction stage	<ul> <li>EIAO Guidance Note No. 4/2010</li> <li>TM-EIAO</li> </ul>	Implemented

# Appendix G Monitoring Schedule of the Reporting Month

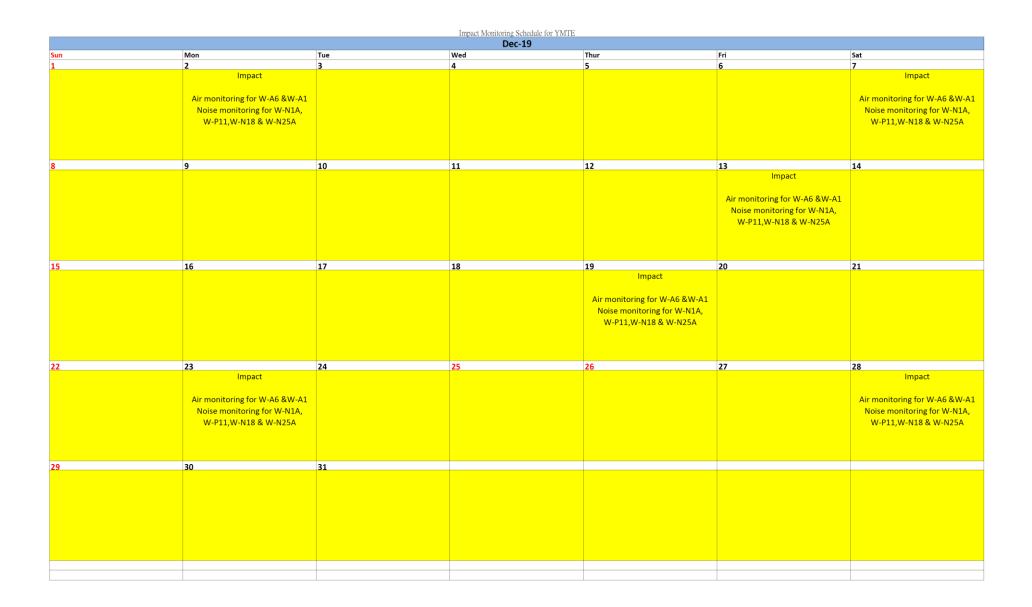

# Appendix H Calibration Certificates (Air Monitoring)

## SIBATA

SIBATA SCIENTIFIC TECHNOLOGY LTD. 1-1-62, Nakane, Soka, Saitama, 340-0005 Japan TEL: 048-933-1582 FAX: 048-933-1591

### CALIBRATION CERTIFICATE

Date: September 24th, 2019

Equipment Name	: Digital Dust Indicator, Model LD-5R
Code No.	: 080000-72
Quantity	: 1 unit
Serial No.	: 992818
Sensitivity	: 0.001 mg/m3
Sensitivity Adjustment	: 638CPM
Scale Setting	: September 3rd, 2019

We hereby certify that the above mentioned instrment has been calibrated satisfactory.

Sincerely

### SIBATA SCIENTIFIC TECHNOLOGY LTD.

Jong Shang

Tong Zhang



Overseas & New Business Group Overseas Sales Department



SIBATA SCIENTIFIC TECHNOLOGY LTD. 1-1-62, Nakane, Soka, Saitama, 340-0005 Japan TEL: 048-933-1582 FAX: 048-933-1591

### **CALIBRATION CERTIFICATE**

Date: August 28th, 2019

Equipment Name	:	Digital Dust Indicator, Model LD-5R
Code No.	:	080000-72
Quantity	:	1 unit
Serial No.	:	851820
Sensitivity	:	0.001 mg/m3
Sensitivity Adjustment	:	640
Scale Setting	:	August 23rd, 2019

We hereby certify that the above mentioned instrument has been calibrated satisfactory.


Sincerely

#### SIBATA SCIENTIFIC TECHNOLOGY LTD.

long thang

Tong Zhang Overseas & New Business Group Overseas Sales Department



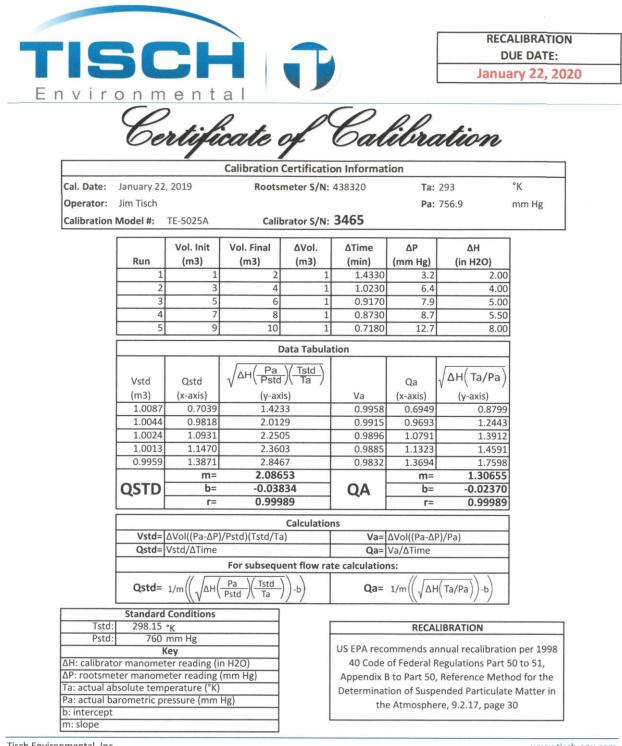

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.com TOLL FREE: (877)263-7610 FAX: (513)467-9009

創新科儀有限公司

### HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information								
	YMT Catholic Primary							
Location:	School	Site ID:	W-A1	Date:	13-Dec-2019			
Serial No:	Serial No: 1049 Model: TE-5170X Operator: Tim							

### Ambient Condition

Corrected Pressure (mm Hg):	760.0	Temperature (deg K):	298.2
confected Pressure (initi rig).	700.0	remperature (deg K).	290.2

### **Calibration Orifice**

Model:	TE-5025	Slope:	2.08653
Serial No.:	3465 Interce		-0.03834
Calibration Due Date:	22-Jan-20	Corr. Coeff:	0.99989

### **Calibration Data**

Plate or	In,H2O	In,H2O Qa, X-Axis		IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.81	0.663	34.1	34.09
2	2.31	0.747	35.7	35.69
3	3.28	0.886	38.7	38.69
4	4.17	0.997	41.0	40.99
5	5.16	1.107	43.2	43.19

### Sampler Calibration Relationship (Qa on x-axis, IC on y-axis)

m=	20.6683	b=	20.3449	Corr. Coeff=	0.9999
Samp	ler set point(SSP)	45	CFM		
		C	Calculations		
Qstd = 1/m[Sqrt(H	2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/Pstd	l)(Tstd/Ta)]		b = sampler intercept		
			I = chart response		
Qstd = standard flo	w rate		Tav = average temperature		
IC = corrected char	t response		Pav = average pressure		
I = actual chart response					
m = calibrator Qst	d slope				
b = calibrator Qstd	intercept				
Ta = actual tempera	ture during calibration (deg K)				
Pa = actual pressure	e during calibration (mm Hg)				
Tstd = 298 deg K					
Pstd = 760 mm Hg					
For subsequent calculation of sampler flow:					
(1.21*m+b)/[Sqrt(2	•				
	72				
	Tim				
Checked by:			Date:	13-De	ec-19

創新科儀有限公司

### HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information						
YMT Catholic Primary						
Location:	School	Site ID:	W-A1	Date:	28-Dec-2019	
Serial No:	1049	Model:	TE-5170X	Operator:	Tim	

### **Ambient Condition**

Corrected Pressure (mm Hg):	760.0	Temperature (deg K):	298.2
	·		

### **Calibration Orifice**

Model:	TE-5025	Slope:	2.08653
Serial No.:	3465	Intercept:	-0.03834
Calibration Due Date:	22-Jan-20	Corr. Coeff:	0.99989

### **Calibration Data**

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.67	0.638	33.4	33.39
2	2.28	0.742	35.5	35.49
3	3.35	0.895	38.9	38.89
4	4.23	1.004	41.2	41.19
5	5.14	1.105	43.3	43.29

### Sampler Calibration Relationship (Qa on x-axis, IC on y-axis)

m=	21.3304	b=	19.7509	Corr. Coeff=	0.9999
Sample	r set point(SSP)	46	CFM		
	· · · · -	(	Calculations		
Ostd = 1/m[Sart(H2)]	O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/Pstd)(			b = sampler intercept		
10 - 1[041(1 #1 3@)(	1500/10/]		I = chart response		
Qstd = standard flow	rate		T = chartresponse Tav = average temperature		
IC = corrected chart r			Pav = average pressure		
I = actual chart responses	*		Tuv – uvorago prosouro		
m = calibrator Qstd					
b = calibrator Qstd in	-				
-	re during calibration (deg K)				
	during calibration (mm Hg)				
Tstd = $298 \text{ deg K}$	auning cultoration (initi Tig)				
Pstd = $760 \text{ mm Hg}$					
0	lation of sampler flow:				
(1.21*m+b)/[Sqrt(29					
(1.21°III+0)/[34]I(29	0/10//10//				
	Tim				
Checked by:			Date:	28-De	ec-19

創新科儀有限公司

### HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information					
Location:	Man Cheong Building	Site ID:	W-A6	Date:	13-Dec-2019
Serial No:	1050	Model:	TE-5170X	Operator:	Tim

### **Ambient Condition**

Corrected Pressure (mm Hg):	760.0	Temperature (deg K):	298.2

### **Calibration Orifice**

Model:	TE-5025	Slope:	2.08653
Serial No.:	3465	Intercept:	-0.03834
Calibration Due Date:	22-Jan-20	Corr. Coeff:	0.99989

### **Calibration Data**

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.77	0.656	27.8	27.79
2	2.41	0.762	30.6	30.59
3	3.59	0.926	35.7	35.69
4	4.35	1.018	38.2	38.19
5	5.29	1.120	41.3	41.29

### Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	29.2375	b=	8.5006	Corr. Coeff=	0.9997
Sampler set point(SSP)		44	CFM		
		C	Calculations		
Qstd = 1/m[Sqrt(H	H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/Pst	d)(Tstd/Ta)]		b = sampler intercept		
			I = chart response		
Qstd = standard flo	ow rate		Tav = average temperature		
IC = corrected char	rt response		Pav = average pressure		
I = actual chart resp	ponse				
m = calibrator Qst	td slope				
b = calibrator Qsto	d intercept				
Ta = actual temper	ature during calibration (deg K)				
Pa = actual pressur	re during calibration (mm Hg)				
Tstd = 298 deg K					
$Pstd = 760 mm H_2$	g				
For subsequent calculation of sampler flow:					
(1.21*m+b)/[Sqrt(	(298/Tav)(Pav/760)]				
	Tim				
Checked by:			Date:	13-De	ec-19

創新科儀有限公司

### HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

		Site	Information		
Location:	Man Cheong Building	Site ID:	W-A6	Date:	28-Dec-2019
Serial No:	1050	Model:	TE-5170X	Operator:	Tim

### Ambient Condition

Corrected Pressure (mm Hg):	760.0	Temperature (deg K):	298.2

### Calibration Orifice

Model:	TE-5025	Slope:	2.08653
Serial No.:	3465	Intercept:	-0.03834
Calibration Due Date:	22-Jan-20	Corr. Coeff:	0.99989

### **Calibration Data**

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	2.21	0.731	26.3	26.29
2	3.29	0.887	32.4	32.39
3	4.61	1.047	39.1	39.09
4	5.72	1.164	43.5	43.49
5	5.93	1.185	44.5	44.49

### Sampler Calibration Relationship (Qa on x-axis, IC on y-axis)

m=	40.0317	b=	-2.9993	Corr. Coeff=	0.9999
Sam	pler set point(SSP)	45	CFM		
		c	Calculations		
Qstd = 1/m[Sqrt()]	H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/Ps	td)(Tstd/Ta)]		b = sampler intercept		
			I = chart response		
Qstd = standard f	low rate		Tav = average temperature		
IC = corrected cha	art response		Pav = average pressure		
I = actual chart res	sponse				
m = calibrator Qs	std slope				
b = calibrator Qst	td intercept				
Ta = actual tempe	rature during calibration (deg K)				
Pa = actual pressu	re during calibration (mm Hg)				
Tstd = 298 deg K					
Pstd = 760  mm H	lg				
For subsequent ca	lculation of sampler flow:				
(1.21*m+b)/[Sqrt	(298/Tav)(Pav/760)]				
	Tim				
Checked by:			Date:	28-De	ec-19

# Appendix I Calibration Certificates (Noise)

(A+A)\*L Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

# Certificate of Calibration

for

Description:	Sound Level Meter
Manufacturer:	NTi Audio
Type No.:	XL2 (Serial No.: A2A-13548-E0)
Microphone:	ACO 7052 (Serial No.:60997)
Preamplifier:	NTi Audio MA220 (Serial No.:5287)
	Submitted by:

Customer: Acuity Sustainability Consulting Limited Address: Unit 1908, iPlace, Nos. 301-305 Castle Peak Road, Kwai Chung, New Territories

Upon receipt for calibration, the instrument was found to be:



the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 8 January 2019

Date of issue: 10 January 2019

Certificate No.: APJ18-157-CC001

Date of calibration: 10 January 2019

fla

Calibration Technician

Certified by: Mr. Ng Yan Wa Laboratory Manager

Page 1 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong Tel: (852) 2668 3423 Fax:(852) 2668 6946 Homepage: http://www.aa-lab.com E-mail : inquiry@aa-lab.com

Calibrated by:

### (A+A)\*L Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

### 1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

### 2. Calibration Conditions:

Air Temperature:	22.3 °C
Air Pressure:	1006 hPa
Relative Humidity:	71.3 %

### 3. Calibration Equipment:

	Туре	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV180064	HOKLAS

### 4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq. Weighting Time Weighting		Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

Time Weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Range, dB Freq. Weighting Time Weighting		Level, dB	Frequency, Hz	dB	Specification, dB	
30-130	dBA	SPL	Fast	0.4	1000	94.0	Ref
30-130	¢ВА	SPL	Slow	94	1000	94.0	±0.3

Certificate No.: APJ18-157-CC001

Page 2 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong Tel: (852)26683423 Fax:(852)26686946 Homepage: http://www.aa-lab.com E-mail : inquiry@aa-lab.com

### (A+A)\*L Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

### Frequency Response

Linear Response

Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq. We	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	94.0	±2.0
					63	94.1	+1.5
					125	94.1	±1.5
					250	94.0	±1.4
30-130	dB	SPL	Fast	94	500	94.0	±1.4
					1000	94.0	Ref
					2000	93.8	±1.6
					4000	93.8	±1.6
					8000	92.7	+2.1;-3.1

A-weighting

Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, IIz	dB	Specification, dB
					31.5	54.8	-39.4 ±2.0
					63	67.9	-26.2±1.5
					125	78.0	-16.1±1.5
					250	85.4	$-8.6 \pm 1.4$
30-130	dBA	SPL	Fast	94	500	90.8	-3.2±1.4
					1000	94.0	Ref
					2000	95.1	+1.2±1.6
					4000	94.8	$+1.0\pm1.6$
					8000	91.6	-1.1+2.1; -3.1

C-weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	91.0	-3.0±2.0
					63	93.2	-0.8±1.5
					125	93.9	-0.2±1.5
					250	94.0	$-0.0 \pm 1.4$
30-130	dBC	SPL	Fast	94	500	94.0	-0.0+1.4
					1000	94.0	Ref
					2000	93.7	-0.2±1.6
					4000	93.0	-0.8±1.6
					8000	89.7	-3.0 +2.1: -3.1

Certificate No.: APJ18-157-CC001

Page 3 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong Tel: (852) 2668 3423 Fax:(852) 2668 6946 Homepage: http://www.aa-lab.com E-mail : inquiry@aa-lab.com

# (A+A)\*L Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

### 5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

94 dB	31.5 Hz	± 0.05
	63 Hz	± 0.05
	125 Hz	+ 0.10
	250 Hz	± 0.10
	500 Hz	± 0.10
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.10
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

Uncertainties of Applied Value:

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)\*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ18-157-CC001

Page 1 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong Tel: (852) 2668 3423 Fax:(852) 2668 6946 Homepage: http://www.aa-lab.com E-mail : inquiry@aa-lab.com



### **CALIBRATION CERTIFICATE**

Customer Information         Company Name       Acuity Sustainability Consulting Limited         Address       Unit 1908, Nos. 301-305 Castle Peak Road,         Kwai Chung, N.T.       Equipment-under-Test (EUT)         Description       Acoustic Calibrator         Pulsar       Model Number         105       Serial Number         Equipment Number       63705         Equipment Number       EasSep-2019         Calibration Particular       28-Sep-2019         Date of Calibration       28-Sep-2019         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         Relative Humidity       55% ± 25%         Over 3 hours       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-2019         Approved By & Date       Za-Sep-2019	Certificate Information	on	和社会主要的主义的		
Company Name       Acuity Sustainability Consulting Limited         Address       Unit 1908, Nos. 301-305 Castle Peak Road,         Kwai Chung, N.T.       Equipment-timeder-Text (EUT)         Description       Acoustic Calibrator         Manufacturer       Pulaar         Model Number       105         Serial Number       63705         Equipment Number       -         Calibration Particular       Equipment         Date of Calibration       28-Sep-2019         Calibration Equipment       28-Sep-2019         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         Relative Humidity       55% ± 25%         EUT       Stabilizing Time         Warm-up Time       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-2019         Statements       28-Sep-2019         Calibration Certificate only relate to the values measured at the time of the calibration and hock during transportation, seption and the succetal data were detailed in the continuation pages.         Calibration Results       Calibration certificate only relate to the values measured at the time of th	Date of Issue	28-Sep-2019		Certificate Number MLC	N192490S
Address       Unit 1908, Nos. 301-305 Castle Peak Road,         Kwai Chung, N.T.       Equipment-under-Test (EUT)         Description       Acoustic Calibrator         Manufacturer       Pulsar         Model Number       105         Serial Number       63705         Equipment Number       -         Calibration       28-Sep-2019         Calibration Equipment       28-Sep-2019         Calibration Porcedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         Temperature       23 °C ± 5 °C         Relative Humidity       55% ± 25%         Over 3 hours       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-201?         Statemation result was out of EUT specification.       28-Sep-201?         Statemation result was out of EUT specification.       28-Sep-201?         Calibration capingenet used for this calibration are traceable to national / international standards.       *         Calibration capingenet used for this calibration are traceable to national / international standards.       *         *       The result sio on this Calibration Certificate only relate	Customer Informatio	n			
Kwai Chung, N.T.         Equipment-under-Text (EUT)         Description       Acoustic Calibrator         Manufacturer       Pulsar         Model Number       105         Serial Number       63705         Equipment Number       -         Calibration Particular         Date of Calibration       28-Sep-2019         423 (MLTE008) / AV180068 / 13-May-20         1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         Relative Humidity       55% ± 25%         EUT       Stabilizing Time         Nover Supply       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration Results       Calibration are traceable to national / international standards.         Statements       Calibration certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishanding unsue, and the calibration camered. Calibration cerificate may be reproduced will not include allowance for the EUT long term drift, variation with environmental changes, winto an a shock during transportation, evered will not	Company Name	Acuity Sustainab	oility Consulting Limite	ed	
Equipment-t-under-Test (EUT)         Description       Acoustic Calibrator         Manufacturer       Pulsar         Model Number       105         Serial Number       63705         Equipment Number       -         Calibration Particular       28-Sep-2019         Calibration Equipment       23 (MLTE008) / AV180068 / 13-May-20         Table of Calibration Equipment       23:(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         EUT       Stabilizing Time         Years Supply       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-2019         Staternets       Calibration result was out of EUT specification.         Staternets       Calibration centricate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishanding missue, and the calibration certificate only relate to the values measurement.         * One only of this Certificate conly relate to the values measurement.         * One calibration cerupr	Address			oad,	
Description       Acoustic Calibrator         Manufacturer       Pulsar         Model Number       105         Serial Number       63705         Equipment Number       -         Calibration Particular       -         Date of Calibration       28-Sep-2019         Calibration Equipment       4231(MLTE008) / AV180068 / 13-May-20         1357(MLTE190) / MLEC19/05/02 / 26-May-20       1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory       Temperature Relative Humidity       23 °C ± 5 °C         Stabilizing Time       Over 3 hours       Over 3 hours         Warm-up Time       Not applicable       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.       28-Sep-2019         Statements       Calibration are traceable to national / international standards.       28-Sep-2019         Statements       Calibration are traceable to national / international standards.       38-Sep-2019         * One results on this Calibration are traceable to national / international standards.       38-Sep-2019         * Calibration equipment used for this calibration are traceable to national / internationand shock during transportation, overloading, misusea, and the cap		Kwai Chung, N.	Г.		
Description       Acoustic Calibrator         Manufacturer       Pulsar         Model Number       105         Serial Number       63705         Equipment Number       -         Calibration Particular       -         Date of Calibration       28-Sep-2019         Calibration Equipment       4231(MLTE008) / AV180068 / 13-May-20         1357(MLTE190) / MLEC19/05/02 / 26-May-20       1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory       Temperature Relative Humidity       23 °C ± 5 °C         Stabilizing Time       Over 3 hours       Over 3 hours         Warm-up Time       Not applicable       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.       28-Sep-2019         Statements       Calibration are traceable to national / international standards.       28-Sep-2019         Statements       Calibration are traceable to national / international standards.       38-Sep-2019         * One results on this Calibration are traceable to national / international standards.       38-Sep-2019         * Calibration equipment used for this calibration are traceable to national / internationand shock during transportation, overloading, misusea, and the cap					
Manufacturer       Pulsar         Model Number       105         Serial Number       63705         Equipment Number          Calibration Particular          Calibration Equipment       28-Sep-2019         Calibration Equipment       4231(MLTE008) / AV180068 / 13-May-20         1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         Provent Supply       23 °C ± 5 °C         Not applicable       Over 3 hours         Power Supply       Not applicable         Power Supply       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-2019         Stutentist       28-Sep-2019         Stutentist       28-Sep-2019         Stutentist       28-Sep-2019         Calibration certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include alloware for the EUT long term difficate invironmental changes, vibration and shock during transportation, overloading, missue, and the capacity of any other laboratory to repeat the measurement.         * The results on this Cali	Equipment-under-Te	st (EUT)			
Model Number       105         Serial Number       63705         Equipment Number       -         Calibration         Calibration Equipment       28-Sep-2019         Calibration Equipment       28-Sep-2019         4231(MLTE008) / AV180068 / 13-May-20       1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         Relative Humidity       55% ± 25%         EUT       Stabilizing Time         Warm-up Time       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-2019         Statements       Calibration result was out of EUT specification.         Statements       Calibration conjument used for this calibration are traceable to national / international standards.         * The results on this Calibration Centrificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowane for the EUT hog term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         * Mataba Calibration Cerent Limited shall not be laboratory to repeat	Description		itor		
Serial Number       63705         Equipment Number          Calibration Particular       28-Sep-2019         Qalibration Equipment       28-Sep-2019         4231(MLTE008) / AV180068 / 13-May-20       1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory         Temperature       23 °C ± 5 °C         Relative Humidity       55% ± 25%         Over 3 hours       Not applicable         Not applicable       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-2019         Studements       Second filteration are traceable to national / international standards.         * Calibration equipment used for this calibration are traceable to national / international standards.       * The results on this Calibration Centrificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT hog term drift, variation with environmental changes, vibration and shock during transportation, overloading, misuse, and the capacity of any other laboratory to repeat the measurement.         * MaxLab Calibration Centre Limited shall not be labole for any loss or damage resulting from the use of the EUT.         * MaxLab Calibration Center Limited shall not be labole for any loss	Manufacturer	Pulsar			
Equipment Number	Model Number				
Calibration Particular         Date of Calibration         Calibration Equipment         Calibration Equipment         Calibration Equipment         Calibration Equipment         Calibration Procedure         MLCG00, MLCG15         Calibration Conditions         Laboratory         Temperature         Calibration Conditions         Laboratory         Temperature         Calibration Conditions         Laboratory         Warm-up Time         Not applicable         Power Supply         Internal battery         Calibration Results         Calibration adata were detailed in the continuation pages.         Calibration result was out of EUT specification.         Statements         Calibration contificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term offit, variation with environmental changes, vibration and the uncertainties quoted will not include allowance for the EUT long term offit, variation with environmental changes, vibration detaindending, missue, and the capacity of any other		63705			
Date of Calibration       28-Sep-2019         Calibration Equipment       4231(MLTE008) / AV180068 / 13-May-20         1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory       Temperature         Baboratory       Relative Humidity         EUT       Stabilizing Time         Warm-up Time       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       28-Sep-2019         Stutements       Stutement was out of EUT specification.         Stutements       The results on this calibration are traceable to national / international standards.         * The results on this Calibration Certificate only relate to the values measurement.       MaxLab Calibration and the use of the EUT.         * MaxLab Calibration Certificate is owned by MaxLab Calibration Centre Limited shall not be labe for any loss or damage resulting from the use of the EUT.	Equipment Number				
Calibration Equipment       4231(MLTE008) / AV180068 / 13-May-20 1357(MLTE190) / MLEC19/05/02 / 26-May-20         Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory       Temperature Relative Humidity       23 °C ± 5 °C 55% ± 25%         EUT       Stabilizing Time Warm-up Time Power Supply       Dover 3 hours         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Approved By & Date       Two Stabilizing Time Warm-up Time Power Supply       Two Stabilizing Time Not applicable Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Statements       Two Stabilization on the calibration are traceable to national / international standards.         * The results on this calibration are traceable to national / international standards.         * The results on the Calibration certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         * MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         * MaxLab Calibration Centre Limited Science on a damage resulting from the use of the EUT.         <	Calibration Particula	nr -			
Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory       Temperature Relative Humidity       23 °C ± 5 °C         Stabilizing Time       Over 3 hours       Not applicable         Power Supply       Not applicable       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Approved By & Date       Fm Cank, O. Lo       28-Sep-2019         Statibration equipment used for this calibration are traceable to national / international standards.       28-Sep-2019         Station and the contribution out for this calibration are traceable to national / international standards.       28-Sep-2019         Markab Calibration Centrificate only relate to the values measured at the time of the calibration, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.       38 Markab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         *       Markab Calibration Centre Limited Science Centre Limited. No part of this Certificate may be reproduced without the prior	Date of Calibration				
Calibration Procedure       MLCG00, MLCG15         Calibration Conditions       Laboratory       Temperature Relative Humidity       23 °C ± 5 °C         EUT       Stabilizing Time Warm-up Time Power Supply       Over 3 hours         Not applicable       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Approved By & Date       State Calibration are traceable to national / international standards.         *       Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         *       MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         *       MaxLab Calibration Centre Limited Aball Calibration Centre Limited. No part of this Certificate may be reproduced without the prior	Calibration Equipment				
Calibration Conditions       Laboratory       Temperature Relative Humidity       23 °C ± 5 °C         Stabilizing Time Warm-up Time Power Supply       Over 3 hours       Over 3 hours         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.       Not applicable         Approved By & Date       FW K.O. Lo       28-Sep-2019         Statements       * Calibration are traceable to national / international standards.       28-Sep-2019         Statements       * Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         * MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         * The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior		1357(MLTE190	)/ MLEC19/05/02/26	-May-20	
Calibration Conditions       Laboratory       Temperature Relative Humidity       23 °C ± 5 °C         Stabilizing Time Warm-up Time Power Supply       Over 3 hours       Over 3 hours         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.       Not applicable         Approved By & Date       FW K.O. Lo       28-Sep-2019         Statements       * Calibration are traceable to national / international standards.       28-Sep-2019         Statements       * Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         * MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         * The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior					
Relative Humidity       55% ± 25%         EUT       Stabilizing Time         Warm-up Time       Not applicable         Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages.         Calibration result was out of EUT specification.       Statilization         Approved By & Date       Fm Querconstructure         Statistion equipment used for this calibration are traceable to national / international standards.       28-Sep-2019         Statistion equipment used for this calibration are traceable to national / international standards.       28-Sep-2019         MaxLab Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, misuse, and the capacity of any other laboratory to repeat the measurement.         MaxLab Calibration Centre Limited shall not be liable for any loss or dmage resulting from the use of the EUT.         * The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No gram of this Certificate may be reproduced without the prior	<b>Calibration Procedure</b>	MLCG00, MLC	G15		
EUT       Stabilizing Time Warm-up Time Power Supply       Over 3 hours Not applicable Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Approved By & Date       Fm Querk O. Lo         Statements       28-Sep-2019         Statements       • Calibration certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         • MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         • The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior	<b>Calibration Conditions</b>	Laboratory	Temperature	$23 \degree C \pm 5 \degree C$	
Warm-up Time Power Supply       Not applicable Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Approved By & Date       Fm Mark O. Lo       28-Sep-2019         Statements       Calibration are traceable to national / international standards.       28-Sep-2019         Mark D Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, misuse, and the capacity of any other laboratory to repeat the measurement.       Mark B Calibration Centre Limited shall not be liable for any loss or dmage resulting from the use of the EUT.         * The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior			Relative Humidity	55% ± 25%	
Power Supply       Internal battery         Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Approved By & Date       Try Carconal State         Statements       28-Sep-2019         Statements       • Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, misuse, and the capacity of any other laboratory to repeat the measurement.         MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.       • The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior		EUT	Stabilizing Time	Over 3 hours	
Calibration Results       Calibration data were detailed in the continuation pages. Calibration result was out of EUT specification.         Approved By & Date       Fm Querk O. Lo       28-Sep-2019         Statements       * Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         * MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         * The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior					
Calibration result was out of EUT specification.         Approved By & Date         Fm Cark, O. Lo         28-Sep-2019         Statements         * Calibration equipment used for this calibration are traceable to national / international standards.         * The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         * MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         * The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior					
Approved By & Date       Fm CanK.O. Lo       28-Sep-2019         Statements       * Calibration equipment used for this calibration are traceable to national / international standards.       *       28-Sep-2019         * Calibration equipment used for this calibration are traceable to national / international standards.       *       *         * The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         * MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         * The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior	Calibration Results			1 0	
For Loc. Lo     28-Sep-2019     Statements     Calibration equipment used for this calibration are traceable to national / international standards.     The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.     MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.     The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior		Calibration resul	It was out of EUT spec	infication.	
For Loc. Lo     28-Sep-2019     Statements     Calibration equipment used for this calibration are traceable to national / international standards.     The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.     MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.     The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior					
For Loc. Lo     28-Sep-2019     Statements     Calibration equipment used for this calibration are traceable to national / international standards.     The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.     MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.     The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior					
For Loc. Lo     28-Sep-2019     Statements     Calibration equipment used for this calibration are traceable to national / international standards.     The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.     MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.     The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior	Approved By & Date				
Statements         Calibration equipment used for this calibration are traccable to national / international standards.         The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior				Frin	
Statements         Calibration equipment used for this calibration are traccable to national / international standards.         The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.         MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.         The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior				CenK.O. Lo	28-Sep-2019
<ul> <li>The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.</li> <li>MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.</li> <li>The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior</li> </ul>	Statements				
<ul> <li>include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.</li> <li>MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.</li> <li>The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior</li> </ul>					atad will not
<ul> <li>MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EU1.</li> <li>The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior</li> </ul>					
* The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior					
					out the prior
				,	

Page 1 of 2

萬 儀 校 正 中 心 有 限 公 司 MaxLab Calibration Centre Limited 香港新界葵涌華星街 16-18 號保盈工業大廈 9 樓 B2 室 Unit B2, 9/F., Boldwin Industrial Bldg., 16-18 Wah Sing Street, Kwal Chung, N.T., Hong Kong Tel: (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk



Certificate No.

MLCN192490S

Calibration Data				
EUT Setting	Standard Reading	EUT Error from Setting	Calibration Uncertainty	EUT Specification
94 dB	93.8 dB	-0.2 dB	0.20 dB	± 0.2 dB

- END -

Calibrated By : Date :

Dan 28-Sep-19

Checked By : Date :

K.O. Lo 28-Sep-19 Page 2 of 2

萬 儀 校 正 中 心 有 限 公 司 MaxLab Calibration Centre Limited 香港新界芸涌華星街 16-18 號保盈工業大廈 9 樓 B2 室 Unit B2, 9/F., Boldwin Industrial Bldg., 16-18 Wah Sing Street, Kwai Chung, N.T., Hong Kong Tel; (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk

# Appendix J The Certification of Laboratory with HOKLAS Accredited Analytical Tests



Hong Kong Accreditation Service 香港認可處

### Certificate of Accreditation 認可證書

This is to certify that 特此證明

### ALS TECHNICHEM (HK) PTY LIMITED

11/F., Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 為香港認可處執行機關根據認可證詢委員會建議而接受的

> HOKLAS Accredited Laboratory 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO / IEC 17025 : 2005 – General requirements for the competence 此實驗所符合ISO / IEC 17025 : 2005 – 《測試及校正實驗所能力的通用規定》所訂的要求。 of testing and calibration laboratories and it has been accredited for performing specific tests or calibrations as 獲認可進行載於香港實驗所認可計劃《認可實驗所名冊》內下述測試類別中的指定 listed in the HOKLAS Directory of Accredited Laboratories within the test category of 测試或校正工作

#### Environmental Testing 環境測試

This laboratory is accredited in accordance with the recognized international Standard ISO / IEC 17025 : 2005. 本實動所乃根據公認的國際標準 ISO / IEC 17025 : 2005 獲得證可。 This accreditation demonstrates technical compatence for a defined scope and the operation of a laboratory 選項證可資格深示在指定範疇所需的技術能力及實驗所質量的理解系的運作 quality management system (see joint IAF-ILAC-ISO Communique). (見國際證可論壇、國際實驗所認可含作輻膜及國際標準化組織的融合公記)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 香港認可處執行機關的權限在此蓋上通用印章

CHAN Sing Sing, Terence, Executive Administrator 執行幹事 陳成城 Issue Date: 5 May 2009 簽發日期:二零零九年五月五日

Registration Number: HOKLAS 066 註冊號碼:



Date of First Registration : 15 September 1995 首次註冊日期 : 一九九五年九月十五日

This certilicate is issued subject to the terms and conditions laid down by HKAS 本證書按照香港銀可處訂立的條款及條件發出 L 000552



Hong Kong Accreditation Service 香港認可處

### Certificate of Accreditation 認可證書

This is to certify that 特此證明

#### ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Lot 12, Tam Kon Shan Road, North Tsing Yi, New Territories, Hong Kong 香港新界青衣北担杆山路12路段

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 在認可諮詢委員會的建議下獲香港認可處執行機關接受為

> HOKLAS Accredited Laboratory 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO/IEC 17025:2005 and it has been accredited for performing specific tests or calibrations as listed in the scope of accreditation within the test category of

**Environmental Testing** 

此實驗所符合ISO/IEC 17025:2005所訂的要求 並獲認可進行載於認可範圍內下述測試類別中的指定測試或校正工作

### 環境測試

This accreditation to ISO/IEC 17025:2005 demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (see joint IAF-ILAC-ISO Communiqué). 此項 ISO/IEC 17025:2005 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套實驗所質量管理體系(見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

WONG Wang-wan, Executive Administrator 執行幹事 黃宏華 Issue Date : 16 July 2014 簽發日期 : 二零一四年七月十六日

Registration Number : HOKLAS 241 註冊號碼:


This certificate is issued subject to the terms and conditions laid down by HKAS 本證書按照言港認可處訂立的條款及條件發出



Date of First Registration : 16 July 2014 首次註冊日期:二零一四年七月十六日

L 001195

# Appendix K Location Plan of Noise and Air Quality Monitoring Station

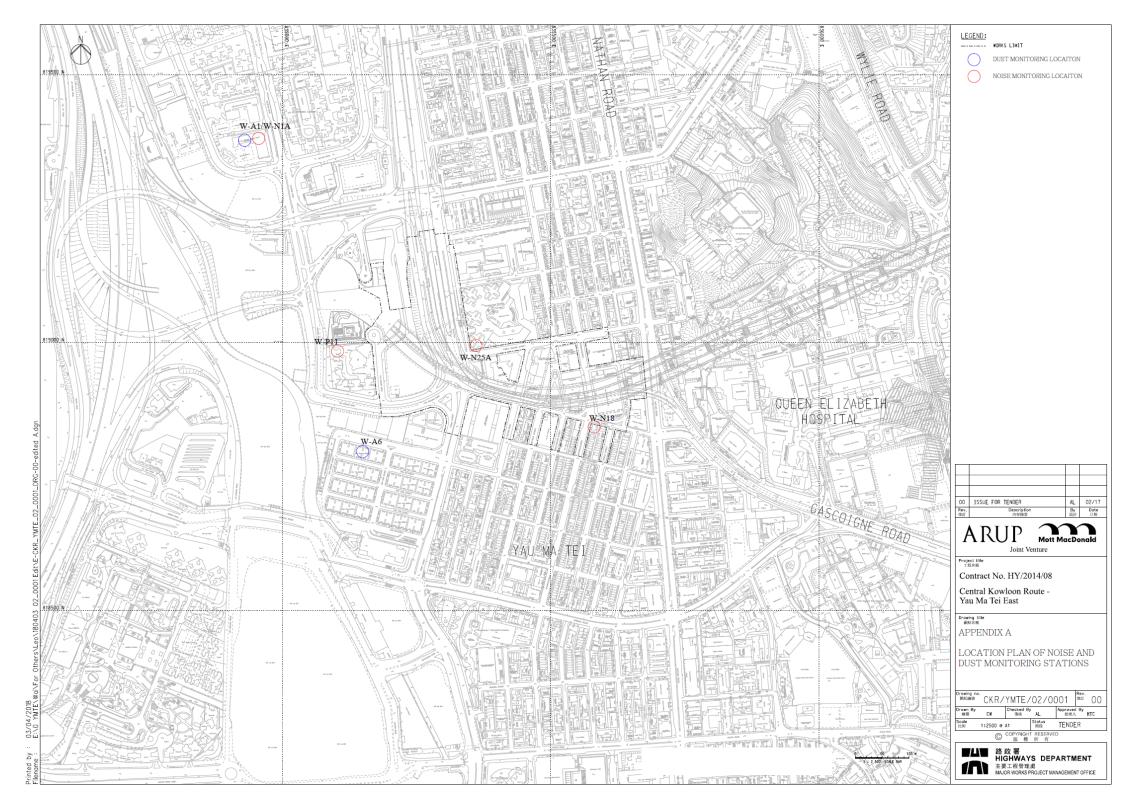

# Appendix L Monitoring Data (Air Monitoring)


Location:	Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	TSP 1-hour
Other Factors	nearby traffic, construction work from West Kowloon Government
	Offices, school activities


	<b>1-hour TSP (μg/m<sup>3</sup>)</b>							
Date	Weather	Start Time	1 <sup>st</sup> Hour (μg/m <sup>3</sup> )	2 <sup>nd</sup> Hour (μg/m <sup>3</sup> )	3 <sup>rd</sup> Hour (μg/m <sup>3</sup> )			
02/12/2019	Sunny	9:40	56	44	49			
07/12/2019	Fine	10:48	55	48	52			
13/12/2019	Sunny	10:00	60	66	57			
19/12/2019	Fine	10:12	52	57	60			
23/12/2019	Fine	9:30	48	51	45			
28/12/2019	Sunny	9:45	47	46	43			

Location:	Man Cheong Building (W-A6)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	TSP 1-hour
Other Factors	Nearby traffic

	<b>1-hour TSP (μg/m<sup>3</sup>)</b>									
Date	Weather	Start Time	1 <sup>st</sup> Hour (μg/m <sup>3</sup> )	2 <sup>nd</sup> Hour (μg/m <sup>3</sup> )	3 <sup>rd</sup> Hour (μg/m <sup>3</sup> )					
02/12/2019	Sunny	9:10	48	57	52					
07/12/2019	Fine	10:33	56	51	47					
13/12/2019	Sunny	10:38	55	59	46					
19/12/2019	Fine	9:40	47	51	53					
23/12/2019	Fine	11:28	59	62	67					
28/12/2019	Sunny	9:18	53	57	51					



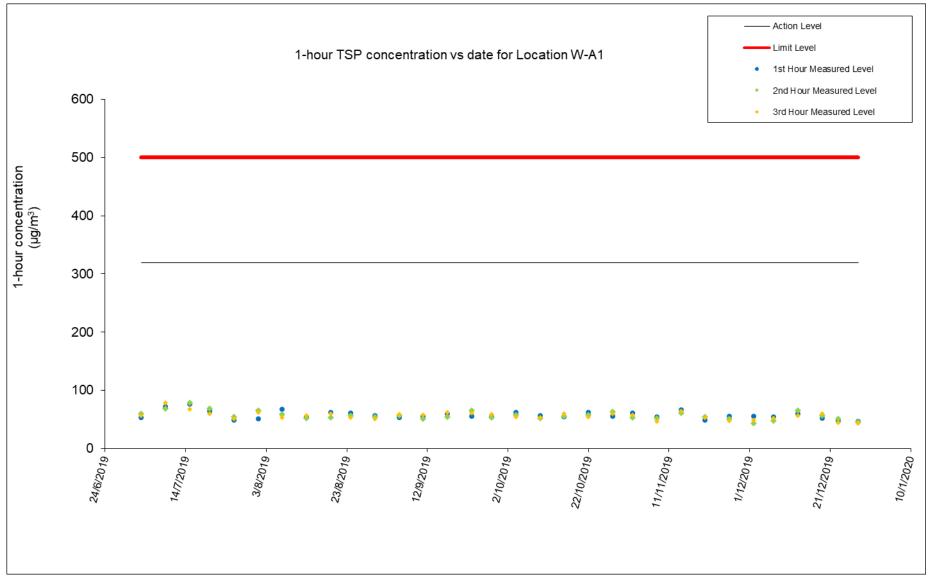

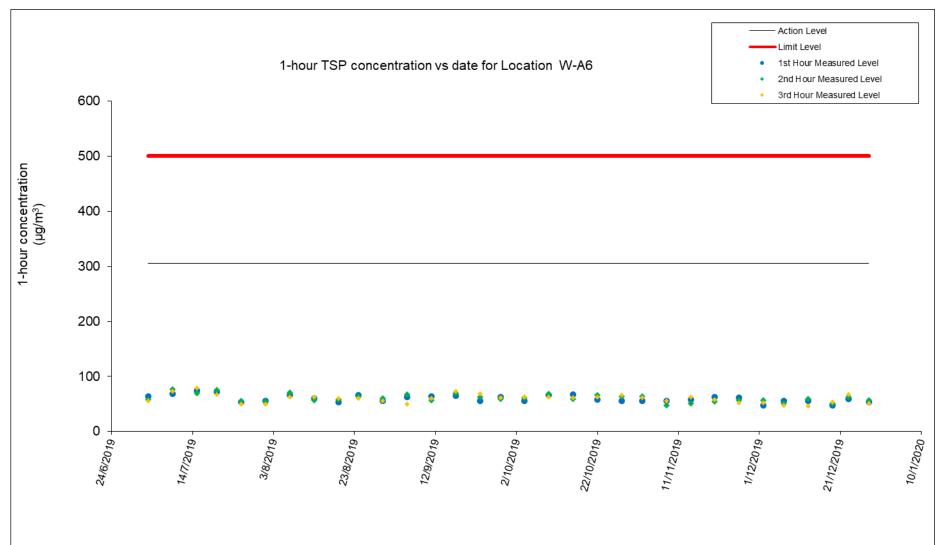


### Figure 2: Graphical Illustration of Measured 1-hour TSP (µg/m<sup>3</sup>) Levels at W-A6

Location:	Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	TSP 24-hour
Other Factors	nearby traffic

										Date of 0	Calibration:	26-Nov-19		Slop =	19.4516
											Calibration due date: 11-Dec-19			Intercept =	21.2552
					Ţ					Date of Calibration: 13-Dec-20			Slop =	20.6683	
										Calibration due date: 28-Dec-20				Intercept =	20.3449
											Calibration:	28-Dec-20		Slop =	21.3304
											n due date:	12-Jan-21		Intercept =	19.7509
Start Date	Weather		Elapse Time		Chart Reading		Avg Air Temp Avg Air Pressure		Flow Rate Standard Volume		Filter Weight (g)		Particulate weight	Conc.	
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(mm Hg)	(m <sup>3</sup> /min)	(m <sup>3</sup> )	Initial	Final	(g)	$(\mu g/m^3)$
2/12/2019	Sunny	2927.7	2951.7	1440.00	43	45	44.0	17.4	1021.6	1.99	2862	2.7614	2.9109	0.1495	52
7/12/2019	Fine	2951.8	2975.8	1440.00	42	44	43.0	16.2	1024.8	1.93	2784	2.7839	2.8842	0.1003	36
13/12/2019	Sunny	2976.1	3000.1	1440.00	44	46	45.0	19.2	1022.4	1.97	2842	2.7051	2.8133	0.1082	38
19/12/2019	Fine	3000.2	3024.2	1440.00	43	45	44.0	19.8	1019.8	1.90	2732	2.7529	2.8763	0.1234	45
23/12/2019	Fine	3024.3	3048.3	1440.00	44	44	44.0	20.0	1016.7	1.86	2674	2.7007	2.7996	0.0989	37
28/12/2019	Sunny	3048.5	3072.5	1440.00	43	44	43.5	18.5	1020.2	1.84	2652	2.7135	2.8627	0.1492	56

Location:	Man Cheong Building (W-A6)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	TSP 24-hour
Other Factors	nearby traffic

				Г						Calibration:	26-Nov-19	Slop =		29.2452	
									Calibratio	n due date:	11-Dec-19	Intercept =		8.5089	
									Date of 0	Calibration:	13-Dec-19		29.2375		
									Calibratio	n due date:	28-Dec-19		Intercept =	8.5006	
									Date of 0	Calibration:	28-Dec-19		Slop =		
									Calibratio	n due date:	12-Jan-20	-	Intercept =	-2.9993	
Weather Condition		Elapse Time		Chart Reading		Avg Air Temp	Avg Atmospheric Pressure		Flow Rate Standard Air Filter Weight (g Volume		t (g)	Particulate weight	Conc.		
Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(mm Hg)	(m <sup>3</sup> /min)	(m <sup>3</sup> )	Initial	Final	(g)	$(\mu g/m^3)$	
Sunny	2565.0	2589.0	1440.00	41	42	41.5	17.4	1021.6	1.64	2364	2.7143	2.8562	0.1419	60	
Fine	2589.1	2613.1	1440.00	43	43	43.0	16.2	1024.8	1.72	2480	2.7135	2.7813	0.0678	27	
Sunny	2613.3	2637.3	1440.00	42	42	42.0	19.2	1022.4	1.66	2392	2.7384	2.8776	0.1392	58	
Fine	2637.3	2661.3	1440.00	41	43	42.0	19.8	1019.8	1.65	2382	2.7411	2.888	0.1469	62	
Fine	2661.4	2685.4	1440.00	43	43	43.0	20.0	1016.7	1.69	2439	2.7522	2.8422	0.0900	37	
Sunny	2685.5	2709.5	1440.00	42	42	42.0	18.5	1020.2	1.50	2158	2.7242	2.8984	0.1742	81	

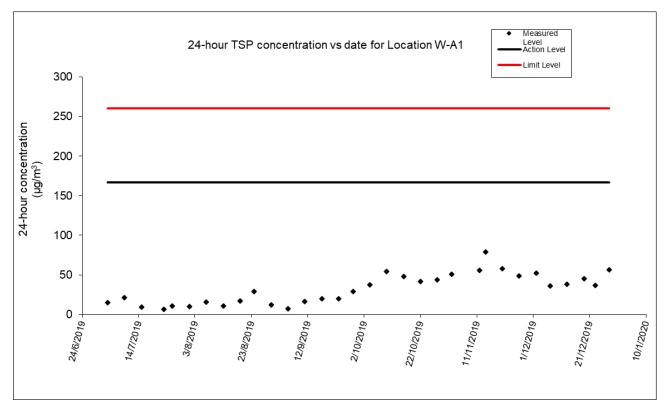






Figure 4: Graphical Illustration of Measured 24-hour TSP (µg/m<sup>3</sup>) Levels at W-A6

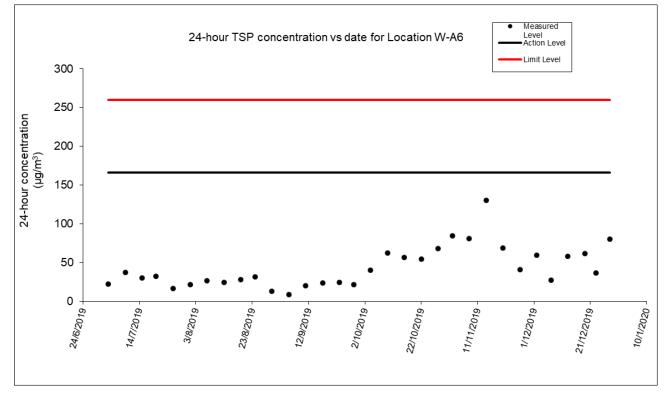


### Wind direction data for 2, 3, 7, 8, 13, 14, 19, 20, 23, 24, 28, 29 December 2019

Wind Direction:

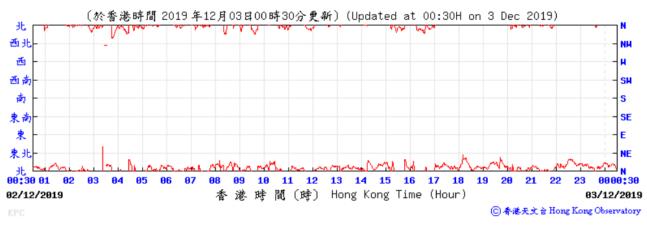


Wind Direction:

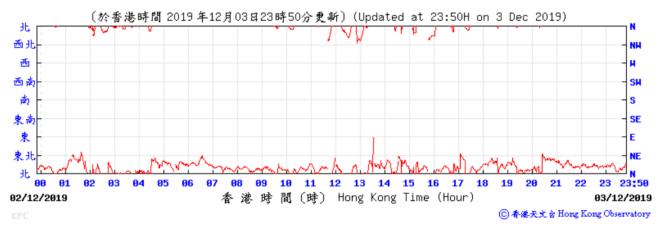




Wind Direction:

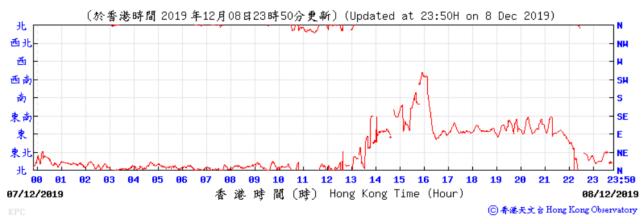


Wind Direction:

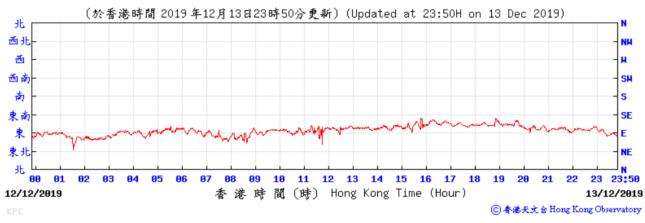



Wind Direction:

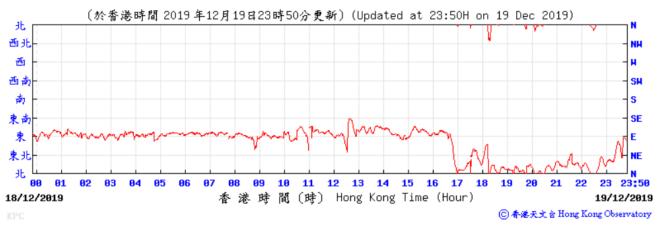







Wind Direction:




Wind Direction:






### Wind speed data for 2, 3, 7, 8, 13, 14, 19, 20, 23, 24, 28, 29 December 2019

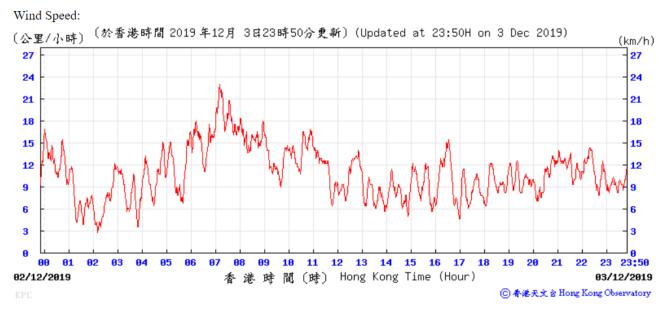


Wind Speed:

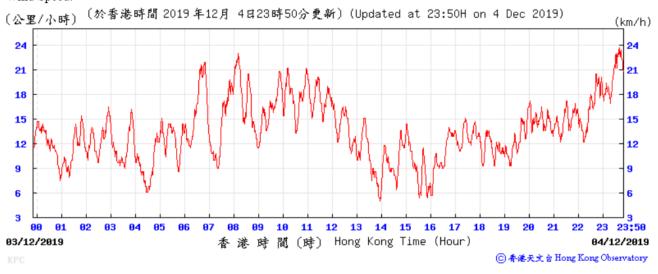





#### Wind Speed:

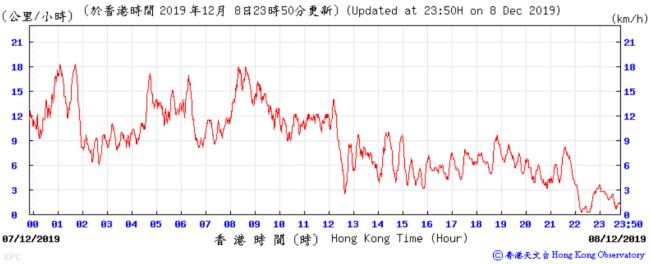

Wind Speed:

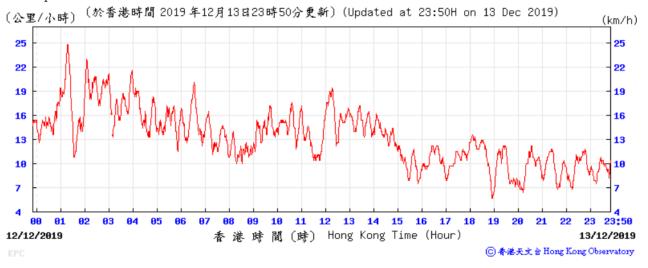


Wind Speed:

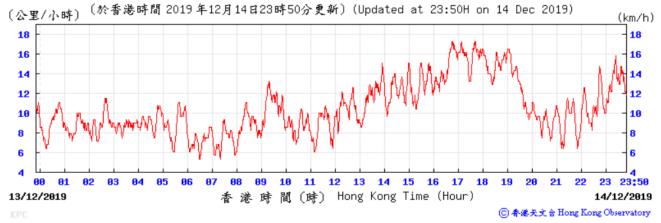

#### Contract No. HY/2014/08 Environmental Monitoring & Auditing


#### Wind Speed:

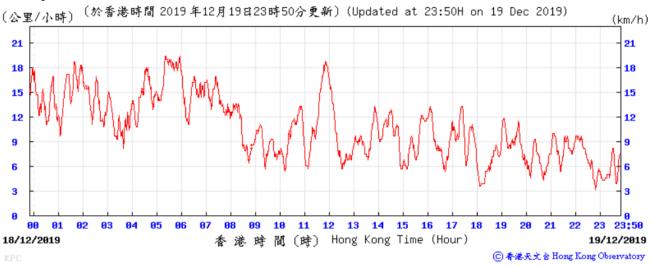


Wind Speed:




Wind Speed:

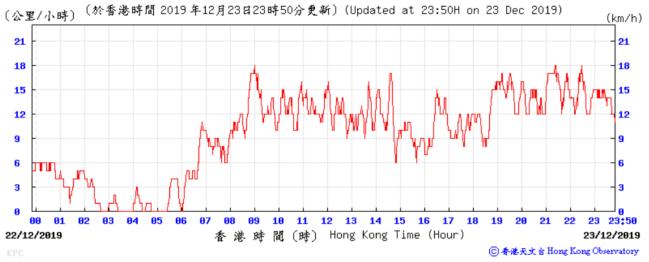


#### Wind Speed:

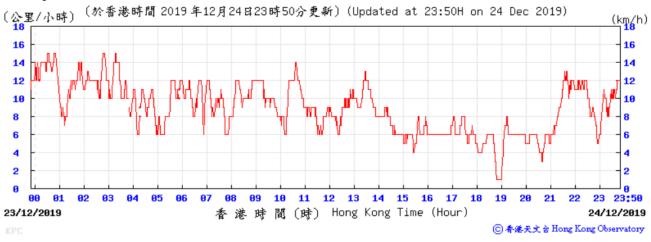

Wind Speed:

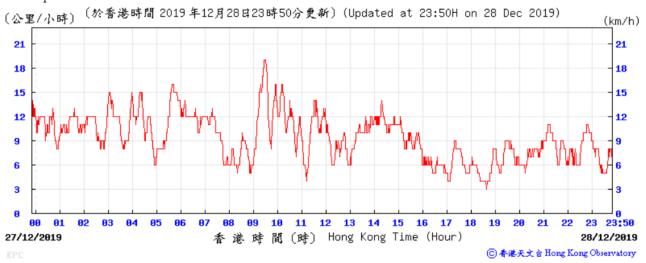

Wind Speed:

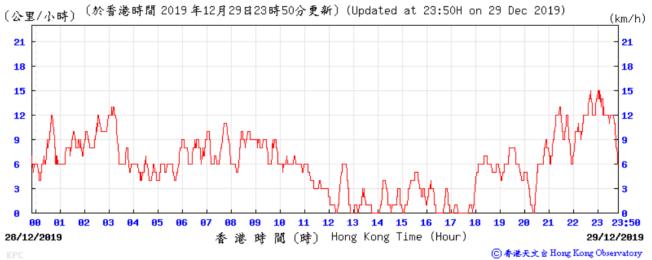

## Appendix M Monitoring Data (Noise)

Location:	Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-N1A)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	$L_{eq}, L_{10}, L_{90}$
Other Factors	Nearby traffic, construction work from West Kowloon Government
	Offices, school activities

Date	Weather	Start Time	-	End Time	L <sub>eq</sub>	L <sub>10</sub>	L <sub>90</sub>	Wind speed (m/s)
02/12/2019	Sunny	9:40	-	10:10	62.2	64.3	58.2	3.4
07/12/2019	Fine	10:48	-	11:18	63.4	65.6	59.2	4.1
13/12/2019	Sunny	10:04	-	10:34	60.8	62.6	58.6	2.9
19/12/2019	Fine	10:12	-	10:42	64.5	66.5	61.4	2.1
23/12/2019	Fine	9:45	-	10:15	63.5	66.0	59.8	3.2
28/12/2019	Sunny	9:45	-	10:15	59.8	61.5	57.8	2.4

Location:	Hydan Place (W-N18)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	$L_{eq}, L_{10}, L_{90}$
Other Factors	Nearby traffic


Date	Weather	Start Time		End Time	т	т	т	Wind
Date	weather	Start Time	-		L <sub>eq</sub>	L <sub>10</sub>	$L_{90}$	speed (m/s)
02/12/2019	Sunny	11:54	-	12:24	68.0	69.3	64.5	3.1
07/12/2019	Fine	11:32	-	12:02	67.1	68.7	63.8	4.3
13/12/2019	Sunny	11:30	-	12:00	68.6	71.1	66.9	2.7
19/12/2019	Fine	12:45	-	13:15	66.2	68.1	64.4	2.4
23/12/2019	Fine	13:18	-	13:48	68.0	70.2	66.0	3.4
28/12/2019	Sunny	13:05	-	13:35	68.2	70.4	66.1	2.3

Location:	Prosperous Garden Block 1 (W-N25A)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	Leq, L10, L90
Other Factors	nearby traffic

Date	Weather	Start Time	-	End Time	L <sub>eq</sub>	L <sub>10</sub>	L <sub>90</sub>	Wind speed (m/s)
02/12/2019	Sunny	11:15	-	11:45	65.8	67.4	63.5	3.5
07/12/2019	Fine	12:20	-	12:50	65.3	67.7	63.3	4.2
13/12/2019	Sunny	10:50	-	11:20	71.4	72.7	70.1	2.8
19/12/2019	Fine	12:03	-	12:33	66.3	68.3	63.9	1.7
23/12/2019	Fine	12:28	-	12:58	65.2	67.6	63.2	3.1
28/12/2019	Sunny	10:32	-	11:02	66.9	69.0	64.2	1.8


Location:	The Coronation Tower 1 (W-P11)
Monitoring date:	2, 7, 13, 19, 23, 28 December 2019
Parameter :	L <sub>eq</sub> , L <sub>10</sub> , L <sub>90</sub>
Other Factors	Nearby traffic


Date	Weather	Start Time	-	End Time	L <sub>eq</sub>	L <sub>10</sub>	L <sub>90</sub>	Wind Speed (m/s)
02/12/2019	Sunny	10:20	-	10:50	63.4	66.3	60.9	3.0
07/12/2019	Fine	13:12	-	13:42	64.5	66.0	61.4	4.3
13/12/2019	Sunny	13:24	-	13:54	67.2	69.0	63.0	2.5
19/12/2019	Fine	13:33	-	14:03	65.9	67.8	62.9	2.0
23/12/2019	Fine	10:32	-	11:02	69.6	72.2	65.9	3.3
28/12/2019	Sunny	11:19	-	11:49	65.3	67.4	63.4	1.9

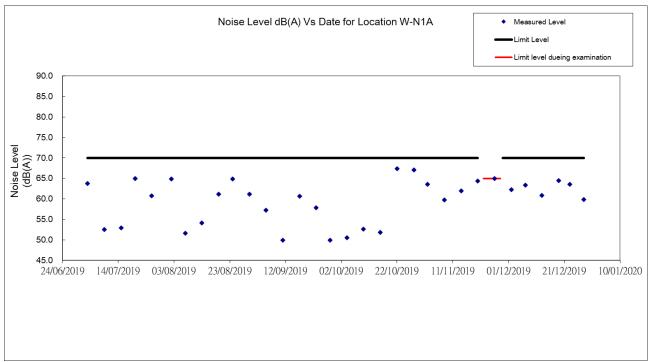




#### Figure 2: Graphical Illustration of Measured Noise Levels at W-N18

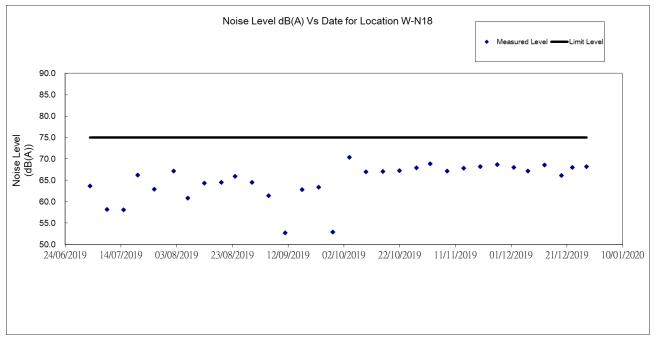

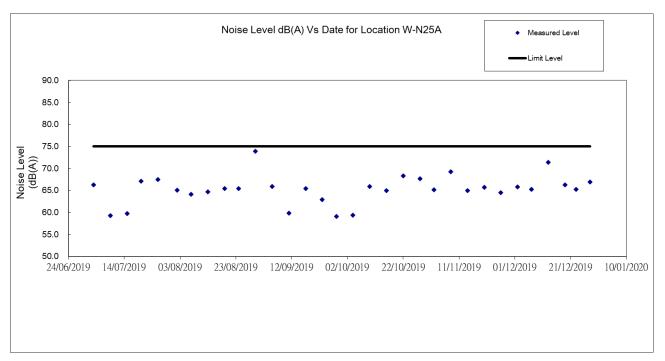



#### Figure 4: Graphical Illustration of Measured Noise Levels at W-P11

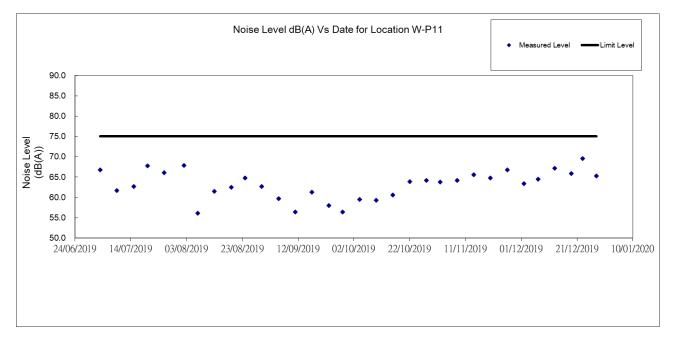

### Appendix N Waste Flow Table

#### Monthly Summary Waste Flow Table

**Highways Department** Name of Department: Monthly Summary Waste Flow Table forDecember 2019[to be submitted not later than the 15<sup>th</sup> day of each month following reporting month]

Contract No. / Works Order No.: <u>HY/2014/08</u>

(All quantities shall be rounded off to 1 decimal place.)

			ted Monthly			
Month	$ \begin{array}{c} (a)=(b)+(c)+(d)+(e)+\ (f)+\ (g)+\ (h)+\ (i)+\\ (j)+\ (k)\\ Total \ Quantity \ Generated \end{array} $	(b) Hard Rock and Large Broken Concrete	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed of as Public Fill	(f) Imported Fill
	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)
2018	51058.0	0.0	0.0	0.0	47715.6	2877.4
Jan-19	8937.5	15.0	0.0	0.0	7941.9	961.8
Feb-19	6705.9	0.0	0.0	0.0	6306.9	384.6
Mar-19	7105.5	97.6	0.0	0.0	6980.5	0.0
Apr-19	11091.1	149.2	0.0	0.0	10904.0	0.0
May-19	9409.9	183.2	0.0	440.6	8706.3	0.0
Jun-19	14754.7	65.8	0.0	653.2	13930.5	0.0
Sub-total	58004.6	510.8	0.0	1093.8	54770.1	1346.4
Jul-19	11932.0	30.2	0.0	6373.1	5429.8	0.0
Aug-19	8062.1	0.0	0.0	364.7	7558.7	0.0
Sep-19	2676.3	0.0	31.8	1208.0	565.3	741.1
Oct-19	3114.2	0.0	423.5	0.0	1488.1	1068.1
Nov-19	2493.9	0.0	350.8	0.0	2058.3	0.0
Dec-19	26547.2	0.0	717.7	4485.4	21262.7	0.0
Total	112830.2	541.0	1523.8	12525.0	93133.0	3155.6

		Actual Quantities of <u>Non-inert</u> Construction Waste Generated Monthly									
Month	(g Me		(h) Paper/ cardboard packaging		(i) Plastics			(j) al Waste	(k) Others, e.g. General Refuse disposed at Landfill		
	(in '0	00kg)	(in '0	00kg)	(in '00	00kg)	(in '0	00kg)	(in 'tonnes)		
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated		
2018	28.4	0.0	0.0	0.0	0.0	0.0	2.0	0.0	434.5		
Jan-19	0.0	0.0	0.4	0.4	0.0	0.0	0.8	0.0	17.6		
Feb-19	0.0	0.0	0.0	0.0	0.0	0.0	1.2	0.0	13.2		
Mar-19	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	27.5		
Apr-19	0.0	0.0	0.0	1.0	0.0	0.0	0.8	0.0	36.0		
May-19	0.0	9.1	0.0	0.8	0.0	0.0	2.4	0.0	67.5		
Jun-19	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	105.2		
Sub-total	0.0	9.1	0.4	2.2	0.0	0.0	5.2	0.0	267.0		
Jul-19	0.0	0.0	0.0	0.4	0.0	0.0	0.0	0.0	98.4		
Aug-19	0.0	0.0	0.0	1.3	0.0	0.0	0.0	0.0	137.3		
Sep-19	0.0	0.0	0.0	2.9	0.0	0.0	0.0	0.0	127.1		
Oct-19	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	134.5		
Nov-19	0.0	0.0	3.4	0.0	0.0	0.0	0.0	0.0	81.4		
Dec-19	0.0	0.0	0.0	0.0	0.0	0.0	0.0	0.0	81.5		
Total	0.0	9.1	0.4	10.3	0.0	0.0	5.2	0.0	927.3		

Remark: Construction waste record for Nov-19 has been updated.

# Appendix O Statistics on Complaint, Notifications of Summons and Successful Prosecutions

	Statistical Summa	ary of Exceedances							
Air Quality									
Location	Action Level         Limit Level         Total								
W-A1	0	0	0						
W-A6	0	0	0						
	Noise								
Location	Action Level	Limit Level	Total						
W-N1A	0	0	0						
W-N18	0	0	0						
W-N25A	0	0	0						
W-P11	0	0	0						

#### Statistical Summary of Environmental Complaints

Departing Deriod	Environmental Complaint Statistics						
<b>Reporting Period</b>	Frequency	Cumulative	Complaint Nature				
1 December 2019- 31 December 2019	1	9	N/A				

### Statistical Summary of Environmental Non-compliance

Departing Daried	Environmental Non-compliance Statistics		
<b>Reporting Period</b>	Frequency	Cumulative	Details
1 December 2019- 31 December 2019	0	1	N/A

#### Statistical Summary of Environmental Summons


Domonting Donio d	Environmental Summons Statistics		
<b>Reporting Period</b>	Frequency	Cumulative	Details
1 December 2019- 31 December 2019	0	0	N/A

#### Statistical Summary of Environmental Prosecution

Departing David	Environmental Prosecution Statistics		
<b>Reporting Period</b>	Frequency	Cumulative	Details
1 December 2019-	0	0	NI/A
31 December 2019	0	0	N/A

# Appendix P Monitoring Schedule of the Coming Month

#### Contract No. HY/2014/08 Environmental Monitoring & Auditing

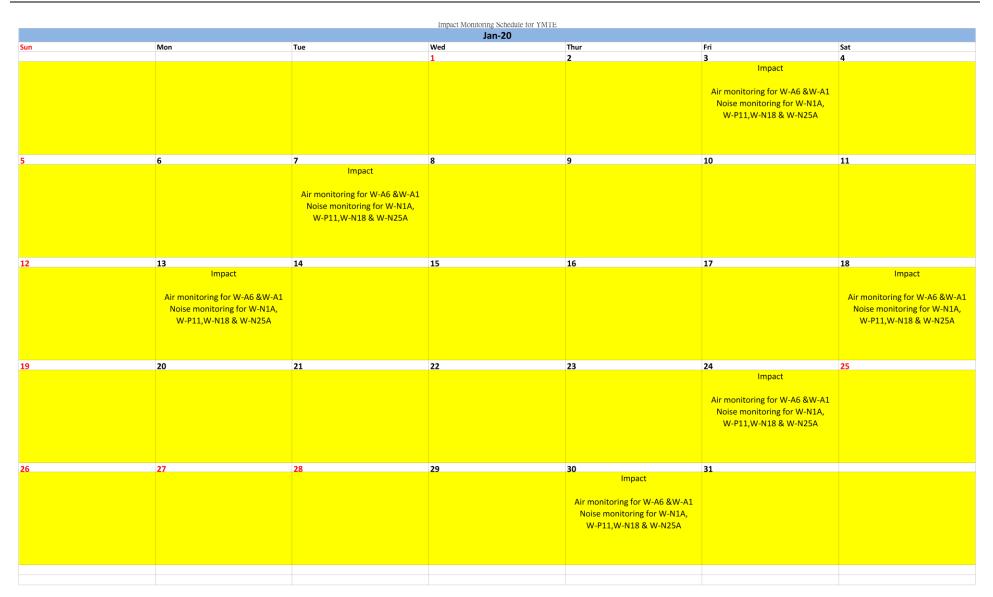

## Appendix Q Interim Report for the Complaint

#### **Interim Report on Environmental Complaint**

Project	Central Kowloon Route, Yau Ma Tei East Section		
Complaint Code	EC008-CKRYMTE20191211_001		
Complaint description	Complainant complained that there was petrol odour problem near Prosperous Garden around 10:00am, lasting for 1 to 2 minutes on 11 December 2019.		
Parameter	Odour		
Investigation finding	Immediate site inspection was conducted by the Contractor on 11 December 2019, no petroleum odour was detected in Zone C. No petrol-driven PME was used on 11 December 2019. A few bottles of petrol container were found to be well-plugged. During the weekly site inspection by the Contractor, the Environmental Team member and the Engineering Representative on 12 December 2019, no petrol odour was detected in Zone C. As petrol is seldom used in the construction site, the complaint on petrol odour is concluded as non-project related.		
Actions taken / to be taken	As a precautionary measure, the Contractor will conduct regular site inspection to make sure all petrol containers are well-plugged, if any, and stored in the designated area. All equipment will be regularly maintained.		
Remarks	<ul><li>Construction works carried out on 11 December 2019:</li><li>Excavation, deep cement mixing.</li></ul>		
	<ul> <li>PME used on 11 December 2019:</li> <li>One Deep cement mixing machine</li> <li>One Excavator</li> <li>One Mini backhoe</li> <li>One Hand-held breaker</li> </ul>		
	One Generator     Works locations:     (next page.)		
Prepared by			

