
# Vol. 3 of 5 FEP-03/457/2013/D Central Kowloon Route Yau Ma Tei East Contract No. HY/2014/08 January 2022





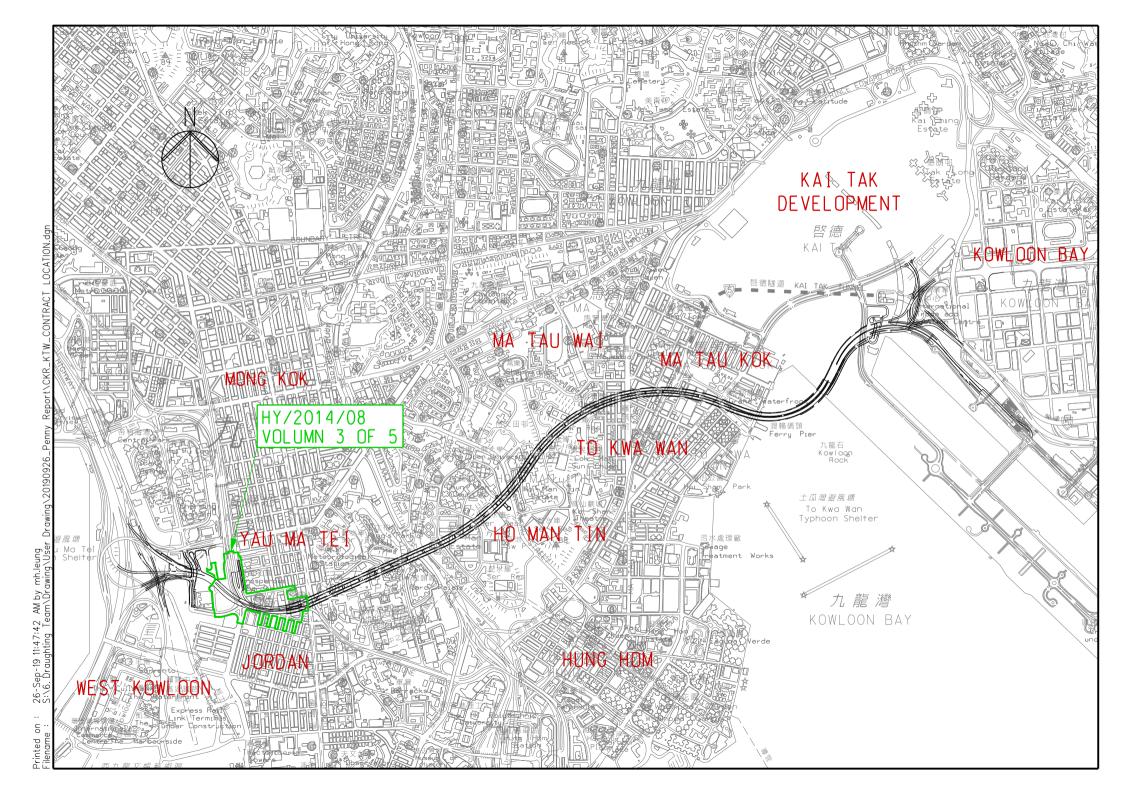

#### Environmental Permit No. EP-457/2013/D

#### **Central Kowloon Route**

#### **Independent Environmental Checker Verification**

	,
Reference Document/Plan	
Document/Plan to be Certified/ Verified:	Monthly EM&A Report No.46 (January 2022)
Date of Report:	11 February 2022 (Rev.1)
Date received by IEC:	11 February 2022

Yau Ma Tei East (HY/2014/08)

#### **Reference EP Condition**

**Works Contract:** 

Environmental Permit Condition: 3.4

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

#### **IEC Verification**

Mondy 20.

I hereby verify that the above referenced document/<del>plan</del> complies with the above referenced condition of EP-457/2013/D.

Ms Mandy To Date: 11 February 2022

Independent Environmental Checker

Our ref: 0436942\_IEC Verification Cert\_YMTE\_Monthly EM&A Rpt No.46.docx



# Acuity Sustainability Consulting Limited

Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan Kowloon, Hong Kong Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

### Build King – SK ecoplant Joint Venture

# Central Kowloon Route Contract HY/2014/08 Section of Yau Ma Tei East

Monthly EM&A Report No. 46

(Period from 1 to 31 January 2022)

# Rev. 1 (11 February 2022)

	Name	Signature
Prepared by	Katrina K.S. Chui (Assistant Environmental Consultant)	fr.
Checked & Reviewed by	Tandy K.C. Tse (Senior Environmental Consultant)	ludelly
Approved & Certified by	Kevin W. M. Li (Environmental Team Leader)	K.

#### **TABLE OF CONTENTS**

#### **EXECUTIVE SUMMARY**

1.	BASIC PROJECT INFORMATION	7
2.	ENVIRONMENTAL STATUS	10
3.	MONITORING RESULTS	12
4.	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	20
5.	EM&A SITE INSPECTION	22
6.	FUTURE KEY ISSUES	23
7.	CONCLUSION AND RECOMMENDATIONS	25

#### LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/08
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month
- Q. Interim Report for the Complaint

#### **EXECUTIVE SUMMARY**

- A.1 Build King SK ecoplant Joint Venture ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/08 Section of Yau Ma Tei East ("The Project") on 20 April 2018. This is the 46<sup>th</sup> monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 January 2022 to 31 January 2022.
- A.2 A summary of the construction works reported by Main Contractor for the Project during the reporting month is listed below.

#### **Construction Activities undertaken**

- Pile Piling at Yau Ma Tei Police Station (YMTPS)
- Socket H-piles for underpinning of existing pile cap & tam grouting at Yau Ma Tei Police Station (YMTPS)
- Construction of D-wall panels (31 panels) at Zone B
- Site formation, predrilling, remedial works for land contamination, grout curtain wall & guide wall & D-wall at Zone B
- Construction of Stage 3 D-wall panels, soil improvement works, sheet piling at Zone C
- Predrilling, guide wall & D-wall panels and pipe piles, pre-boring & transfer beams at Zone D
- Diversion of DN900 Sewer Pipes (ELS, Excavation and Pipe Laying) along Kansu Street at Zone F/B3
- Predrilling, pipe piles & divert DN450 watermain & DN1800 Drainage at Zone G
- ELS, Excavation and Construction of Pad Footing, Piers and Portal Frame for Reprovision of Gascoigne Road Flyover (RGRF)
- CLP Cable Diversion, demolition of subway/ backfill & predrilling at Zone D
- Construct Bridge Deck including Trial Panel, Form Traveller Assembly and Relocation for RGRF
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

#### Regular construction noise monitoring during normal working hours

W-N1A, W-P11, W-N18, W-N25A 6 times

Construction dust (24-hour TSP) monitoring

W-A1 6 times

W-A6 7 times, 1 voided sample, 6 valid

samples

Construction dust (1-hour TSP) monitoring

W-A1, W-A6 18 times

- A.4 Bi-weekly inspection of the implementation of landscape and visual mitigation measures was conducted on 6 and 20 January 2022. Details of the audit findings and implementation status are presented in Section 5.
- A.5 Joint weekly site inspections were conducted by representatives of Environmental Team (ET), Contractor and Engineer on 6, 13, 20, 27 and 31 January 2022. One joint site

inspection with IEC was also undertaken on 20 January 2022. Details of the audit findings and implementation status are presented in Section 5.

- A.6 Details of waste management are presented in Section 3.
- A.7 Due to the electricity supply failure for the high volume sampler (HVS) on 10 January 2022 at Man Cheong Building (W-A6), 24-hour TSP result was voided. Inspection and repair works for the electricity supply were conducted by the Contractor on 11 January 2022. Additional monitoring for 24-hour TSP at W-A6 was arranged on 12 January 2022. The result was valid and used as a substitute for the voided monitoring result on 10 January 2022.
  - A.8 Two Action Levels of construction noise were triggered during the reporting period as two documented complaints were received on 20 and 26 January 2022 related to construction noise from works areas at Gascoigne Road Flyover and Portion 21. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- A.9 One noise-related complaint and one non-project related complaint were received on 20 and 26 January 2022. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- A.10 No non-compliance was reported in the reporting month.
- A.11 No notification of summon or prosecution was received in this reporting month.
- A.12 A summary of the construction activities provided by Main Contractor in the next reporting month is listed below:

#### **Construction Activities to be undertaken**

- Excavation /ELS Works below ceiling slab and mass concrete and bottom slab (vertical) construction at Zone A.
- Continue excavation works including installation of waling/strut to tunnel roof slab level, lagging wall construction, roof slab construction at Zone B.
- Pipe piles construction in lieu of D-wall for P35 & P36 at EB2 at Zone B.
- TAM grouting between Zones B2 & C1, install king posts, excavate and construct temporary buttress wall at Zones C1/C2 & C3 and strengthen the joints of HDPE pipes at C3, excavation to roof slab and construct part of roof slab at C3 for Pier construction.
- Construction of pier head for P4L/P4R, D-wall, utilities diversion works, buttress wall and installation of king posts at Zone D.
- Complete trench excavation for DN450 FW/SW watermains diversion by WSD at Zone B3.
- Excavation to tunnel roof slab and Partial Demolition of Cable Tunnel A (coring for temporary access) and commence works for Oil Interceptor & Fuel Tank inside CLP Station at Zone F.
- Continue for diversion work of DN1800 drainage (stage 1) such as pipe laying install waling/strut, delivery & installation of pre-fabricated temporary manhole at Zone G.
- Works for RGRF at HKAA area: Construction of end-span at P8L, install temporary support & construction of Portal Frame over Piers P7L and P7R and installation of temporary support for demolition of GRF Portion 1 (existing 3 beams).

#### **Construction Activities to be undertaken**

- Bridge Works:
  - i. Pier head construction for P4L/P4R and P6L.
  - ii. Relocate FT1 to pier P4L and commence FT1-2 Assembly on P4L.
  - iii. Pier construction for P1L and P3L.
  - iv. Modification of traffic island at east end (above temple street)
- Continue socketed H-piling works for middle/east foundation and west side of Zone 3 F02 Noise Enclosure, ELS works for pile cap construction for middle/east foundation for F02 Noise Enclosure.
- Continue parapet modification works for Noise Enclosure at Zone 3 on the bridge deck of FSF.
- Works at Zone 2 Noise Enclosure scheduled as following:
  - i. Column E Permanent socketed H-piling works;
  - ii. Column G Utilities diversion works;
  - iii. Column C Trial Pit Excavation commence temporary socketed H-piling works;
  - iv. Column A Complete trial pit excavation / predrilling works and commence temporary diversion of DN 150 Strom Drainage.
- Monitoring of instrumentation for all areas.

#### 1. Basic Project Information

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 July 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was applied for and the EP (EP-457/2013/C) was issued by EPD on 16 January 2017. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/D) was issued by EPD on 15 June 2021. A Further EP (FEP-03/457/2013/D) was issued by EPD on 5 November 2021.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/08 Section of Yau Ma Tei East (YMTE) covers part of the construction activities located at Yau Ma Tei under the EP and FEP which includes:
  - Section of Yau Ma Tei East
  - i. Construction of Cut-and-Cover Tunnel in compliance with all statutory requirements and the requirements specified under the Contract while maintaining the traffic with all necessary provisions
  - ii. Construction and subsequent handover of Yau Ma Tei Access Shaft for facilitating the access and use by the contractor of Central Kowloon Route Central Tunnel contract
  - iii. Demolition of existing buildings including Yau Ma Tei Multi-storey Carpark Building, Yau Ma Tei Specialist Clinic Extension Building and Yau Ma Tei Jade Hawker Bazaars
  - iv. Demolition and re-provisioning of Gascoigne Road Flyover(GRF) and the underpinning works for the existing Ferry Street Flyover and Yau Ma Tei Police Station New Wing Building
  - v. Construction of civil provisions and coordination with the contractor of Central Kowloon Route Tunnel Electrical & Mechanical contract
  - vi. Design and construction of Noise Barrier Works
  - vii. Prepare TTA proposals, discuss at TMLG meeting and obtain its agreement and approval/ endorsement from relevant authorities at suitable times to enable the execution of the Works

The alignment and works area for the Contract No. HY/2014/08 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

#### **Construction Activities undertaken**

- Pile Piling at Yau Ma Tei Police Station (YMTPS)
- Socket H-piles for underpinning of existing pile cap & tam grouting at Yau Ma Tei Police Station (YMTPS)
- Construction of D-wall panels (31 panels) at Zone B
- Site formation, predrilling, remedial works for land contamination, grout curtain wall & guide wall & D-wall at Zone B
- Construction of Stage 3 D-wall panels, soil improvement works, sheet piling at Zone C
- Predrilling, guide wall & D-wall panels and pipe piles, pre-boring & transfer beams at Zone D
- Diversion of DN900 Sewer Pipes (ELS, Excavation and Pipe Laying) along Kansu Street at Zone F/B3
- Predrilling, pipe piles & divert DN450 watermain & DN1800 Drainage at Zone G
- ELS, Excavation and Construction of Pad Footing, Piers and Portal Frame for Reprovision of Gascoigne Road Flyover (RGRF)
- CLP Cable Diversion, demolition of subway/ backfill & predrilling at Zone D
- Construct Bridge Deck including Trial Panel, Form Traveller Assembly and Relocation for RGRF
  - 1.5. The project organisational chart specifying management structure and contact details are shown in Appendix C.
  - 1.6. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2.

Table 1.2 Summary of the Status of Valid Environmental Licence

#### Notification, Permit and Documentations

Permit/ Licences/	Valid	Period		
Notification /Reference No.	From	То	Status	Remark
<b>Environmental Permit</b>				
EP-457/2013/D	15 Jun 2021	End of Project	Valid	-
Further Environmental l	Permit			
FEP-03/457/2013/D	5 Nov 2021	End of Project	Valid	
Wastewater Discharge Li	cense			
WT00030660-2018	28 Mar 2018	31 Mar 2023	Valid	-
Notification of Constructi	on Works under	the Air Pollution	Control (Construction	n Dust) Regulation
471691	14 Sep 2021	End of Project	Notified	-
<b>Chemical Waste Produce</b>	r Registration			
WPN5213-225-B2526-01	14 Mar 2018	End of Project	Valid	-
Billing Account for Dispo	Billing Account for Disposal of Construction Waste			
7029997	1 Feb 2018	End of Project	Valid	-
Construction Noise Permit				
GW-RE1171-21	25 Nov 2021	22 Apr 2022	Valid	Construction Noise Permit at Jade Hawker Bazaar Building

Permit/ Licences/ Valid Period				
Notification /Reference No.	From	То	Status	Remark
GW-RE1038-21	30 Dec 2021	29 Mar 2022	Valid	Construction Noise Permit for D-wall at Zone B2
GW-RE1111-21	15 Nov 2021	31 Jan 2022	Valid until 31 Jan 2022	Construction Noise Permit at GRF for Temporary Erection of Bridge Decking
GW-RE1094-21	2 Nov 2021	1 May 2022	Valid	Construction Noise Permit at Zone D & G
GW-RE1095-21	2 Nov 2021	1 May 2022	Valid	Construction Noise Permit at Multi-storey Carpark Building
GW-RE1093-21	2 Nov 2021	1 May 2022	Valid	Construction Noise Permit at Zone A & B
GW-RE0881-21	10 Sep 2021	9 Mar 2022	Valid	Construction Noise Permit at Zone 3
GW-RE1240-21	15 Dec 2021	14 Feb 2022	Valid	Construction Noise Permit for Bridge Works at Shanghai Street
GW-RE1315-21	4 Jan 2022	25 Feb 2022	Valid from 4 Jan 2022	Construction Noise Permit for Formtraveller Assembly and Launching at Reclamation Street
GW-RE0087-22	28 Jan 2022	27 Apr 2022	Valid from 28 Jan 2022	Construction Noise Permit at Zone D & P4
GW-RE0054-22	28 Jan 2022	27 Apr 2022	Valid from 28 Jan 2022	Construction Noise Permit at P6
GW-RE0093-22	28 Jan 2022	27 Apr 2022	Valid from 28 Jan 2022	Construction Noise Permit at Multi-storey Carpark Building
<b>Marine Dumping Permit</b>		Γ		
EP/MD/22-051	8 Sep 2021	7 Mar 2022	Suspended by EP/MD/22-091	Type 1- Open Sea
EP/MD/22-091	23 Dec 2021	22 Jun 2022	Valid	Disposal
EP/MD/22-109	31 Jan 2022	28 Feb 2022	Valid from 31 Jan 2022	Type 1- Open Sea Disposal (Dedicated Site) & Type 2 - Confined Marine Disposal)

#### 2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/D) and FEP (FEP-03/457/2013/D) as of the reporting period for the Project are summarised in Table 2.1

Table 2.1 Summary of Status of Required Submission for EP-457/2013/D and FEP-03/457/2013/D for the Project

EP/FEP Condition (EP-457/2013/D) (FEP-03/457/2013/D)	Submission	Submission date
Condition 3.4	Monthly EM&A Report (Dec 2021)	14 Jan 2022

2.2. Details of the major construction activities reported by Main Contractor in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Co	nstruction activities undertaken	Remarks on progress
•	Socket H-piles for underpinning of existing pile cap & tam grouting at YMTPS	•98% completion
•	Construction of D-wall panels at Zone B	●98% completion
•	Site formation, predrilling, remedial works for land contamination, grout curtain wall & guide wall & D-wall at Zone B	•85% completion
•	Construction of Stage 3 D-wall panels, soil improvement works, sheet piling at Zone C	•97% completion
•	Predrilling, guide wall, D-wall and pipe piles at Zone D	•85% completion
•	Diversion of DN900 Sewer Pipes (ELS, Excavation and Pipe Laying) along Kansu Street at Zone F/B3	•80% completion
•	Predrilling, pipe piles & divert DN450 watermain & DN1800 Drainage at Zone G	•55% completion
•	ELS, Excavation and Construction of Pad Footing, Piers and Portal Frame for RGRF	•85% completion
•	CLP Cable Diversion, demolition of subway/ backfill & predrilling at Zone D	•80% completion
•	Construct Bridge Deck including Trial Panel, Form Traveller Assembly and Relocation for RGRF	•95% completion

2.3. The drawing showing the project layout and the location of the monitoring station and environmental sensitive receivers are attached in Appendix A and Appendix K. Co-ordinates of the monitoring location are shown in Table 2.3.

Table 2.3 Summary for the location of the monitoring station

<b>Monitoring Location</b>	Location ID	Latitude	Longitude
Yau Ma Tei Catholic Primary School (Hoi Wang Road)	W-A1/ W-N1A	22.313357	114.16409
Man Cheong Building	W-A6	22.308185	114.166033
Hydan Place	W-N18	22.30858	114.170185
Prosperous Garden Block 1	W-N25A	22.309846	114.168072
The Coronation Tower 1	W-P11	22.309824	114.165616

#### 3. MONITORING RESULTS

3.1. Monitoring Parameters

#### **Air Quality**

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

#### **Noise**

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L<sub>eq</sub>). Leq (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, Leq (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as  $L_{10}$  and  $L_{90}$  shall also be obtained for reference.
- 3.2. Monitoring Equipment

#### **Air Quality**

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificates of dust monitoring equipment are attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
1 hour TCD	LD-5R Digital Dust Indicator	992821	19 Sep 2021
1-hour TSP	LD-5R Digital Dust Indicator	851819	1 Jul 2021
24-hour TSP	TE-5170X High Volume	1084	3 Jan 2022 and 20 Jan
	Sampler		2022
	TE-5170X High Volume	1050	3 Jan 2022 and 20 Jan
	Sampler		2022
	TE-5028A Calibration Kit	3702	3 Aug 2021

Table 3.1 Construction Dust Monitoring Equipment

#### Noise

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.
- 3.2.6. Acoustic calibrators and sound level meters using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

		$\mathcal{E}$
<b>Monitoring Equipment</b>	Serial Number	Date of Calibration
Nti XL2 Sound Level Meter	A2A-13661-E0	23 Sep 2021
RION NL-31 Sound Level	00303811	27 Apr 2021
Meter		
Pulsar 105 Acoustic Calibrator	63705	7 Aug 2021

Table 3.2 Monitoring Equipment Used in Monitoring

#### 3.3. Monitoring Methodology and QA/QC results

#### **Air Quality**

- 3.3.1. The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R) was used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.
- 3.3.2. The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- ◆ The HVS was set at the monitoring location, with electricity supply connected and secured:
- ◆ HVS was calibrated before commencing the 1<sup>st</sup> measurement;
- ◆ The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
- The airflow over time during sampling process was recorded by the HVS.

## 3.3.3. HVSs were free-standing with no obstruction. The following criteria were considered in the installation of the HVS:

- ◆ Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
- ◆ A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
- ◆ No furnace or incinerator flues was nearby;
- ◆ Airflow around the sampler was unrestricted; and
- Permission could be obtained to set up the samplers and gain access to the monitoring station.

#### 3.3.4. Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- ◆ Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

#### 3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- The filter holder and area surrounding the filter were cleaned:
- ◆ The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- ◆ The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- ◆ The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- The shelter lid was closed and secured with an aluminum strip;
- ◆ The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- ◆ A new flow rate record sheet was inserted into the flow recorder;
- ◆ The flow rates of the HVS was checked and adjusted to between 0.64-1.52m³min⁻¹, which was within the range specified in the EM&A Manual (i.e. 0.6-1.7m³min⁻¹);

- ◆ The programmable timer was set for a sampling period of 24 hours, and the starting time, weather condition and filter number were recorded;
- ◆ The initial elapsed time was recorded;
- ◆ At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- ◆ The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- ◆ The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

#### 3.3.6. Maintenance and Calibration

- ◆ The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- ♦ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.

#### 3.3.7. Wind Data Monitoring

◆ The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.

#### **Noise**

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level ( $L_{eq}$ ) in decibels dB(A).  $L_{Aeq(30min)}$  was used as the monitoring metric for the time period between 0700 -1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB(A).
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms<sup>-1</sup> or wind with gusts exceeding 10 ms<sup>-1</sup>. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms<sup>-1</sup>.

#### 3.4. Monitoring Locations

#### **Air Quality**

3.4.1. During the site visit, both of the original proposed dust monitoring locations were rejected due to the condition at The Coronation was not favorable for monitoring and the access was declined by the management office of Hong Kong Community College (HKCC) of PolyU. Two alternative air monitoring stations Yau Ma Tei Catholic Primary School (Hoi Wang Road) and Man Cheong Building had been proposed by ET and approved by IEC. 2 designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 3.3. The location plan of air quality monitoring stations is shown in Appendix K.

Table 3.3 Location of the Dust Monitoring Stations

Air Quality Monitoring Station	Dust Monitoring Station
W-A1	Yau Ma Tei Catholic Primary School (Hoi Wang Road)
W-A6	Man Cheong Building

#### **Noise**

3.4.2. During the site visit, one of the original proposed noise monitoring locations Tak Cheong Building was rejected by the president of the owner's corporation. Alternative noise monitoring station Hydan place had been proposed by ET and approved by IEC. 4 noise sensitive receivers designated noise monitoring locations were identified and agreed with IEC and EPD. The designated monitoring stations are identified and access was granted by the premises. The details of noise monitoring stations are described in Table 3.4 and the location plan of noise monitoring station is shown in Appendix K.

Table 3.4 Noise Monitoring Stations

Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
W-N1A	Yau Ma Tei Catholic Primary School (Hoi Wang Road)	Façade
W-N18	Hydan Place	Façade
W-N25A	Prosperous Garden Block 1	Façade
W-P11	The Coronation Tower 1	Façade

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.5.

**Impact** Duration **Sampling Parameter Frequency Monitoring** 1-hour continuous 1-hour TSP Dust 3 times per six days measurement 24-hour continuous Dust 24-hour TSP Once per six days sampling 30-minute continuous  $L_{eq 30 min}$ , Noise Once per week (0700 – 1900) measurement L<sub>10</sub> and L<sub>90</sub> as reference.

Table 3.5 Summary of Impact Monitoring Programme

#### 3.6. Result Summary

#### **Air Quality**

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are summarised in Table 3.6.

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source	
W-A1	Nearby traffic	
W-A6	Nearby traffic	

- 3.6.2. 1-hour TSP dust monitoring at W-A1 and W-A6 and 24-hour TSP dust monitoring at W-A1 were carried out on 4, 10, 15, 21, 27 and 31 January 2022; 24-hour TSP dust monitoring at W-A6 was carried out on 4, 12, 15, 21, 27 and 31 January 2022.
- 3.6.3. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.7 and Table 3.8. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

Table 3.7 Summary of 1-hour TSP Monitoring Results

<b>Monitoring Location</b>	Range(μg/m³)	Action Level(µg/m3)	Limit Level(µg/m3)
W-A1	54-72	319	500
W-A6	57-77	306	500

Table 3.8 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(μg/m³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	29-56	167	260
W-A6	25-57	166	260

#### **Noise**

3.6.4. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.9:

8				
Monitoring Station	Major Noise Source			
W-N1A	Nearby traffic			
W-N18	Nearby traffic			
W-N25A	Nearby traffic			
W-P11	Nearby traffic			

Table 3.9 Observation at Noise Monitoring Stations

- 3.6.5. The construction noise impact monitoring for the reporting month was carried out on 4, 10, 15, 21, 27 and 31 January 2022.
- 3.6.6. The result for noise monitoring is summarized in Table 3.10. The measurement data are shown in Appendix M.

Table 3.10 Summary of Noise Monitoring Results

Time	Monitoring	Parameter	Range, dB(A)				
Period location			$L_{ m eq}$	$L_{10}$	L <sub>90</sub>	Action Level	Limit Level#
W-N1A W-N18 Normal working	W-N1A		55.8-63.2	56.5-64.9	54.9-59.2	When one documented	70dB(A) or 65 dB(A) during examination
	W-N18	Leq	69.2-72.5	71.3-74.6	66.7-68.9		
hour from 0700-1900	our from	30min	68.0-71.4	69.7-74.9	65.5-69.3	complaint is received	75dB(A)#
	W-P11		68.0-69.9	70.2-73.8	64.4-67.7		

Remarks:

1. # If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit by the Noise Control Authority have to be followed.

#### **Waste management**

3.6.7. The waste generated from this Project includes inert C&D materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.11. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

Table 3.11 Quantities of waste generated from the Project

	Quantity					
			Non-inert C&D Materials			
		Others, e.g.	Recycled materials			
Reporting period	Inert C&D Materials (in 'tonnes)	Chemical Waste (in'000 Kg)	arsposea	Paper/card board (in '000 Kg)		Metals (in '000 Kg )
Jan-2021	6755.70	0.00	45.80	0.00	0.01	0.00

## 4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

Table 4.1 Environmental Complaint Handling Procedure

Complaint Received via Project Hotline		Complaint Received via 1823 or from other government departments		
		government departments		
Contractor notify ER, ET	and IEC	ER notify Contractor, ET and IEC		
Contractor log complain	the complaint database. Contractor, ER and ET to gation of complaint			
If complaint is considered	d not valid	If complaint is found valid		
ET or ER to reply the con	mplainant if necessary	Contractor to identify and implement remedial measures in consultation with the IEC, ET and ER.		
		The ER, ET and IEC to review the effectiveness of the Contractor's remedial measures and the updated situation; ET to undertake additional monitoring and audit to verify the situation if necessary, and oversee that circumstances leading		
		to the complaint do not recur. ER to conduct further inspection as necessary.		
complaint investigation	and follow-up actions sti al monitoring identified of	tractor to prepare interim report on the status of the pulated above, including the details of the remedial or already taken, for submission to EPD within the igned by the EPD		

The ET to record the details of the complaint, results of the investigation, subsequent actions taken to address the complaint and updated situation including the effectiveness of the remedial measures, supported by regular and additional monitoring results in the monthly EM&A reports

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Event and Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. Two Action Levels of construction noise were triggered during the reporting period as two documented complaints were received on 20 and 26 January 2022 related to construction noise from works areas at Gascoigne Road Flyover and Portion 21. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- 4.4. One noise-related complaint and one non-project related complaint were received on 20 and 26 January 2022. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- 4.5. No non-compliance was reported in the reporting month.
- 4.6. No notification of summons and prosecution was received in the reporting period.
- 4.7. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

#### 5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, five (5) site inspections were carried out on 6, 13, 20, 27 and 31 January 2022, along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 6 and 20 January 2022.
- 5.2. One joint site inspection with IEC also undertaken on 20 January 2022. Minor deficiencies were observed during weekly site inspection. Key observations during the site inspections are summarized in Table 5.1.

**Environmental Observations Date Follow-up Status** No major observation was found during site 6 January 2022 inspection. No major observation was found during site 13 January 2022 inspection. The NRMM label of generator at Zone C The NRMM label of excavator 20 January 2022 was not in correct size. had been replaced at Zone C. The NRMM label of excavator at Zone 3 The NRMM label of excavator was missing. had been replaced at Zone 3. 2. The cement bags and disposal of inert waste The cement bags and disposal of 27 January 2022 at Zone B2 should be covered with inert waste at Zone B2 had been impervious sheeting. covered with impervious sheeting The cement bags at Zone C should be The cement bags at Zone C had covered with impervious sheeting. been covered with impervious 31 January 2022 sheeting.

Table 5.1 Site Observations

- 5.3. The Contractor had rectified all observation identified during environmental site inspection in the reporting period.
- 5.4. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.

#### 6. FUTURE KEY ISSUES


- 6.1. The construction activities provided by Main Contractor in the next reporting month are:
- Excavation /ELS Works below ceiling slab and mass concrete and bottom slab (vertical) construction at Zone A.
- Continue excavation works including installation of waling/strut to tunnel roof slab level, lagging wall construction, roof slab construction at Zone B.
- Pipe piles construction in lieu of D-wall for P35 & P36 at EB2 at Zone B.
- TAM grouting between Zones B2 & C1, install king posts, excavate and construct temporary buttress wall at Zones C1/C2 & C3 and strengthen the joints of HDPE pipes at C3, excavation to roof slab and construct part of roof slab at C3 for Pier construction.
- Construction of pier head for P4L/P4R, D-wall, utilities diversion works, buttress wall and installation of king posts at Zone D.
- Complete trench excavation for DN450 FW/SW watermains diversion by WSD at Zone B3.
- Excavation to tunnel roof slab and Partial Demolition of Cable Tunnel A (coring for temporary access) and commence works for Oil Interceptor & Fuel Tank inside CLP Station at Zone F.
- Continue for diversion work of DN1800 drainage (stage 1) such as pipe laying install waling/strut, delivery & installation of pre-fabricated temporary manhole at Zone G.
- Works for RGRF at HKAA area: Construction of end-span at P8L, install temporary support & construction of Portal Frame over Piers P7L and P7R and installation of temporary support for demolition of GRF Portion 1 (existing 3 beams).
- Bridge Works:
  - i. Pier head construction for P4L/P4R and P6L.
  - ii. Relocate FT1 to pier P4L and commence FT1-2 Assembly on P4L.
  - iii. Pier construction for P1L and P3L.
  - iv. Modification of traffic island at east end (above temple street)
- Continue socketed H-piling works for middle/east foundation and west side of Zone 3 F02
   Noise Enclosure, ELS works for pile cap construction for middle/east foundation for F02 Noise Enclosure.
- Continue parapet modification works for Noise Enclosure at Zone 3 on the bridge deck of FSF.
- Works at Zone 2 Noise Enclosure scheduled as following:
  - i. Column E Permanent socketed H-piling works;
  - ii. Column G Utilities diversion works;
  - iii. Column C Trial Pit Excavation commence temporary socketed H-piling works;
  - iv. Column A Complete trial pit excavation / predrilling works and commence temporary diversion of DN 150 Strom Drainage.
- Monitoring of instrumentation for all areas.


- 6.2. Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.
- 6.3. The tentative schedule of regular construction noise monitoring, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.4. The construction programme for the Project for the next reporting month is presented in Appendix B.

#### 7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 46<sup>th</sup> monthly EM&A Report presents the EM&A works undertaken during the period from 1 January 2022 to 31 January 2022 in accordance with the EM&A Manual and the requirement under EP- 457/2013/D and FEP-03/457/2013/D.
- 7.2. Air quality (including 1-hour TSP and 24-hour TSP) and noise impact monitoring were carried out in the reporting period. No exceedance of the Action Level and Limit Level was recorded for construction noise and air quality impact monitoring during the reporting month.
- 7.3. Due to the electricity supply failure for the high volume sampler (HVS) on 10 January 2022 at Man Cheong Building (W-A6), 24-hour TSP result was voided. Inspection and repair works for the electricity supply were conducted by the Contractor on 11 January 2022. Additional monitoring for 24-hour TSP at W-A6 was arranged on 12 January 2022. The result was valid and used as a substitute for the voided monitoring result on 10 January 2022.
- 7.4. Weekly environmental site inspections were conducted during the reporting period. Joint site inspection with IEC were carried out on 20 January 2022. Minor deficiency was observed during site inspection and was rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.
- 7.5. Two Action Levels of construction noise were triggered during the reporting period as two documented complaints were received on 20 and 26 January 2022 related to construction noise from works areas at Gascoigne Road Flyover and Portion 21. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- 7.6. One noise-related complaint and one non-project related complaint were received on 20 and 26 January 2022. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- 7.7. No non-compliance was reported in the reporting month.
- 7.8. No notification of summons or prosecution was received in the reporting month.
- 7.9. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Contract No. HY/2014/08 Environmental Monitoring & Auditing
Zin ti di ilia
Appendix A
Alignment and Works Area For the Contract No.
TTT 10 0 1 1 10 0
HY/2014/08

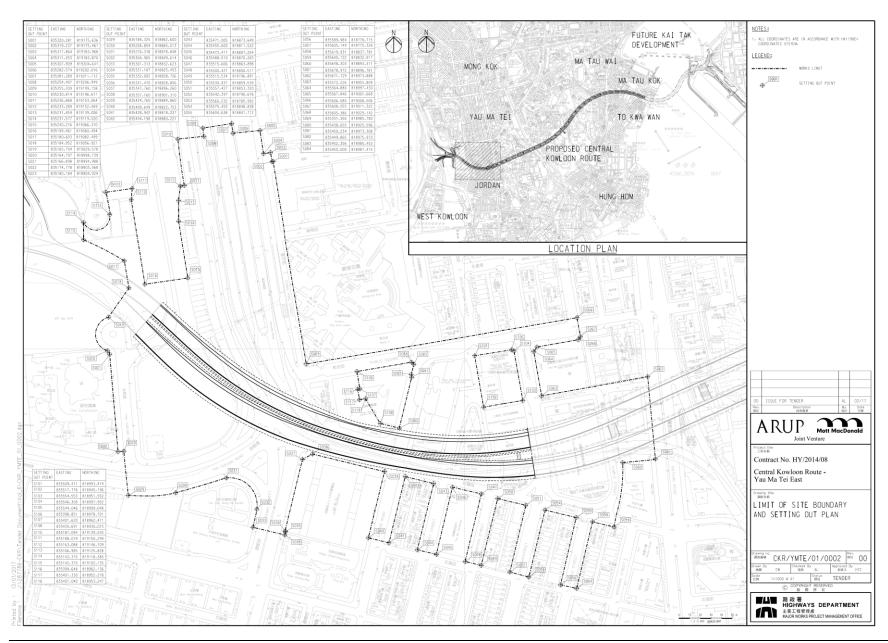




# Appendix B Construction Programme




Contract No. HY/2014/08	
Environmental Monitoring & Auditing	

## Appendix C Project Organization Chart

## Project O-Chart

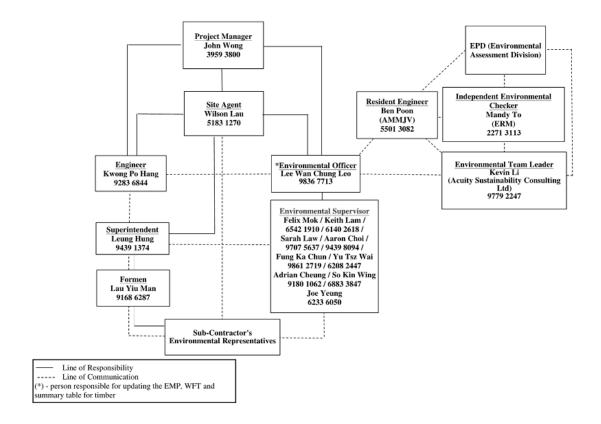

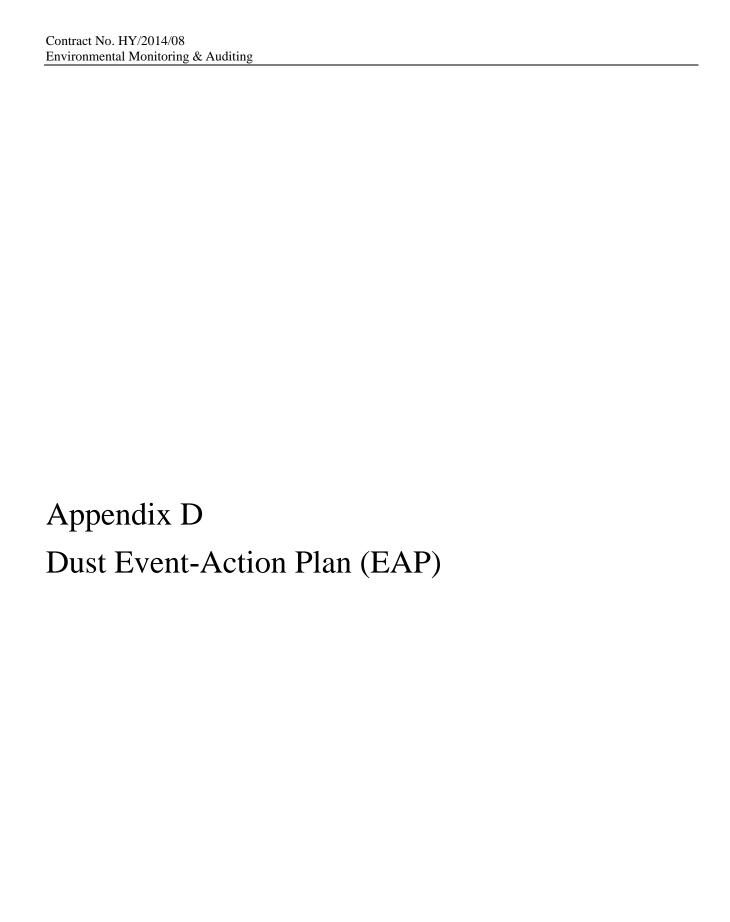

EVENT	ACTION						
EVENI	ET	IEC	ER	CONTRACTOR			
ACTION LEV	ACTION LEVEL						
1.Exceedance for one sample	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Inform IEC and ER;</li> <li>Repeat measurement to confirm finding;</li> <li>Increase monitoring frequency to daily.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method.</li> </ol>	1. Notify Contractor.	<ol> <li>Rectify any unacceptable practice;</li> <li>Amend working methods if appropriate.</li> </ol>			
2.Exceedance for two or more consecutive samples	<ol> <li>Identify source;</li> <li>Inform IEC and ER;</li> <li>Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Discuss with IEC and Contractor on remedial actions required;</li> <li>If exceedance continues, arrange meeting with IEC and ER;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> <li>Discuss with ET and Contractor on possible remedial measures;</li> <li>Advise the ET on the effectiveness of the proposed remedial measures;</li> <li>Supervise Implementation of remedial measures.</li> </ol>	1. Confirm receipt of notification of failure in writing; 2. Notify Contractor; 3. Ensure remedial measures properly implemented.	<ol> <li>Submit proposals for remedial to ER within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Amend proposal if appropriate.</li> </ol>			
LIMIT LEVEL							
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures;     Inform ER, Contractor and	<ol> <li>Check monitoring data submitted by ET;</li> <li>Check Contractor's working method;</li> </ol>	Confirm receipt of     notification of failure in     writing;     Notify Contractor;	Take immediate action to avoid further exceedance;     Submit proposals for remedial actions to IEC			


EVENT	ACTION			
EVENI	ET	IEC	ER	CONTRACTOR
	<ul> <li>EPD;</li> <li>3. Repeat measurement to confirm finding;</li> <li>4. Increase monitoring frequency to daily;</li> <li>5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results.</li> </ul>	<ul> <li>3. Discuss with ET and Contractor on possible remedial measures;</li> <li>4. Advise the ER on the effectiveness of the proposed remedial measures;</li> <li>5. Supervise implementation of remedial measures.</li> </ul>	3. Ensure remedial measures properly implemented.	within 3 working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.
2.Exceedance for two or more consecutive samples	<ol> <li>Notify IEC, ER, Contractor and EPD;</li> <li>Identify source;</li> <li>Repeat measurement to confirm findings;</li> <li>Increase monitoring frequency to daily;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Arrange meeting with IEC and ER to discuss the remedial actions to be taken;</li> <li>Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results;</li> <li>If exceedance stops, cease additional monitoring.</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated.</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

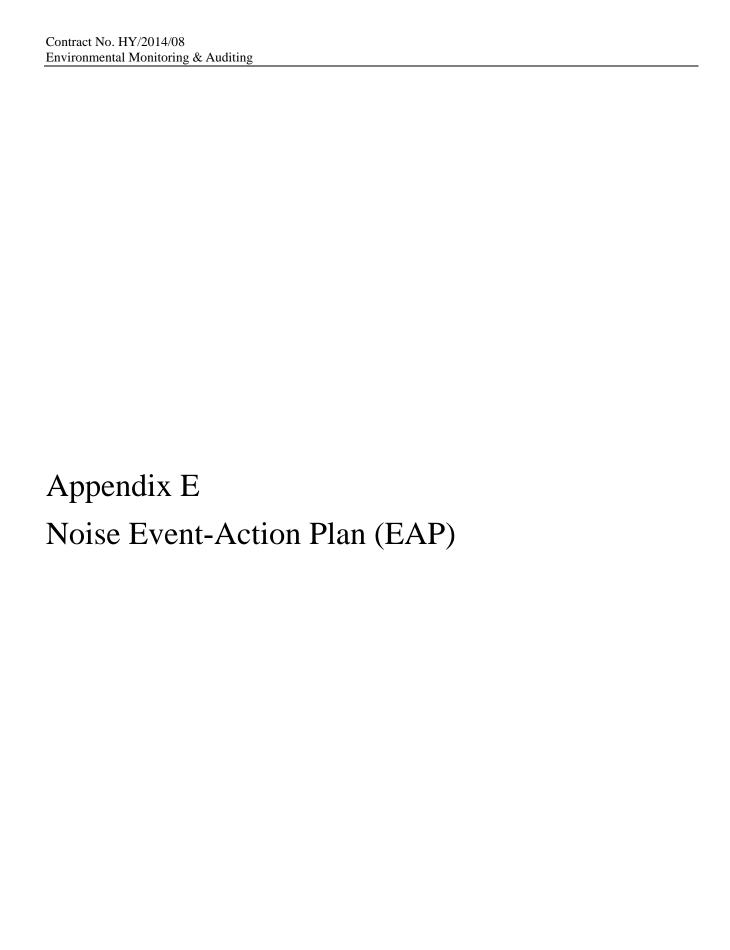

EVENT		ACTIO	ON	
	ET	IEC	ER	CONTRACTOR
Action Level	<ol> <li>Identify source, investigate the causes of exceedance and propose remedial measures;</li> <li>Notify IEC and Contractor;</li> <li>Report the results of investigation to the IEC, ER and Contractor;</li> <li>Discuss with the Contractor and formulate remedial measures;</li> <li>Increase monitoring frequency to check mitigation effectiveness.</li> </ol>	<ol> <li>Review the analysed results submitted by the ET;</li> <li>Review the proposed remedial measures by the Contractor and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures are properly implemented</li> </ol>	Submit noise mitigation proposals to IEC;     Implement noise mitigation proposals.
Limit Level	<ol> <li>Identify source;</li> <li>Inform IEC, ER, EPD and Contractor;</li> <li>Repeat measurements to confirm findings;</li> <li>Increase monitoring frequency;</li> <li>Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented;</li> <li>Inform IEC, ER and EPD the causes and actions taken for the exceedances;</li> <li>Assess effectiveness of Contractor's remedial actions</li> </ol>	<ol> <li>Discuss amongst ER, ET, and Contractor on the potential remedial actions;</li> <li>Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly;</li> <li>Supervise the implementation of remedial measures.</li> </ol>	<ol> <li>Confirm receipt of notification of failure in writing;</li> <li>Notify Contractor;</li> <li>Require Contractor to propose remedial measures for the analysed noise problem;</li> <li>Ensure remedial measures properly implemented;</li> <li>If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is</li> </ol>	<ol> <li>Take immediate action to avoid further exceedance;</li> <li>Submit proposals for remedial actions to IEC within 3 working days of notification;</li> <li>Implement the agreed proposals;</li> <li>Resubmit proposals if problem still not under control;</li> <li>Stop the relevant portion of works as determined by the ER until the exceedance is abated.</li> </ol>

EVENT	ACTION							
	ET	IEC	ER	CONTRACTOR				
	and keep IEC, EPD and ER informed of the results;		abated.					
	8. If exceedance stops, cease additional monitoring.							

Note:

ET – Environmental Team

IEC – Independent Environmental Checker

ER – Engineer's Representative



Appendix F
Environmental Mitigation Implementation
Schedule (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Constru	ction Dust Impact				
S4.3.10	D1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	Implemented, deficiency rectified after observation.
\$4.3.10	D2	<ul> <li>Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of no less than 1.3 L/m² to achieve the dust removal efficiency.</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	Implemented
\$4.3.10	D3	<ul> <li>Proper watering at exposed spoil should be undertaken throughout the construction phase;</li> <li>Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading;</li> <li>Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads;</li> <li>A stockpile of dusty material should not be</li> </ul>	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO     To control the dust impact     To meet     HKAQO and     TM-EIA     criteria	Implemented, deficiency rectified after observation.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		extended beyond the pedestrian barriers, fencing or traffic cones;  The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle.  Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores;  When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period;  The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials;  Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S4.3.10	D6	<ul> <li>continuously;</li> <li>Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet;</li> <li>Any skip hoist for material transport should be totally enclosed by impervious sheeting;</li> <li>Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides;</li> <li>Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system</li> <li>Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies.</li> <li>Implement regular dust monitoring under EM&amp;A programme during the construction stage.</li> </ul>	Monitoring of dust impact	Contractor	Selected rep. dust monitoring	Construction stage	• TM-EIA	• Implemented
			Compt	tion Noise (Airborn	station			

Acuity Sustainability Consulting Ltd.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S5.4.1	N1	<ul> <li>Implement the following good site practices:</li> <li>Only well-maintained plant should be operated onsite and plant should be serviced regularly during the construction programme;</li> <li>Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum;</li> <li>Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs;</li> <li>Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works;</li> <li>Mobile plant should be sited as far away from NSRs as possible and practicable;</li> <li>Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities.</li> </ul>	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented
S5.4.1	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	Annex 5, TM- EIAO	Implemented
\$5.4.1	N3	Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with 25mm thick internal sound absorptive lining), acoustic mat or full enclosure,	Sreen the noisy plant items to be used at all construction	Contractor	All construction sites where practicable	Construction stage	Annex 5, TM- EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		screen the noisy plants including air compressors, generators and handheld breakers, etc.	sites					
S5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	Annex 5, TM- EIAO	Implemented
S5.4.1	N5	Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/ unloading activities	Contractor	Mucking out locations	Construction stage	• Annex 5, TM- EIAO	Implemented
S5.4.1	N6	Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM- EIAO	Implemented
S5.4.1	N7	Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected rep. noise monitoring station	Construction stage	• TM-EIAO	Implemented

Water Quality (Construction Phase)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.1		In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following:  Construction Runoff  • At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction;  • The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/ sediment trap. The sediment/ silt traps should be incorporated in the permanent drainage channels to enhance deposition rates;  • The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-EIAO TM-DSS	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of 0.1 m3/s a sedimentation basin of 30 m3 would be required and for a flow rate of 0.5 m3/s the basin would be 150 m3. The detailed design of the sand/silt traps shall be undertaken by the contractor prior to the commencement of construction;  • All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. Exposed slope surfaces should be covered by tarpaulin or other means;  • The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows, and all traffic areas and access roads protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during prolonged periods of inclement weather and the reduction of surface sheet flows;  • All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas;  • Measures should be taken to minimize the ingress of site drainage into excavations. If the excavation						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities;  Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50m3 should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system;  Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers;  Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes;  All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and site wheel washing facilities should be provided at every construction						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains;  Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain;  Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts;  All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby;  Adopt best management practices;  All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable.						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.2	W2	<ul> <li>Tunneling Works and Underground Works</li> <li>Cut-&amp;-cover tunneling work should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable.</li> <li>Uncontaminated discharge should pass through sedimentation tanks prior to off-site discharge;</li> <li>The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater;</li> <li>Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries.</li> </ul>	To minimize construction water quality impact from tunneling works	Contractor	All tunneling portion	Construction stage	Water     Pollution     Control     Ordinance     ProPECC PN     1/94     TM-DSS     TM-EIAO	• Implemented
S6.9.1.3	W3	Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	Water     Pollution     Control     Ordinance     TM-DSS	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.						
S6.9.1.5	W4	<ul> <li>No direct discharge of groundwater from contaminated areas should be adopted.</li> <li>A discharge license under the WPCO through the Regional Office of EPD for groundwater discharge should be applied. Prior to the excavation works within these potentially contaminated areas, the groundwater quality should be reviewed during the process of discharge license application. The compliance to the Technical Memorandum on Standards for Effluents Discharged into Drainage on Sewerage Systems, Inland and Coastal Waters (TM-DSS) and the existence of prohibited substance should be confirmed. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, the contaminated groundwater should be either properly treated in compliance with the requirements of the TM-DSS or properly recharged into the ground.</li> <li>If wastewater treatment is deployed, the wastewater treatment unit shall deploy suitable treatment process (e.g. oil interceptor / activated carbon) to reduce the pollution level to an</li> </ul>	To minimize groundwater quality impact from contaminated area	Contractor	Excavation areas where contamination is found	Construction stage	Water     Pollution     Control     Ordinance     TM-DSS     TM-EIAO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		acceptable standard and remove any prohibited substances (e.g. TPH) to undetectable range. All treated effluent from wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be discharged into the foul sewers.  • If groundwater recharging wells are deployed, recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in the Section 2.3 of TM-DSS. The baseline groundwater quality shall be determined prior to the selection of the recharge wells, and submit a working plan (including the laboratory analytical results showing the quality of groundwater at the proposed recharge location(s) as well as the pollutant levels of groundwater to be recharged) to EPD for agreement. Pollution levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Prior to recharge, any prohibited substances such as TPH products should be removed as necessary by installing the petrol interceptor.						
\$6.9.1.6		Accidental Spillage  In order to prevent accidental spillage of chemicals, the following is recommended:	To minimize water quality impact from accidental	Contractor	All construction site where practicable	Construction stage	Water     Pollution     Control     Ordinance	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		All the tanks, containers, storage area should be bunded and the locations should be locked as far as possible from the sensitive watercourse and stormwater drains;  The Contractor should register as a chemical waste producer if chemical wastes would be generated. Storage of chemical waste arising from the construction activities should be stored with suitable labels and warnings.  Disposal of chemical wastes should be conducted in compliance with the requirements as stated in the Waste Disposal (Chemical Waste) (General) Regulation.	spillage				<ul> <li>ProPECC PN 1/94</li> <li>TM-EIAO</li> <li>TM-DSS</li> </ul>	
			Waste Manage	ement (Construction )	Waste)			
S7.4.1	WM1	Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite dyke rock should be separated at the source sites as far as practicable and stored at designated stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete	Separation of unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use	Contractor	All construction sites	Construction stage	• DEVB (W) No. 6/2010	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored.						
\$7.5.1	WM2	<ul> <li>Construction and Demolition Material</li> <li>Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement;</li> <li>Carry out on-site sorting;</li> <li>Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate;</li> <li>Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible;</li> <li>Implement a trip-ticket system for each works contract to ensure that the disposal of C&amp;D materials are properly documented and verified; and</li> </ul>	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land     (Miscellaneo     us Provisions)     Ordinance     Waste     Disposal     Ordinance     ETWB TCW     No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction.						
\$7.5.1	WM3	<ul> <li>Standard formwork or pre-fabrication should be used as far as practicable in order to minimize the arising of C&amp;D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage;</li> <li>The Contractor should recycle as much of the C&amp;D materials as possible on-site. Public fill and C&amp;D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.</li> </ul>	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land     (Miscellaneo     us Provisions)     Ordinance     Waste     Disposal     Ordinance     ETWB TCW     No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM5	<ul> <li>All construction plant and equipment shall be designed and maintained to minimize the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location;</li> <li>All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash;</li> <li>Before moving the vessels which are used for transporting dredged material, excess material shall be cleaned from the decks and exposed fittings of vessels and the excess materials shall never be dumped into the sea except at the approved locations;</li> <li>Adequate freeboard shall be maintained on barges to ensure that decks are not washed by wave action.</li> <li>The Contractors shall monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The Contractor shall keep and produce logs and other records to demonstrate compliance and that journeys are consistent with designated locations and copies of such records shall be submitted to the engineers;</li> <li>The Contractors shall comply with the conditions in the dumping licence.</li> </ul>	To control pollution due to marine sediment	Contractor	Along CKR alignment	Construction stage	• ETWB TCW No. 34/2002	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>All bottom dumping vessels (Hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material;</li> <li>The material shall be placed into the disposal pit by bottom dumping;</li> <li>Contaminated marine mud shall be transported by spit barge of not less than 750m3 capacity and capable of rapid opening and discharge at the disposal site;</li> <li>Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Material adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site.</li> <li>For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping designated mud pit would be a possible arrangement. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal.</li> </ul>						
S7.5.1	WM6	<ul> <li>Chemical Waste</li> <li>Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in</li> </ul>	Control the chemical waste and ensure proper storage,	Contractor	All construction sites	Construction stage	• Waste Disposal (Chemical Waste)	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes;</li> <li>Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation;</li> <li>The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and arranged so that incompatible materials are adequately separated;</li> <li>Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD.</li> </ul>	handling and disposal				(General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM7	<ul> <li>General Refuse</li> <li>General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes;</li> <li>A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law.</li> <li>Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible;</li> <li>Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor.</li> </ul>	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste     Disposal     Ordinance	• Implemented
	ı		Land Contamin	ation		1		
S8.9 & Appendix 8.4	Excavation of the Contaminated Soil  Prior to commencement of the excavation works at the contamination zone, the zone should be clearly marked out on site and the surface levels recorded. Excavation of contaminated material should be undertaken using dedicated earth-moving plant.  The excavated contaminated soils would be stockpiled at designated area on site and covered by sheet to prevent dispersion of contamination		The contaminated soil will be excavated for on-site reuse	Contractor	РВН4	Prior to commencement of construction works within the contaminated area	Practice     Guide (PG)     for     Investigation     and     Remediation     of     Contaminate     d Land	Implemented

EIA Ref.	EM&A Log Ref.	Reco	mmended Mitiga	tion Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		during stockpiling.  The Contractor should pay attention to the selection of suitable groundwater lowering schemes and discharge points if the groundwater table is higher than the contaminated soils during excavation. The Contractor should also obtain a valid Water Pollution Control Ordinance (WPCO) discharge licence from EPD where applicable.							Guidance     Notes for     Contaminate     d Land     Assessment     and     Remediation     Guidance	
S8.9 & Appendix 8.4	LC3	<ul> <li>Following completion of the excavation to the specified depth, at least one sample from the base of the excavation and four samples evenly distributed along the boundary of the excavation shall be taken for a closure assessment testing. The acceptance criterion is shown below:</li> </ul>						Manual for Use of Risk- Based Remediation Goals (RBRGs) for Contaminate	Implemented	
		Locations Testing Acceptance requirement Criteria  PBH4 PCBs RBRGs (Public Park)  • If the results of analysis below the RBRGs (Public Park), no further excavation will be required.  If the analysis indicates presence of contamination (i.e. noncompliance of the acceptance criteria), further excavation shall be carried out in 0.5m increment vertically and/or horizontally depending on the location(s) of the sample(s) which has exceeded the acceptance criteria. Further sampling shall also be conducted for compliance testing. The process of						d Land Management		

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
Appendix 8.4	LC4	excavation, sampling and compliance testing should continue until all contaminated materials are removed and should be supervised by a Land Contamination Specialist.  A Remediation Report (RR) to demonstrate adequate clean-up shall be prepared and submitted to EPD for endorsement prior to the commencement of any construction/development works within the sites. No construction/development works shall be carried out						• Implemented
		prior to the endorsement of the RR by EPD.		 Hazard to Life				
S9.18	H1	Blasting activities regarding transport and use of explosives should be supervised and audited by competent site staff to ensure full compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives handling and transport would be acceptable	Contractor	Works areas at which explosives would be used	Construction stage	Dangerous     Goods     Ordinance	• N/A
S9.6, para.4	H2	Detonators shall not be transported in the same vehicle with other Category 1 Dangerous Goods.	To reduce the risk of explosion during the transport of cartridged emulsion	Contractor	-	Construction stage	Dangerous     Goods     Ordinance	• N/A
S9.6, para.8	Н3	The explosives delivery trucks should be approved by Mines Division and should meet the regulatory requirements for transport of explosives.	To comply with the requirements for approval of an explosives	Contractor	-	Construction stage	Dangerous     Goods     Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			delivery vehicle					
S9.10, para.7 and S9.18	H4	Blast cover should be provided for shaft at HMT, and kept closed during blasting.  Provision of blast doors or heavy duty blast curtains should be implemented at the shaft to prevent flyrock and control the air overpressure.	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
\$9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	Н7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	Dangerous     Goods     Ordinance	• N/A
\$9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.						
S9.18	Н9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H10	Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H11	Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H12	Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms and thunderstorms.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.18	H13	For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H14	Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H22	It is recommended to explore to minimize the use of the cartridged emulsion explosives and maximize the use of bulk emulsion explosive as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H24	It is recommended to explore to use smaller explosive charges such as 'cast boosters' or 'mini-cast booster' instead of cartridged emulsion as primers for bulk emulsion. This option reduces the quantity of explosives required for transportation for the sections where bulk emulsion will be used.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
			Lan	dscape & Visual				
S10.10.1 Table 10.11	LV3	Good Site Management     Large temporary stockpiles of excavated material shall be covered with unobtrusive sheeting to prevent dust and dirt spreading to adjacent landscape areas and vegetation, and to create a neat and tidy visual appearance.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance.						
S10.10.1 Table 10.11	LV4	<ul> <li>Screen Hoarding</li> <li>Decorative screen hoarding should be erected to screen the public from the construction area. It should be designed to be compatible with the existing urban context.</li> </ul>	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV5	Lighting Control during Construction     All lighting in the construction site shall be carefully controlled to minimize light pollution and night-time glare to nearby residencies and GIC. The Contractor shall consider other security measures, which shall minimize the visual impacts.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV6	Erosion Control     The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil.	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	Tree Protection & Preservation  • Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval in due course in accordance with ETWB TC no. 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	• 'Guidelines for Tree Risk Management and Assessment Arrangement on an Area Basis and on a Tree Basis', Greening,	Implemented


EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S10.10.1 Table 10.11	LV8	Tree Transplantation  • For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	Landscape and Tree Management (GLTM) Section, DEVB Latest recommende d horticultural practices from GLTM Section, DEVB ETWB TCW 3/2006 Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							2/2004	
S10.10.1 Table 10.11	LV9	<ul> <li>Compensatory Planting</li> <li>For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006.</li> <li>Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process.</li> </ul>	Minimize visual impact and also enhance landscape	Contractor	Within Project site	Construction stage	ETWB TCW 3/2006  Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB  ETWB TCW 2/2004	• N/A
			Cultural Heritage	Impact (Construct	on Phase)			

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures  The contractor should be alerted during the	Objectives of the Recommende d Measures & Main Concerns to address To preserve any	Implementation Agent Contractor	Location / Timing	Implementation Stage  Construction stage	Requirements and/ or standards to be achieved	Implementation Status  • Implemented
		construction on the possibility of locating archaeological remains and as a precautionary measure, AMO shall be informed immediately in case of discovery of antiquities or supposed antiquities in the subject sites.	cultural heritage items which may be removed and damaged by the excavation		construction works for cut and cover tunnels	· ·	requirements	
S12.6.1	CH3	<ul> <li>Protective covering should be provided for the buildings in the form of plastic sheeting;</li> <li>Buffer zones should be provided between the construction works and the external walls of the buildings and should be as large as site restrictions allow and be marked out by temporary fencing or hoarding;</li> <li>An underpinning scheme is required to transfer the existing column loadings to a deeper rock stratum. The supporting system includes cutting the existing ground floor slab to expose the existing pile caps and then construct transfer beams at both sides of the pile caps. The transfer beams will tie up with the existing caps. Loadings of the transfer beams will be transferred to the rock socket piles installed at the two ends of the beams;</li> <li>The AAA settlement and tilting limit should be 6/8/10 mm and1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		<ul> <li>Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.</li> </ul>						
\$12.6.1		<ul> <li>Adopting diaphragm wall construction method;</li> <li>Grout curtain should be provided in front of the building;</li> <li>Recharging system should be installed as a contingency measure to mitigate the fluctuation of water table;</li> <li>the AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000;</li> <li>Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;.</li> <li>Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance.</li> </ul>	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines     for Cultural     Heritage     Impact     Assessment     EIAO-TM     Annex 10 and     Annex 19     AMO     Proposed     Vibration     Limits	• Implemented
S12.6.1 Table 12.2		<ul> <li>The Alert, Alarm and Action (AAA) vibration limit will be set at 3/4/5 mm/s and a condition survey shall be carried out by the project proponent prior to the construction phase to confirm this assessment</li> <li>Vibration monitoring of the structure shall be employed during the construction phase to ensure that the level is not exceeded. The monitoring proposal should be sent to AMO for comment.</li> </ul>	Protect the building from damage from construction works	Contractor	Tin Hau Temple (CKR- 02)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment     EIAO-TM Annex 10 and Annex 19     AMO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/or standards to be achieved	Implementation Status
							Proposed Vibration Limits	
				EM&A Project				
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual	Control EM&A Performance	Highways Department	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented
S13.2-13.4	EM2	<ul> <li>An Environmental Team needs to be employed as per the EM&amp;A Manual;</li> <li>Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures;</li> <li>An environmental impact monitoring needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&amp;A Manual are fully complied with.</li> </ul>	Perform environmental monitoring & auditing	Highways Department/ Contractor	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented

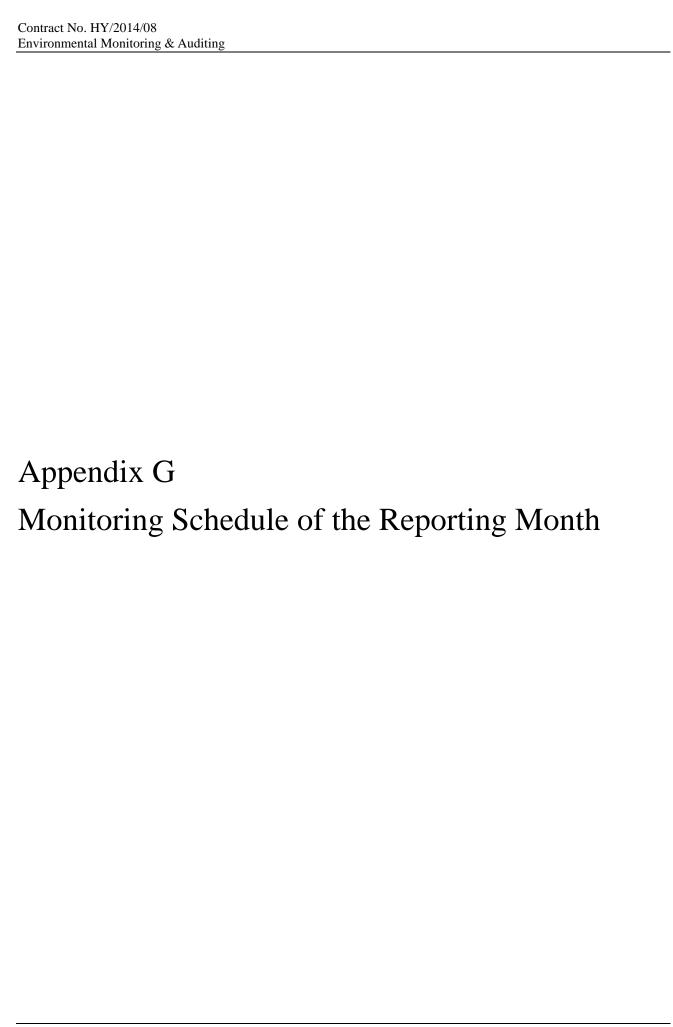

1. 1/1.2. (1.11.6.1977)								
	Impact Monitoring Schedule for YMTE							
Comp.	Mon	Tue	Jan-22 Wed	Thur	Fri	Sat		
Sun	Mon	Tue	Wed	Inur	Fri	Sat		
						1		
	_	-	_	_	7	-		
2	3		5	6	7	8		
		Impact						
		Air monitoring for W-A6 &W-A1						
		Noise monitoring for W-N1A,						
		W-P11,W-N18 & W-N25A						
9	10	11	12	13	14	15		
	Impact		Impact			Impact		
	Air monitoring for W-A6 &W-A1		24-hour air monitoring for W-A6			Air monitoring for W-A6 &W-A1		
	Noise monitoring for W-N1A,					Noise monitoring for W-N1A,		
	W-P11,W-N18 & W-N25A					W-P11,W-N18 & W-N25A		
16	17	18	19	20	21	22		
					Impact			
					Air monitoring for W-A6 &W-A1			
					Noise monitoring for W-N1A,			
					W-P11,W-N18 & W-N25A			
23	24	25	26	27	28	29		
				Impact				
				Air monitoring for W-A6 &W-A1				
				Noise monitoring for W-N1A,				
				W-P11,W-N18 & W-N25A				
30	31							
	Impact							
	Air monitoring for W-A6 &W-A1							
	Noise monitoring for W-N1A,							
	W-P11,W-N18 & W-N25A							
			I .	l .	i e			
						l l		

Remark: Due to the electricity supply failure for the high volume sampler (HVS) on 10 January 2022 at Man Cheong Building (W-A6), 24-hour TSP result was voided. Inspection and repair works for the electricity supply were conducted by the Contractor on 11 January 2022. Additional monitoring for 24-hour TSP at W-A6 was arranged on 12 January 2022. The result was valid and used as a substitute for the voided monitoring result on 10 January 2022.

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix H
Calibration Certificates
(Air Monitoring)







Tel. : (852) 2698 6835 Fox.: (852) 2698 9385

#### Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 12-Sep-21 to 19-Sep-21

 Next Verification Test Date:
 20-Sep-22

 Unit-under-Test- Model No.
 Sibata LD-5R

 Unit-under-Test Serial No.
 992821

 Our Report Refrence No.
 RPT-21-HVS-0012

Standard Equipment Information			
Verification Equipment Type		Tisch's TSP	Tish HVS
vernication Equipment Type		HVS	Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028
Equipment serial no.	MFC	1049	1050
Last Calibration Date		4-Sep-21	24-Sep-20
Next Calibration Date		4-Nov-21	24-Sep-21

Verification	Date		Time		K-Factor	Counts/ Minute (R)	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	12/9/2021	4012.12	4014.84	163.20	0.00115	85.67	13981	R211363/1	98
2	12/9/2021	4014.84	4018.16	199.20	0.00125	93.00	18526	R211363/2	116
3	12/9/2021	4018.16	4021.16	180.00	0.00101	89.00	16020	R211363/3	89
4	19/9/2021	4046.44	4049.65	192.60	0.00040	63.67	12262	R211364/1	26
5	19/9/2021	4049.65	4052.95	198.00	0.00041	65.33	12936	R211364/2	27
6	19/9/2021	4052.95	4055.56	156.60	0.00066	59.33	9291.6	R211364/3	39
				•	0.00081				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

0.8

By Linear Regression of y on x:

slope, mh= 2.5858 intercept,ch= -130.6851 \*Correlation Coefficient,R= 0.9584


Verification Test Result: <u>Strong Correlation</u>, <u>Results were accepted</u>.

 $\mbox{*}$  If the Correlation Coefficient, R is <0.5. Checking and Re-

verification are required.

Verified By: Technical Manager

Date: <u>09-10-2021</u>

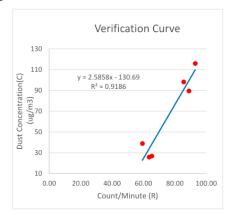







Tel.: (852) 2698 6833 Fax.: (852) 2698 9383

### Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Jun-21 to 1-Jul-21

Next Verification Test Date:1-Jul-22Unit-under-Test- Model No.Sibata LD-5RUnit-under-Test Serial No.851819Our Report Refrence No.RPT-21-HVS-0006

Standard Equipment Information			
Verification Equipment Type		Tisch's TSP	Tish HVS
Vernication Equipment Type		HVS	Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028
Equipment serial no.	MFC	1049	1050
Last Calibration Date		17-Jun-21	24-Sep-20
Next Calibration Date		17-Aug-21	24-Sep-21

Verification	Date		Time		K-Factor	Counts/ Minute (R)	(R) Total Counts (TC)	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)			ID No.	y axis
1	27/6/2021	1254.37	1257.37	180.00	0.00118	28.33	5100	R210872/1	33.33
2	27/6/2021	1258.44	1261.44	180.00	0.00105	56.33	10140	R210872/2	59.26
3	27/6/2021	1262.31	1265.31	180.00	0.00127	7.67	1380	R210872/3	9.72
4	1/7/2021	1265.84	1268.84	180.00	0.00098	74.67	13440	R210887/1	73.15
5	1/7/2021	1269.10	1272.10	180.00	0.00095	14.67	2640	R210887/2	13.89
6	1/7/2021	1272.50	1275.50	180.00	0.00093	26.00	4680	R210887/3	24.07
					0.00106				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

1.1

By Linear Regression of y on x:

slope, mh= 0.9843 intercept, ch= 1.5024 \*Correlation Coefficient, R= 0.9941


Verification Test Result: <u>Strong Correlation, Results were accepted.</u>

\* If the Correlation Coefficient, R is <0.5. Checking and Reverification are required.

Verified By:

Technical Manager

Date: 20-07-2021

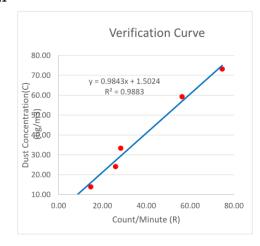



RECALIBRATION DUE DATE:

August 3, 2022

**Calibration Certification Information** 

Cal. Date: August 3, 2021

Rootsmeter S/N: 438320

Ta: 295 Pa: 750.57 °K

Operator: Jim Tisch

Calibration Model #: TE-5028A

Calibrator S/N: 3702

mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.3170	4.1	1.50
2	3	4	1	1.0350	6.7	2.50
3	5	6	1	0.9420	8.0	3.00
4	7	8	1	0.8650	9.3	3.50
5	9	10	1	0.6540	16.2	6.00

Data Tabulation						
Vstd	Qstd	$\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}$		Qa	√∆H(Ta/Pa)	
(m3)	(x-axis)	(y-axis)	Va	(x-axis)	(y-axis)	
0.9922	0.7534	1.2233	0.9945	0.7552	0.7678	
0.9887	0.9553	1.5793	0.9911	0.9576	0.9913	
0.9870	1.0478	1.7300	0.9893	1.0503	1.0859	
0.9853	1.1390	1.8686	0.9876	1.1417	1.1729	
0.9761	1.4925	2.4466	0.9784	1.4960	1.5356	
	m=	1.64554		m=	1.03041	
QSTD	b=	-0.00368	QA	b=	-0.00231	
	r= 0.99975		-	r=	0.99975	

	Calculation	ns		
Vstd=	ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)	
Qstd=	Vstd/∆Time	Qa= Va/ΔTime		
	For subsequent flow ra	te calculatio	ns:	
Qstd=	$1/m\left(\left(\sqrt{\Delta H\left(\frac{Pa}{Pstd}\right)\left(\frac{Tstd}{Ta}\right)}\right)-b\right)$	Qa=	$1/m\left(\left(\sqrt{\Delta H(Ta/Pa)}\right)-b\right)$	

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
•	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slope	

#### RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30.

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.com TOLL FREE: (877)263-7610

FAX: (513)467-9009

創新科儀有限公司

## HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

#### Site Information

	YMT Catholic Primary				
Location:	Schoo1	Site ID:	₩-A1	Date:	3-Jan-2022
Serial No:	1084	Model:	TE-5170X	Operator:	Tim

#### Ambient Condition

Corrected Pressure (mm Hg):	765.9	Temperature (deg K):	291.3

#### Calibration Orifice

Model:	TE-5028A	Slope:	1.03041
Serial No.:	3702	Intercept:	-0.00231
Calibration Due Date:	3-Aug-22	Corr. Coeff:	0.99975

#### Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.33	1.139	39.2	39.80
2	2.47	1.551	40.7	41.32
3	3.20	1.765	41.4	42.04
4	3.54	1.856	41.7	42.34
5	4.18	2.017	42.3	42.95

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m= 3.5565 b= 35.7670 Corr. Coeff= 0.9997

Sampler set point(SSP)

CFM Calculations

m = sampler slope

b = sampler interceptI = chart response

Pav = average pressure

Tav = average temperature

39

Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pa = actual pressure during calibration (mm Hg)

Tstd = 298 deg K

Pstd = 760 mm Hg

For subsequent calculation of sampler flow:

(1.21\*m+b)/[Sqrt(298/Tav)(Pav/760)]

Tim

創新科儀有限公司

## HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

#### Site Information

Location:	YMT Catholic Primary School	Site ID:	W-A1	Date:	20-Jan-2022
Serial No:	1084	Mode1:	TE-5170X	Operator:	Tim

#### Ambient Condition

Corrected Pressure (mm Hg):	763.9	Temperature (deg K):	290.6

#### Calibration Orifice

Model:	TE-5028A	Slope:	1.03041
Serial No.:	3702	Intercept:	-0.00231
Calibration Due Date:	3-Aug-22	Corr. Coeff:	0.99975

#### Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.21	1.086	39.2	39.80
2	2.36	1.516	40.5	41.12
3	3.41	1.822	41.4	42.03
4	3.87	1.941	41.8	42.44
5	4.36	2.060	42.1	42.74

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	3.0440	b=	36.4969	Corr. Coeff=	0.9998

m = sampler slope

b = sampler interceptI = chart response

Pav = average pressure

Tav = average temperature

Sampler set point(SSP)

CFM Calculations

40

Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pa = actual pressure during calibration (mm Hg)

Tstd = 298 deg K

Pstd = 760 mm Hg

For subsequent calculation of sampler flow:

(1.21\*m+b)/[Sqrt(298/Tav)(Pav/760)]

Tim

Checked by: \_\_\_\_\_ Date: 20-Jan-22

Tim

創新科儀有限公司

割 新 科 俵	表有限公司					
	HIVOL SAMPLER	CALIBR	ATION D	ATA SHEET	(TSP)	
		Site I	nformation			
Location:	Man Cheong Building	Site ID:	<b>₩-</b> A6	Date:	03-Jar	n-2022
Serial No:	1050	Model:	TE-5170X	Operator:	Ti	im
		Ambien	t Condition			
Corrected Press	ure (mm Hg):	765.9	Temperature	(deg K):	291	1.3
		Calibra	tion Orific	e		
Mode1:		Т	E-5028A	Slope:	1.03	041
Serial No.:			3702	Intercept:	-0.00	
Calibration Due	Date:	3	-Aug-22	Corr. Coeff:	0.99	975
		Calibr	ation Data	•		
Plate or	In,H2O	1	ı, X-Axis	I, CFM	TC 3	/-Axis
Test #	(in)	+	m3/min)	(chart)		
1	1.08	(1	1.026	39.3	(corrected) 39.90	
2	1.71		1.291	39.8	40.41	
3	1.83		1.335	39.9	40.51	
4	2.84		1.663	40.5	41.12	
5	4.33	2.053		41.3	41.93	
Sampler Calibtation	n Relationship (Qa on x-axis, IC	on y-axis)				
m=	1.9711	b=	37.8721	_	Corr. Coeff=	0.9998
Samp	ler set point(SSP)	40	CFM	_		
	O(Pa/Pstd)(Tstd/Ta))-b] (Tstd/Ta)]	Calo	culations  m = sampler sl b = sampler int	-		
IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]  Qstd = standard flow rate IC = corrected chart response I = actual chart response m = calibrator Qstd slope b = calibrator Qstd intercept Ta = actual temperature during calibration (deg K) Pa = actual pressure during calibration (mm Hg) Tstd = 298 deg K Pstd = 760 mm Hg For subsequent calculation of sampler flow: (1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]			I = chart respoi Tav = average to Pav = average pr	emperature		

3-Jan-22

Date:

Checked by:

創新科儀有限公司

#### HIVOL SAMPLER CALIBRATION DATA SHEET (TSP) Site Information 20-Jan-2022 Location: Man Cheong Building Site ID: ₩-A6 Date: Serial No: 1050 Mode1: TE-5170X Operator: Tim Ambient Condition 290.6 Corrected Pressure (mm Hg): Temperature (deg K): Calibration Orifice TE-5028A Model: Slope: 1.03041 Intercept: -0.00231 Serial No.: 3702 Corr. Coeff: Calibration Due Date: 3-Aug-22 0.99975 Calibration Data Plate or In,H20 Qa, X-Axis I, CFM IC, Y-Axis (m3/min) 1.099 (corrected) 38.99 Test # (chart) (in) 2.30 1.496 40.1 40.71 2.41 1.532 40.2 40.81 1.751 41.73 3.15 41.1 4.01 1.975 41.9 42.54 Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis) 4.0717 34.5593 Corr. Coeff= 0.9992 Sampler set point(SSP) 39 CFM Calculations Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b]m = sampler slope IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]b = sampler intercept I = chart response Tav = average temperature Ostd = standard flow rate IC = corrected chart response Pav = average pressure I = actual chart response m = calibrator Qstd slope b = calibrator Qstd intercept Ta = actual temperature during calibration (deg K) Pa = actual pressure during calibration (mm Hg)

20-Jan-22

Date:

Tstd = 298 deg KPstd = 760 mm Hg

Checked by: \_\_\_

For subsequent calculation of sampler flow: (1.21\*m+b)/[Sqrt(298/Tav)(Pav/760)]

Environmental Monitoring & Auditing
A 11 T
Appendix I
Calibration Certificates (Noise)
Canonation Continuates (110150)

Contract No. HY/2014/08



# Certificate of Calibration

for

Description: Sound Level Meter

Manufacturer: NTi Auaio

Type No.: XL2 (Serial No.: A24-13661-E0)

Microphone: ACO 7052 (Serial No.: 73912)

Preamplifier: NTi Audio MA220 (M2211) (Serial No.:5735)

Suomitted by:

Customer: A wity Sustainability Consulting Limited

Address: Unit C, 11/F, Ford Glory Plaza, No. 37-39 N ng Hong

Street Cheung Sha Wan, Kowloon

Upon receipt for calibration, the instrument was found to be:

✓ Within (31.5 Hz - 8k Hz)

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

 The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 17 September 2021

Date of calibration: 23 September 2021

Calibration Technician

\_\_\_ Certified by:

Date of issue. 27 September 2021

7 = 7/2

Mr. Ng Yan Wa Laboratory Manager

Certificate No.: APJ21-085 CC001

Page 1 of 4

Room 422,Leader In lustrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946

Homepage: http://www.aa-lab.com E-ma

E-mail: inquiry@aa-lab.com



#### 1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurer exast each calibration point.

#### 2. Calibration Conditions:

Air Temperature: 24.0 °C
Air Pressure: 1001 hPa
Relative Humidity: 55.7 %

#### 3. Calibration Equipment:

Type Serial No. Calibration Report Number Trace, ble to

Multifunction Calibrator B&K 42.6 2288467 AV200041 HOK A.S

#### 4. Calibration Results

Sound Pressure Level

Reference Sound Fressare Level

Set ing of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dE	Freq. W	eighting	Time Weighting	Level, d'B	Frequency, Hz	dB	Specification, dB
30-130	αВА	SPI	Fast	94	1000	94.0	±0.4

#### Linearity

Setting of Unit-under-test (UUT)		App	Applied value		IEC 61672 Class 1		
Range, dB	Freq.	Weighting	Time Weighting	Level, aB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

### Time Weigning

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1		
Range, d'5	Freq. W	eighting	Cime Weighting	Level, dB	Frequency, Hz	dB	Specification, dB	
37-130	dBA	SPL	Fast	0.4	1000	94.0	Ref	
3-130	unA	SPL	Slow	94	94 1000	94.0	±0.3	

Certificate No.: APJ21-085 CC001

Page 2 of

Room 422, Leader In Juritrial Centre, 57-59 Au Pui Wan Street ,Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com E-mail:

E-mail:inquiry@aa-lab.com



# Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司



Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. We	ighting	Time Weighting	Level, dv.	Frequency, Hz	dB	Specification, dB
				~	31.5	94.1	±2.0
				^	63	94.1	±1.5
					125	94.1	±1.5
					250	94.6	+1.4
30-130	dB	SPL	Fast	94	<i>5</i> 00	94.0	±1,4
					1000	94.0	Ref
					2000	94.3	£1.6
			//		4000	95.1	-1.6
					8000	94.3	±2/1; -3.1

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reac in 3,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				31.5	54.7	-39.4 ±2.0
				63	67.9	-26.2 ±1.5
				125	73.0	-16.1 ±1.5
				250	85.4	$-8.6 \pm 1.4$
30-130	ABA SPL	Fast	94	500	90.8	-3.2 ±1.4
				1000	94.0	Ref
	/ /			2000	95.5	+1.2 ±1.6
				4000	96.1	+1.0 ±1.6
				8000	93,9	-1.1+2.1; -3.1

C-weighting

Setting of Unit-under-test (UUT)			Appl	Applied value		IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				31.5	91.1	-3.0±2.0
				63	93.3	-0.8 ±1.5
			?	125	93.9	-0.2 ±1.5
				250	94.0	-0.0 ±1.4
30-130	dBC SPL	Fost	94	500	94.0	-0.0 ±1.4
	7 -			1000	94.0	Ref
				2000	94.2	-0.2 ±1.6
		)/		4000	94.3	-0.8±1.6
		//		8000	91.3	-3.0 +2.1: -3.1

Certificate No.: 19571-085-CC001



Page 3 of 4

Room 422, Leader In Ju Itrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong

Tel: (852) 2668 3423

Fax:(852) 2668 6946 E-mail: inquiry@aa-lab.com

Homepage: http://www.aa-lab.com



#### 5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.05
	63 Hz	± 1.05
	125 Hz	+ 0.05
	250 Hz	+ 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 35% con5dence level.

#### Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)\*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ21-085 CC001



Page 4 of 4

Room 422, Leader In Justrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com

E-mail:inquiry@aa-lab.com



# Certificate of Calibration

Description:	Sound	Level	Meter

Manufacturer: RION

Unan receipt for calibration the instrument was found to be

Type No.: NL-31 (Serial No.: 00303811)

Microphone: RION V ~-53A (Seriai No.:322686) Preamplifier:

I.ICN NH-21 (Serial No.:32330)

Submitted by:

Customer: Acui y Sustainability Consulting Limited

Address: Unit 1908 Nos. 301-305 Castle Peak Road,

Kwai Chung, N.T.

opon receipt for cambration, the instrument was found to be.
☑ Within
□ Outside
the allowable tolerance.
The test equipment used for calibration are traceable to National Standards via:

The Government of The Young Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 23 April 2021 Date of calibration: 27 April 2021

Calibrated ho:

Certified by: Calibration Technicia

Mr. Ng Yan Wa Laboratory Manager

Date of issue: 27 April 2021

Certificate No.: 4PJ21-012-CC001

Page 1 of 4

Room 422, Leader Incustrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax:(852) 2668 6946

Homepage: http://www.aa-lab.com

E-mail: inquiry@aa-lab.com

# Acoustics and Air Testing Laboratory Co. Ltd.

#### 1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in in laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

#### 2. Calibration Conditions:

Air Temperature: 24.4 °C Air Pressure: 1001 hPa Relative Humidity: 60.3 %

#### 3. Calibration Equipment:

Calibration Type Serial No. Trace: b'e to Report Number **Multifunction Calibrator** B&K 42: 6 2288467 AV200041 HOK AS

#### 4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Sett ng of Unit-under-test (UUT)		App	Applied value		IEC 61672 Class 1		
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
40-130	('BA	SPL	Fast	94	1000	94.0	±0.4

#### Linearity

Setting of Unit-under-test (UUT)			/.pp.ied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Leva, da	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
40-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

#### Time weighting

Setting o' Unit-under-test (UV Γ)			Applied value		UUT Reading,	IEC 61672 Class 1	
Ra. ge, dB	Freq. V	Veighting	7 i'ne Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
49-130	dBA	SPL	Fast	04	1000	94.0	Ref
40-130	uBA	DA SPL	Slow	94	1000	94.0	±0.3

Certificate No.: 1PJ21-012 CC001

AIR TESTING Page 2 of 4

Room 422, Leader Incus rial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com E-mail: inquiry@aa-lab.com



#### Acoustics and Air Testing Laboratory Co. Ltd.



Frequency Response

Linear Response

Setting of Unit-under-test (UUT)			Appl	Applie / value		IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				4	31.5	33.9	±2.0
					63	94.1	±1.5
					125	94.1	±1.5
					250	94.1	±1.4
40-130	dB	SPL	Fast	0.	.500	94.0	±1.4
					1000	94.0	Ref
					2000	93.9	±1.6
					4000	93.5	±1.6
					8000	91.	+2.1, -3.1

A-weighting

Setting of Unit-under-test (UUT)		Applied value		UUT Reac in g,	IEC 61672 Class	
Range, dB	Freq. Weighting	Time Weighting	Yevel, dB	Frequency, Hz	dB	Specification, dB
	^			31.5	54.7	-39.4 ±2.0
				63	67.3	-26.2 ±1.5
				125	78.0	-16.1 ±1.5
				250	85.4	-8.6 ±1.4
40-130	dB/1 SPL	Fast	94	500	90.8	-3.2 ±1.4
	//			1000	94.0	Ref
	/ (			2000	95.0	+1.2 ±1.6
- 1				4000	94.5	+1.0 ±1.6
				8000	90.6	-1.1+2.1; -3.1

C-weighting

Sett	Setting of Unit-under-test (UUT)			apriied value		IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, aB	Frequency, Hz	dB	Specification, dB
				31.5	91.0	-3.0 ±2.0
				63	93.3	-0.8 ±1.5
				125	93.9	-0.2 ±1.5
				250	94.1	-0.0 ±1.4
40-130	dBC SPI	Fast	94	500	94.1	-0.0 ±1.4
				1000	94.0	Ref
	7/			2000	93.7	-0.2 ±1.6
				4000	92.7	-0.8 ±1.6
		)/		8000	88.7	-3.0 +2.1: -3.1

Certificate No.: 4P.121-012-CC001

NR TESTING MOOR

Page 3 of 4

Room 422, Leader Incus, rial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com

E-mail: inquiry@aa-lab.com



## 5. Calibration Results Applied

The results apply to the particular unit-under-test only. Al calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.15
	63 Hz	± 0.10
	125 Hz	± 0.15
	250 Hz	± 0.10
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05
A STATE OF THE STA	The second second second second	

The uncertainties are evaluated for a 95% confidence level.

#### Note:

The values given in this certification only related to the values measured at the time of the calibration and any vace cainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)\*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: 4P.121-012-CC001



Room 422,Leader Incus rial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946
Homepage: http://www.aa-lab.com E-mail: inquiry@aa-lab.com



## CALIBRATION CERTIFICATE

Certificate Informat	ion										
Date of Issue	7-Aug-2021		Certificate Number	MLCN212053S							
Customer Information	on										
Company Name Address	Unit C, 11/F., I Nos. 37-39 Wit	ability Consulting Lin Ford Glory Plaza, ng Hing Street, an, Kowloon, HK	ited								
Equipment-under-Test (EUT)											
Description Manufacturer Model Number Serial Number Equipment Number	Acoustic Calibration Pulsar 105 63705	rator									
Calibration Particula	ar										
Date of Calibration Calibration Equipment		8) / AV200063 / 23-Ju 0) / MLEC21/05/02 /									
Calibration Procedure	MLCG00, ML	CG15									
Calibration Conditions	Laboratory EUT	Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicable Internal battery								
Calibration Results		a were detailed in the results were within EU									
Approved By & Date			A KO.Lo	7-Aug-2021							

- Statements
- Calibration equipment used for this calibration are traccable to national / international standards.

  The results on this Calibration Certificate only relate to the values measured at the time of the calibration and the uncertainties quoted will not include allowance for the EUT long term drift, variation with environmental changes, vibration and shock during transportation, overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.
- MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.

  The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior written approval of MaxLab Calibration Centre Limited.

Page 1 of 2

萬 儀 校 正 中 心 有 限 公 司 MaxLab Calibration Centre Limited 香港新界葵涌華星街 16-18 號保盈工業大廈 9 棲 B 室 Unit B, 9/F., Boldwin Industrial Bldg.. 16-18 Wah Sing Street, Kwai Chung, N.T., Hong Kong Tel: (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk



Certificate No.

MLCN212053S

Calibration Data							
EUT Setting	Standard Reading	EUT Error from Setting	Calibration Uncertainty	EUT Specification			
94 dB	93.9 dB	-0.1 dB	0.20 dB	± 0.2 dB			

- END -

Calibrated By: Date:


Keneth 7-Aug-21 Checked By:

Date:

K.O. Lo 7-Aug-21

Page 2 of 2

萬 儀 校 正 中 心 有 限 公 司 MaxLab Calibration Centre Limited 香港新界葵涌華星街 16-18 號保盈工業大厦 9 櫻 B 室 Unit B, 9/F., Boldwin Industrial Bidg., 16-18 Wah Sing Street, Kwai Chung, N.T., Hang Kong Tel: (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk

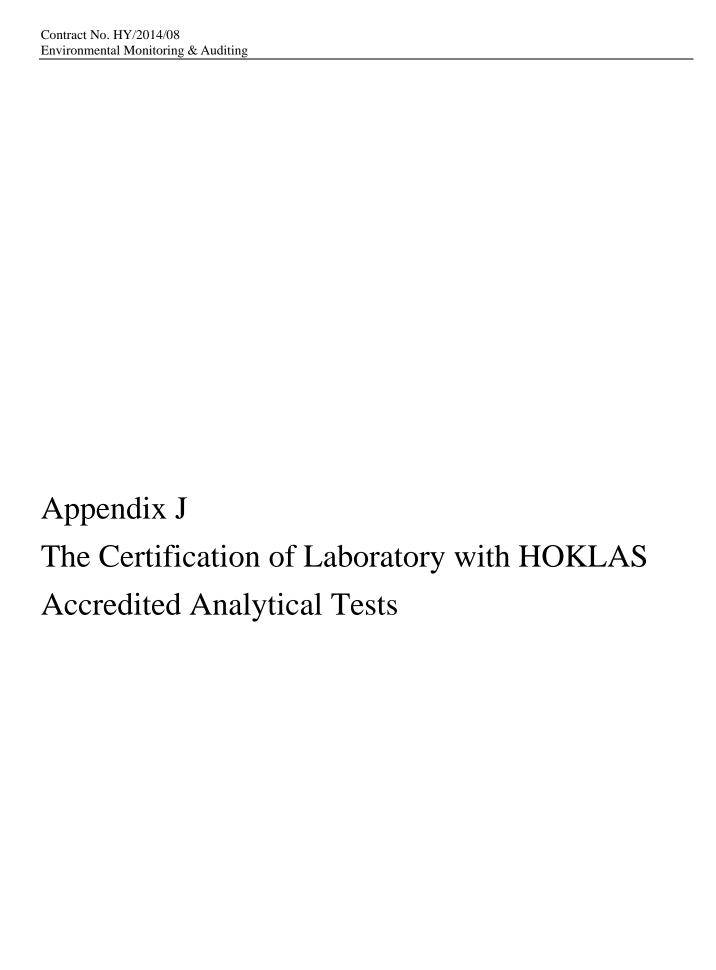



#### Hong Kong Accreditation Service 香港認可處

## **Certificate of Accreditation** 認可證書

This is to certify that 特此證明

#### ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Flat/Rm D, 12/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong

香港九龍長沙灣永康街37-39號福源廣場12樓D室

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下述測試類別中的指定實驗所活動

#### **Environmental Testing**

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué).

此项 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理關系 (見國際認可結婚・國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date: 15 November 2021

簽發日期:二零二一年十一月十五日

Registration Number : HOKLAS 241

Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日

This certificate is issued subject to the terms and conditions laid down by HKAS 本體書級照香港認可盡訂立的條款及條件發出

L002316



Hong Kong Accreditation Service 香港認可處

#### **Certificate of Accreditation**

認可證書

This is to certify that 特此間明

#### ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下述測試類別中的指定實驗所活動

#### **Environmental Testing**

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to isboratory operation (see joint IAF-ILAC-ISO Communiqué).

此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理體系 (見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date : 28 February 2020

签發日期:二零二零年二月二十八日

Registration Number : HOKLAS 066

註冊號碼:




Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日


This certificate is issued subject to the terms and conditions laid down by HKAS. 本證書按照香港認可處訂立的條款及條件發出

L001934

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix K
Location Plan of Noise and Air Quality
Monitoring Station

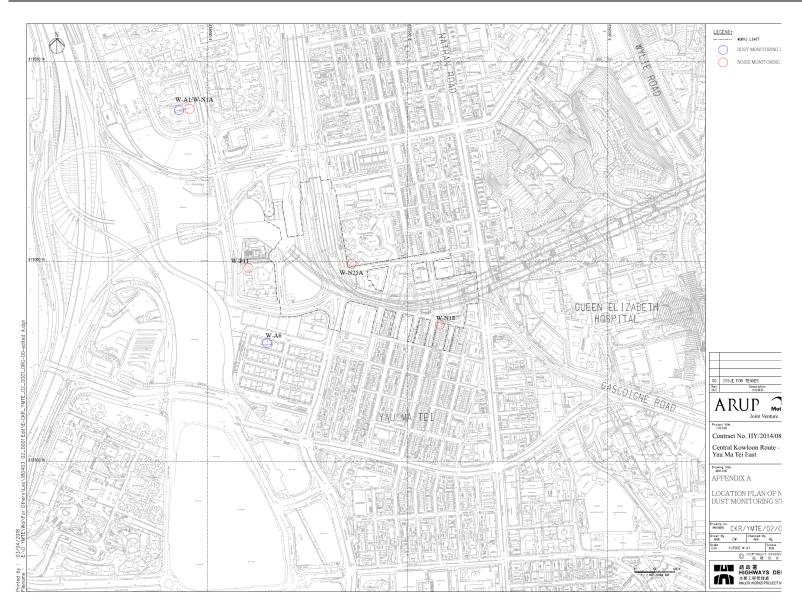

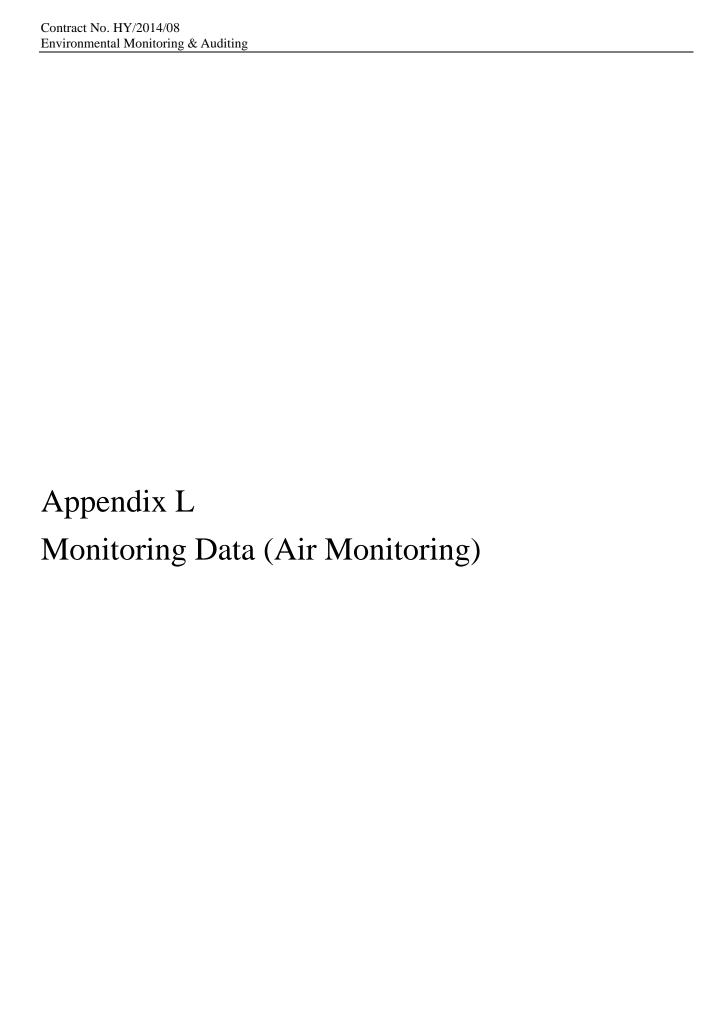

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 4, 10, 15, 21, 27 and 31 January 2022

Parameter: TSP 1-hour Other Factors Nearby traffic

			1-hour TSP (µ	1-hour TSP (μg/m³)					
Date	Weather	Start Time	1 <sup>st</sup> Hour (μg/m³)	2 <sup>nd</sup> Hour (μg/m³)	3 <sup>rd</sup> Hour (μg/m³)				
04/01/2022	Sunny	13:18	54	62	67				
10/01/2022	Fine	11:01	58	66	64				
15/01/2022	Fine	10:42	61	57	63				
21/01/2022	Sunny	13:10	62	65	58				
27/01/2022	Sunny	11:27	64	57	59				
31/01/2022 Sunny		10:25	67	72	65				
Mini	mum: 54 μg/m <sup>2</sup>	3		Maximum: 72μg/m <sup>3</sup>					

Location: Man Cheong Building (W-A6)

Monitoring date: 4, 10, 15, 21, 27 and 31 January 2022

Parameter: TSP 1-hour Other Factors Nearby traffic

			1	1-hour TSP (μg/m³)						
Date	Weather	Start Time		st Hour (μg/m³)	2 <sup>nd</sup> Hour (μg/m³)	3 <sup>rd</sup> Hour (μg/m³)				
04/01/2022	Sunny	13:37		57	72	66				
10/01/2022	Fine	10:19		64	77	70				
15/01/2022	Fine	10:02		62	65	60				
21/01/2022	Sunny	9:50		68	70	75				
27/01/2022	Sunny	10:44		68	72	66				
31/01/2022	Sunny	9:56		66	70	73				
	Minimum: 57	μg/m³	Maximum: 77 μg/m <sup>3</sup>							

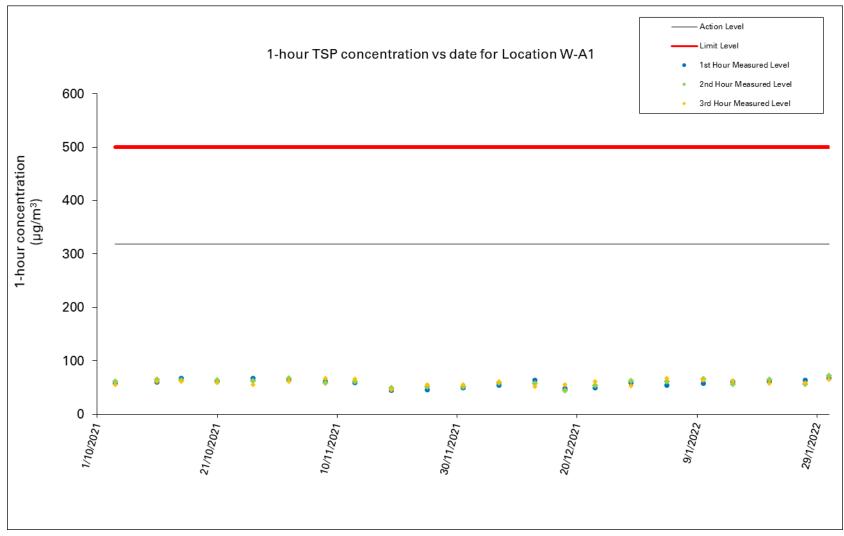


Figure 1: Graphical Illustration of Measured 1-hour TSP ( $\mu g/m^3$ ) Levels at W-A1

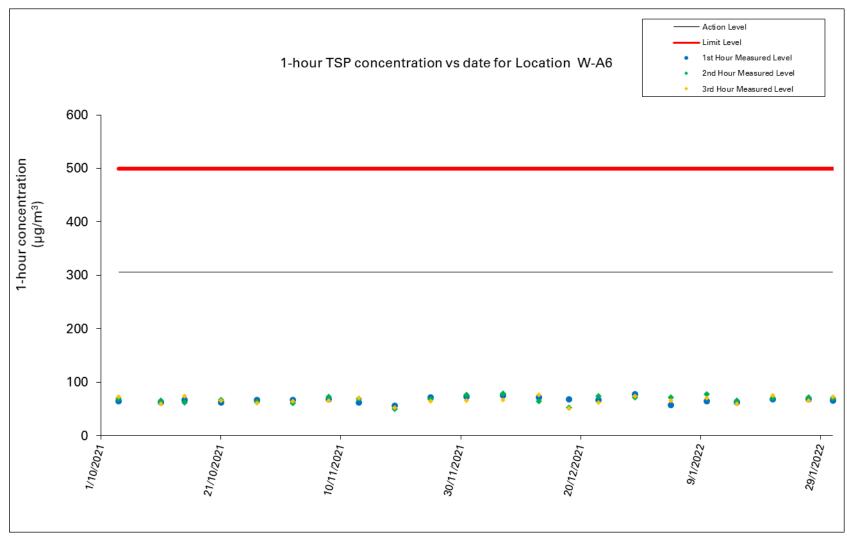


Figure 2: Graphical Illustration of Measured 1-hour TSP ( $\mu g/m^3$ ) Levels at W-A6

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 4, 10, 15, 21, 27 and 31 January 2022

Parameter: TSP 24-hour Other Factors Nearby traffic

Date of Calibration:	3-Jan-22	Slope =	3.5565
Calibration due date:	18-Jan-22	Intercept =	35.7670
Date of Calibration:	20-Jan-22	Slope =	3.0440
Calibration due date:	4-Feb-22	Intercept =	36.4969

Start Date	Weather Condition	Elapse Time Chart Readin				Charl Reading 1		Elapse Time Chart Reading Avg Air Temp Avg Atmospheric Pressure				Flow Rate	Standard Air Volume	Filter Weight (g)		Particulate weight	Conc.
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m <sup>3</sup> )	Initial	Final	(g)	$(\mu g/m^3)$		
4/1/2022	Sunny	6118.4	6142.4	1440.0	40	40	40.0	19.1	1019.6	1.37	1979	2.7652	2.8762	0.1110	56		
10/1/2022	Fine	6142.4	6166.4	1440.0	40	41	40.5	18.4	1017.5	1.51	2171	2.7733	2.8620	0.0887	41		
15/1/2022	Fine	6166.4	6190.4	1440.0	40	40	40.0	17.9	1020.1	1.40	2021	2.7504	2.8497	0.0993	49		
21/1/2022	Sunny	6190.8	6214.8	1440.0	40	41	40.5	17.9	1017.6	1.53	2209	2.7410	2.8046	0.0636	29		
27/1/2022	Sunny	6214.8	6238.8	1440.0	39	40	39.5	19.8	1016.8	1.15	1652	2.7586	2.8217	0.0631	38		
31/1/2022	Sunny	6238.8	6262.8	1440.0	40	40	40.0	14.6	1019.2	1.46	2109	2.7716	2.8483	0.0767	36		
						•		•	•	Maximum:	56	$\mu g/m^3$	Minimum:	29	$\mu g/m^3$		

Location:

Man Cheong Building (W-A6) 4, 12, 15, 21, 27 and 31 January 2022 Monitoring date:

Parameter: TSP 24-hour Nearby traffic Other Factors

Date of Calibration:	3-Jan-22	Slope =	
Calibration due date:	18-Jan-22	Intercept =	37.8721
Date of Calibration:	20-Jan-22	Slope =	4.0717
Calibration due date:	4-Feb-22	Intercept =	34.5593

Start Date	Weather Condition		Elanse Time   Chart Reading		Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter Weigl	ht (g)	Particulate weight	Conc.			
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m <sup>3</sup> /min)	( <b>m</b> <sup>3</sup> )	Initial	Final	(g)	$(\mu g/m^3)$
4/1/2022	Sunny	5707.6	5731.6	1440.00	40	41	40.5	19.1	1019.6	1.67	2404	2.7582	2.8456	0.0874	36
10/1/2022			R	Result was vo	oided due to e	lectric supply	failure, sul	ostitute 24-l	our TSP monitorin	ng was carried	d out on 12.	January 2022			
12/1/2022	Sunny	5755.6	5779.6	1440.00	40	40	40.0	16.1	1020.9	1.55	2225	2.7792	2.8988	0.1196	54
15/1/2022	Fine	5779.6	5803.6	1440.00	39	41	40.0	17.9	1020.1	1.46	2109	2.7411	2.8594	0.1183	56
21/1/2022	Sunny	5803.9	5827.9	1440.00	39	40	39.5	17.9	1017.6	1.37	1977	2.7919	2.9025	0.1106	56
27/1/2022	Sunny	5827.9	5851.9	1440.00	38	39	38.5	19.8	1016.8	1.08	1562	2.7797	2.8694	0.0897	57
31/1/2022	Sunny	5851.9	5875.9	1440.00	40	40	40.0	14.6	1019.2	1.57	2262	2.7692	2.8261	0.0569	25
-										Maximum:	57	$\mu g/m^3$	Minimum:	25	$\mu g/m^3$

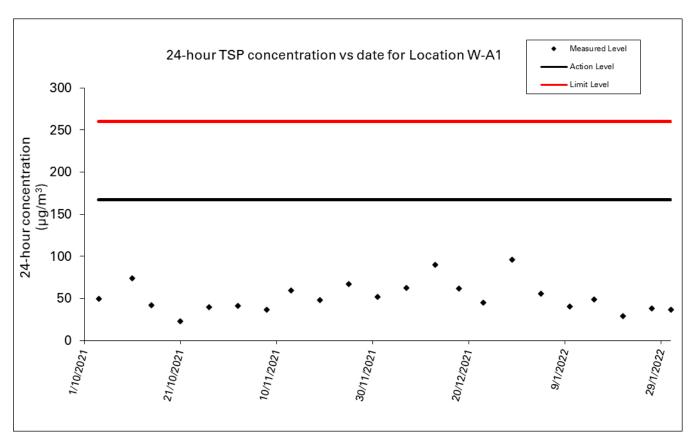


Figure 3: Graphical Illustration of Measured 24-hour TSP (μg/m³) Levels at W-A1




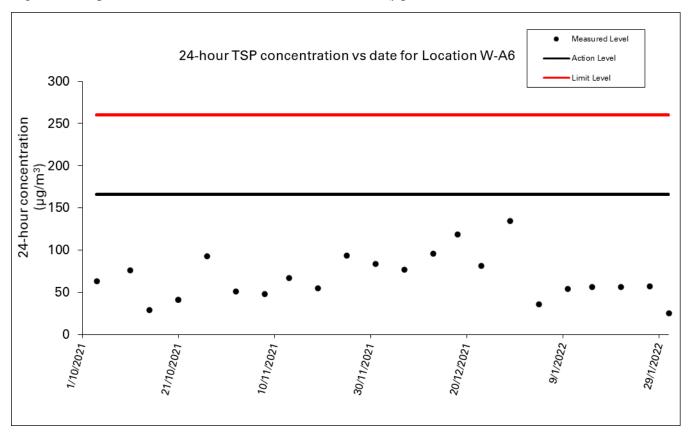



Figure 4: Graphical Illustration of Measured 24-hour TSP (μg/m³) Levels at W-A6


#### Wind direction data for 4, 5, 10, 11, 12, 13, 15, 16, 21, 22, 27, 28, 31 January 2022 and 1 February 2022

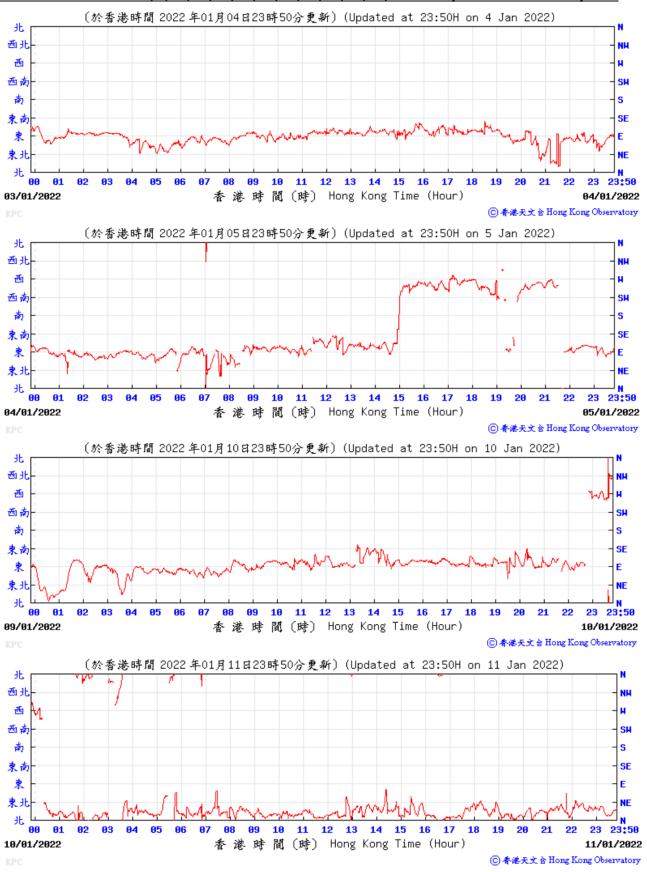


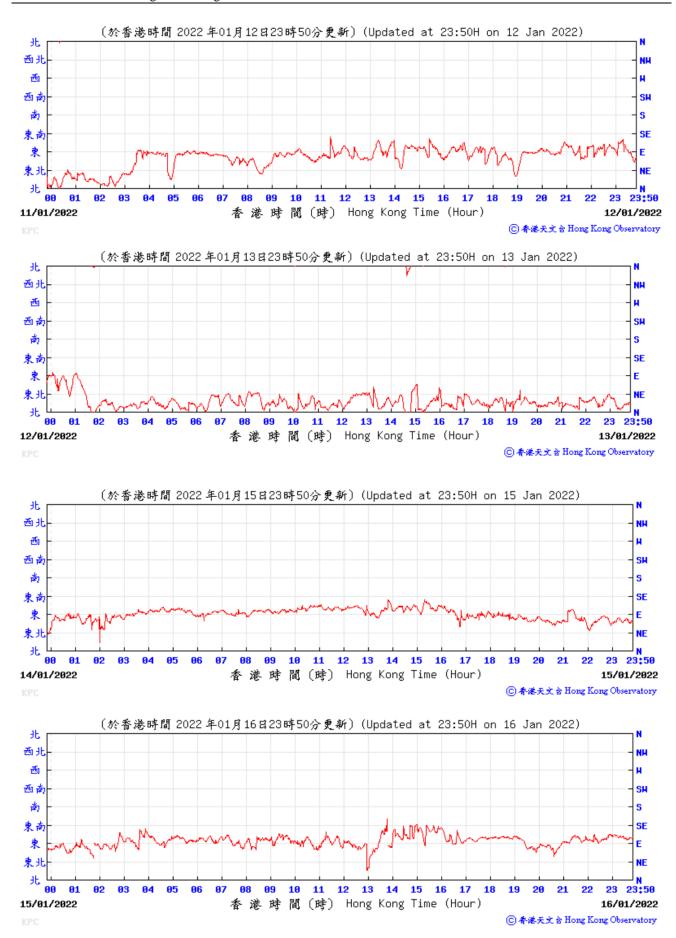


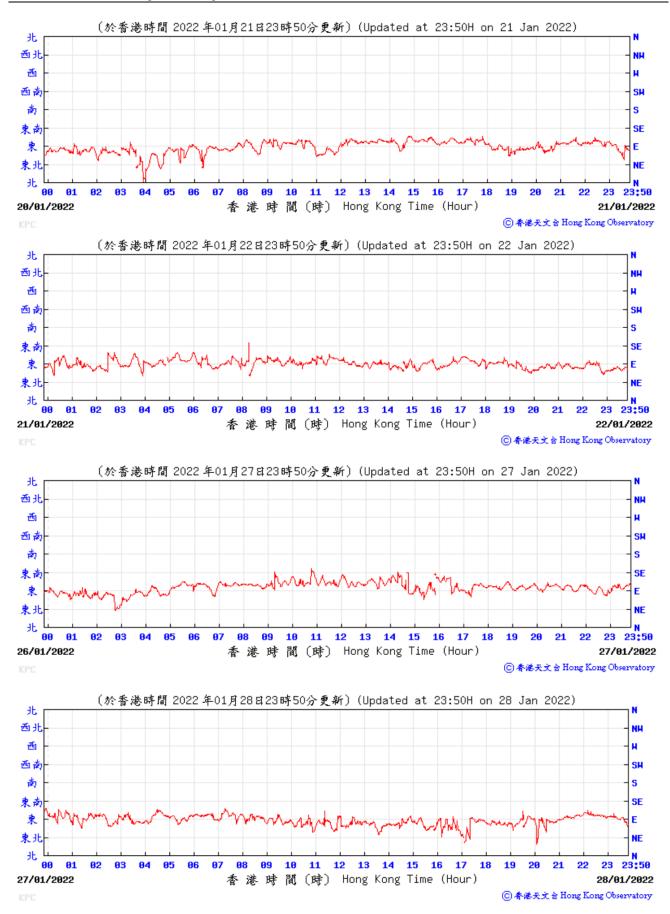


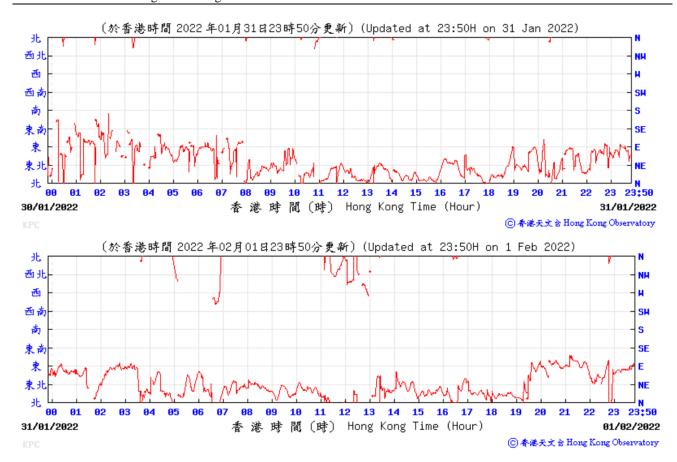





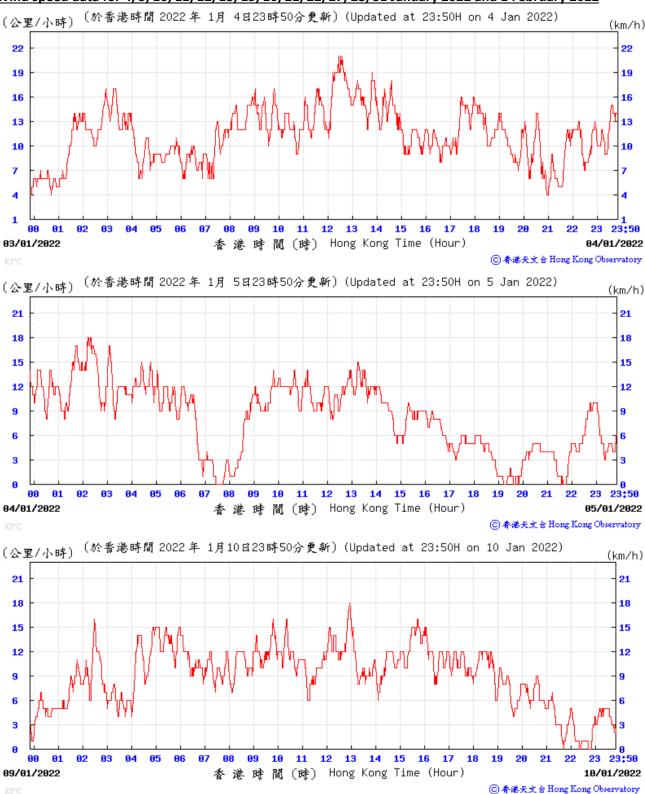


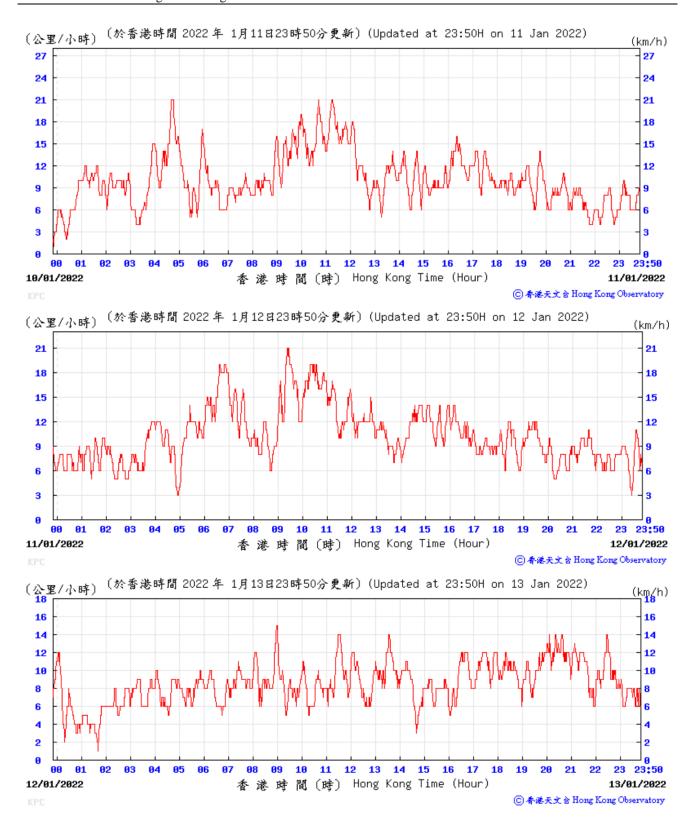

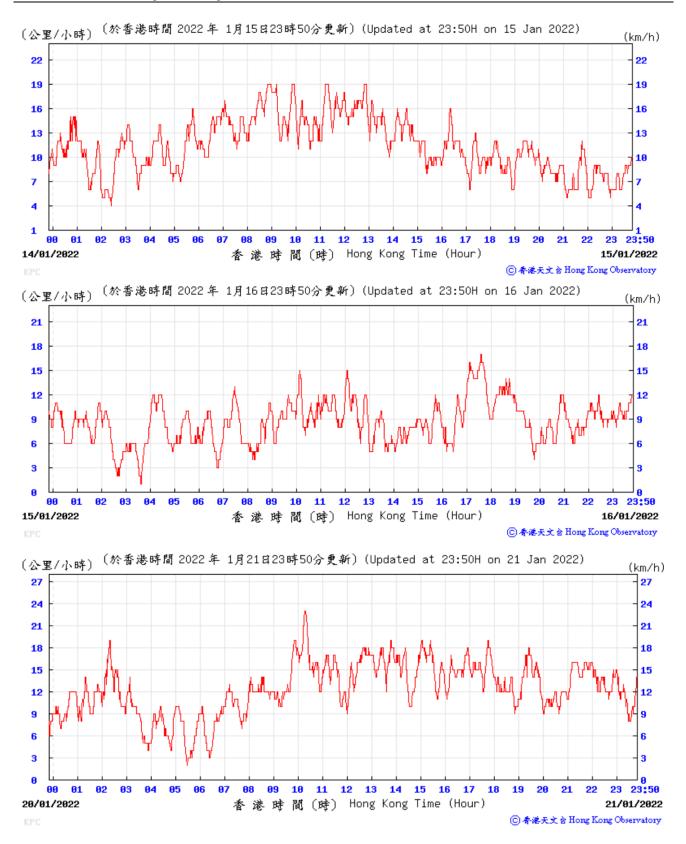

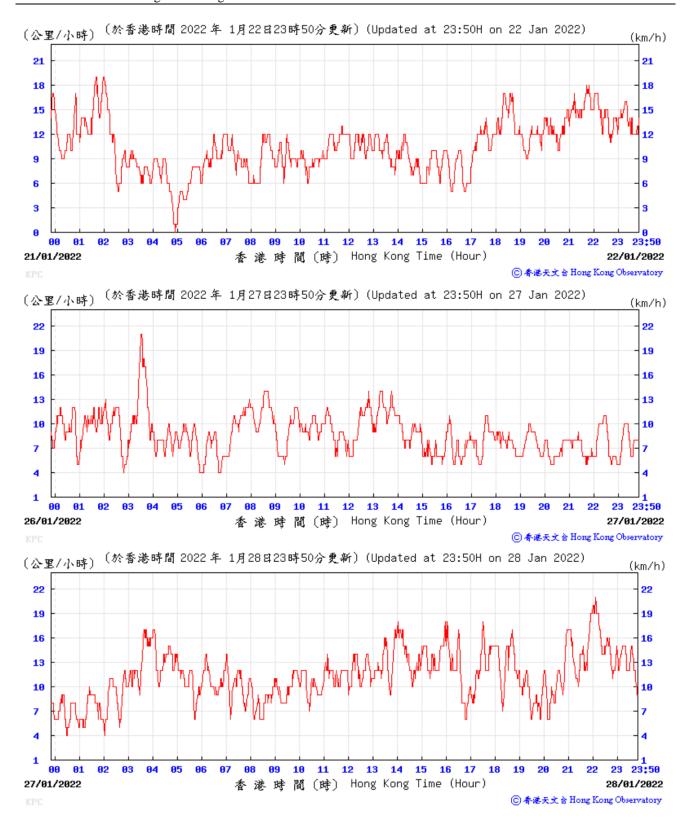

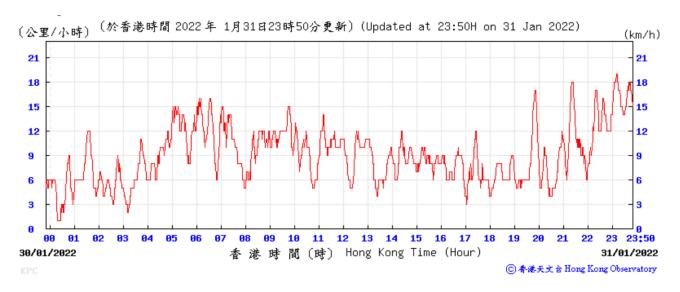

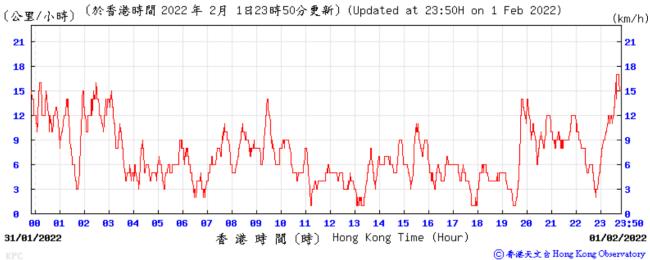

Contract No. HY/2014/08 Environmental Monitoring & Auditing
Appendix M
Monitoring Data (Noise)

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-N1A)

Monitoring date: 4, 10, 15, 21, 27 and 31 January 2022

 $\begin{array}{ll} \text{Parameter}: & L_{\text{eq}}, L_{10}, L_{90} \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$ 

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
04/01/2022	Sunny	16:08	-	16:38	59.9	61.7	58.0	4.3
10/01/2022	Fine	11:04	-	11:34	60.8	63.0	58.2	2.8
15/01/2022	Fine	10:42	-	11:12	63.2	64.9	57.3	3.9
21/01/2022	Sunny	13:32	-	14:02	61.6	63.4	59.2	3.4
27/01/2022	Sunny	11:29	-	11:59	55.8	56.5	54.9	2.2
31/01/2022	Sunny	10:30	-	11:00	58.5	61.0	56.5	3.6

Location: Hydan Place (W-N18)

Monitoring date: 4, 10, 15, 21, 27 and 31 January 2022

 $\begin{array}{ll} Parameter: & L_{eq}, L_{10}, \, L_{90} \\ Other \, Factors & Nearby \, traffic \end{array}$ 

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
04/01/2022	Sunny	14:31	-	15:01	70.7	74.6	68.9	4.2
10/01/2022	Fine	9:39	-	10:09	70.6	74.5	68.0	3.3
15/01/2022	Fine	9:50	-	10:20	70.2	73.3	66.7	3.8
21/01/2022	Sunny	10:16	-	10:46	69.6	71.3	67.0	4.6
27/01/2022	Sunny	12:20	-	12:50	72.5	72.9	68.1	2.0
31/01/2022	Sunny	9:15	-	9:45	69.2	73.1	68.2	3.3

Location: Prosperous Garden Block 1 (W-N25A)

Monitoring date: 4, 10, 15, 21, 27 and 31 January 2022

 $\begin{array}{ll} Parameter: & L_{eq}, L_{10}, \, L_{90} \\ Other \, Factors & Nearby \, traffic \end{array}$ 

Date	Weather	Start Time	-	End Time	Leq	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
04/01/2022	Sunny	15:17	-	15:47	68.9	74.8	65.5	3.5
10/01/2022	Fine	8:59	-	9:29	70.6	74.9	67.3	3.3
15/01/2022	Fine	9:09	-	9:39	69.3	73.4	66.8	4.5
21/01/2022	Sunny	11:15	-	11:45	71.4	73.2	69.3	4.2
27/01/2022	Sunny	9:52	-	10:22	68.0	69.7	65.6	2.2
31/01/2022	Sunny	9:03	-	9:33	69.5	73.0	68.7	3.2

Location: The Coronation Tower 1 (W-P11)

Monitoring date: 4, 10, 15, 21, 27 and 31 January 2022

 $\begin{array}{ll} Parameter: & L_{eq}, L_{10}, L_{90} \\ Other \ Factors & Nearby \ traffic \end{array}$ 

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	$L_{10}$	L <sub>90</sub>	Wind speed (m/s)
04/01/2022	Sunny	13:48	-	14:18	69.0	73.8	66.3	4.5
10/01/2022	Fine	11:55	-	12:25	68.3	70.4	65.5	2.9
15/01/2022	Fine	11:31	-	12:01	68.0	72.6	65.4	4.4
21/01/2022	Sunny	14:50	-	15:20	68.9	71.0	65.3	3.6
27/01/2022	Sunny	13:18	-	13:48	69.9	73.7	67.7	3.1
31/01/2022	Sunny	11:14	-	11:44	68.2	70.2	64.4	2.8

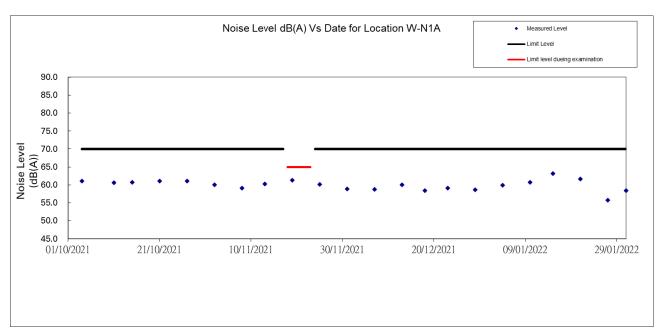


Figure 1: Graphical Illustration of Measured Noise Levels at W-N1A

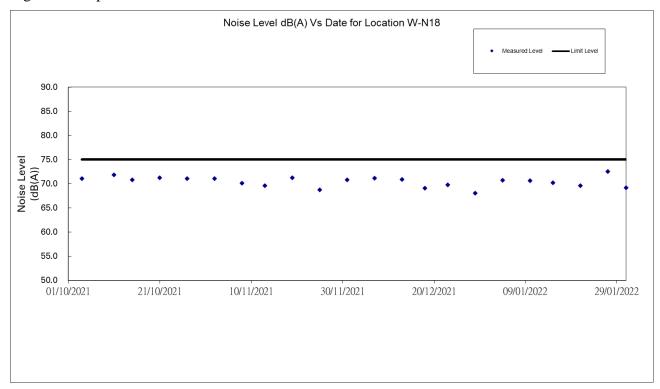


Figure 2: Graphical Illustration of Measured Noise Levels at W-N18

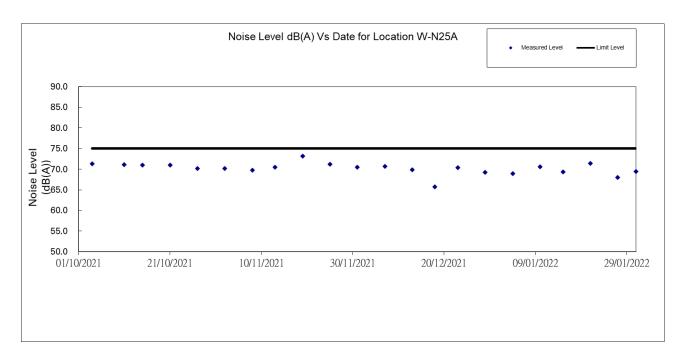


Figure 3: Graphical Illustration of Measured Noise Levels at W-N25A

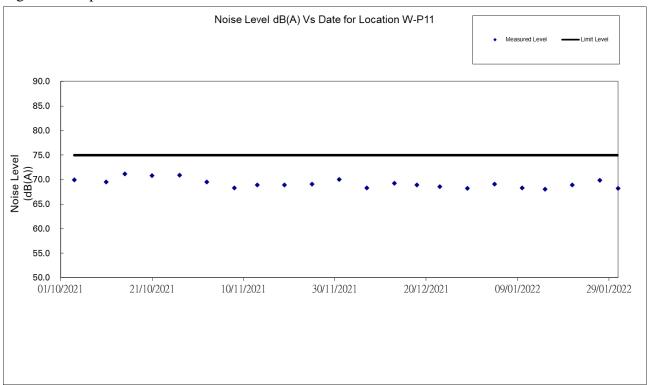


Figure 4: Graphical Illustration of Measured Noise Levels at W-P11

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix N
Waste Flow Table

**Monthly Summary Waste Flow Table** 

Name of Department: <u>Highways Department</u> Contract No. / Works Order No.: <u>HY/2014/08</u>

Monthly Summary Waste Flow Table for January 2022

[to be submitted not later than the 15<sup>th</sup> day of each month following reporting month] (All quantities shall be rounded off to 1 decimal place.)

			Actual Quantities of Inert C	Construction Waste Generated Mon	ithly	
Month	(a)=(b)+(c)+(d)+(e)+ (f)+ (g)+ (h)+ (i)+ (j)+ (k) Total Quantity Generated	(b) Hard Rock and Large Broken Concrete	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed of as Public Fill	(f) Imported Fill
	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)
Jan-22	6801.51	116.10	0.00	4412.20	2227.40	0.00
Feb-22						
Mar-22						
Apr-22						
May-22						
Jun-22						
Sub-total	6801.51	116.10	0.00	4412.20	2227.40	0.00
Jul-22						
Aug-22						
Sep-22						
Oct-22						
Nov-22						
Dec-22						
Total	6801.51	116.10	0.00	4412.20	2227.40	0.00
2018	51057.90	0.00	0.00	0.00	47715.60	2877.40
2019	112830.10	541.00	1523.80	13525.00	93132.90	3155.60
2020	193021.92	58778.00	1205.60	19108.60	112556.80	0.00
2021	104679.02	6461.30	1393.70	1144.70	92950.20	1542.90
Accumulated Total	468390.45	65896.40	4123.10	38190.50	348582.90	7575.90

	Actual Quantities of Non-inert Construction Waste Generated Monthly									
Month	(g) Metals		(h) Paper/ cardboard packaging		(i) Plastics		(j) Chemical Waste		(k) Others, e.g. General Refuse disposed at Landfill	
	(in '(	000kg)	(in '0	00kg)	(in '00	0kg)	(in '0	00kg)	(in 'tonnes)	
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated	
Jan-22	0.00	0.00	0.00	0.00	0.01	0.00	0.00	0.00	45.80	
Feb-22										
Mar-22										
Apr-22										
May-22										
Jun-22										
Sub-total	0.00	0.00	0.00	0.00	0.01	0.00	0.00	0.00	45.80	
Jul-22										
Aug-22										
Sep-22										
Oct-22										
Nov-22										
Dec-22										
Total	0.00	0.00	0.00	0.00	0.01	0.00	0.00	0.00	45.80	
2018	28.40	0.00	0.00	0.00	0.00	0.00	2.00	0.00	434.50	
2019	0.00	9.10	3.40	6.80	0.00	0.00	5.20	0.00	927.30	
2020	69.20	0.00	3.30	0.00	0.02	0.00	25.30	0.00	1275.10	
2021	30.20	0.00	4.80	0.00	0.02	0.00	25.50	0.00	1125.70	
Accumulated Total	127.80	9.10	11.50	6.80	0.05	0.00	58.00	0.00	3808.40	

Remark: Construction waste record for Nov-21 has been updated.

Appendix O
Statistics on Complaint, Notifications of
Summons and Successful Prosecutions

Statistical Summary of Exceedances

	Air Quality								
Location	Action Level	Limit Level	Total						
W-A1	0	0	0						
W-A6	0	0	0						
	Noise								
Location	Action Level	Limit Level	Total						
W-N1A	0	0	0						
W-N18	2^	0	2						
W-N25A	0	0	0						
W-P11	0	0	0						

Remark: ^W-N18 was the nearest NSR to Portion 21 and Gascoigne Road Flyover works areas.

Statistical Summary of Environmental Complaints

Donauting Davied		<b>Environmental Complaint Sta</b>	tistics
Reporting Period	Frequency	Cumulative	Complaint Nature
1 January 2022- 31 January 2022	2	30	N/A

Statistical Summary of Environmental Non-compliance


Danasting Danied	En	vironmental Non-compliance S	Statistics
Reporting Period	Frequency	Cumulative	Details
1 January 2022- 31 January 2022	0	1	N/A

Statistical Summary of Environmental Summons

		<i>j</i>	
Donouting Dovied		<b>Environmental Summons State</b>	tistics
Reporting Period	Frequency	Cumulative	Details
1 January 2022- 31 January 2022	0	1	N/A

Statistical Summary of Environmental Prosecution

<b>Reporting Period</b>	Environmental Prosecution Statistics			
	Frequency	Cumulative	Details	
1 January 2022-	0	0	N/A	
31 January 2022	U	U	IN/A	

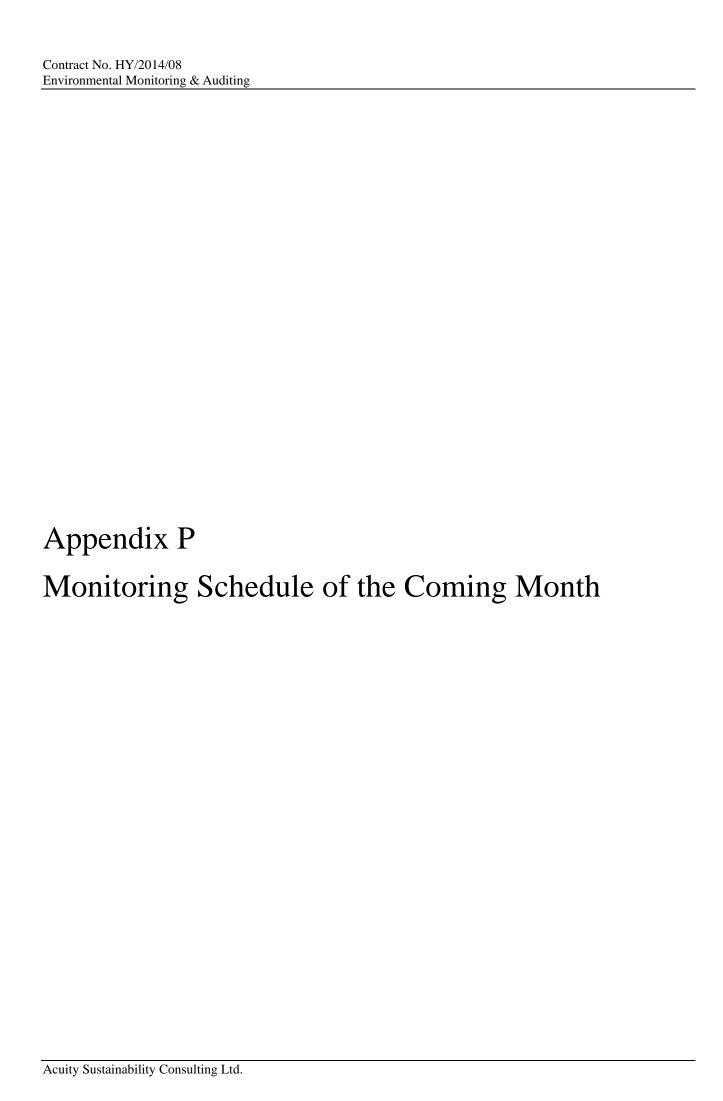

Impact Monitoring Schedule for YMTE							
	Feb-22						
Sun	Mon	Tue		Thur	Fri	Sat	
		1	2	3	4	5	
						Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A	
6	7	8	9	10	11	12	
		Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A					
13	14	15	16	17	18	19	
	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A					Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	
20	21	22	23	24	25	26	
					Impact  Air monitoring for W-A6 &W-A1  Noise monitoring for W-N1A,  W-P11,W-N18 & W-N25A		
27	28						

Appendix Q
Interim Report for the Complaint

Contract No. HY/2014/08 Central Kowloon Route, Yau Ma Tei East Section

Build King - SKEC Joint Venture

### **Interim Report on Environmental Complaint**

Project	Central Kowloon Route, Yau Ma Tei East Section				
Complaint Code	EC030-CKRYMTE20220120_001				
Complaint description	The complainant complained that the construction noise from the road construction work at Gascoigne Road Flyover near Nathan Road carried out in the early morning around 2:20 AM on 20 January 2022.				
Parameter	Construction Noise				
Investigation finding	The complainant was concerning the construction noise generated from the Gascoigne Road Flyover working area in the early morning of 20 January 2022.				
	As noted from the contractor, only one mini robot mounted breaker was used from 1:00 AM to 2:00 AM, one hand-held grinder (CNP 065) and one dump truck with grab were used in turn from 2:00 AM to 3:30 AM on 20 January 2022. The quantity and type of PME used were in compliance with condition 3.a of the CNP Road Section from Ferry Street near Dundas Street to Gascoigne Road Flyover near Chatham Road South, Yau Ma Tei, Kowloon (Permit No.: GW-RE1332-21). To comply with condition 4.d.6 of the CNP, the Contractor had notified EPD before carrying out the night-time work.				
	Considering the fulfillment of stipulated requirements by the Contractor for CNP (Permit No.: GW-RE1332-21) and EM&A manual, it is concluded that there was no non-compliance to the EM&A requirement of the Project regarding noise pollution				
	impact from construction works during restricted hours.				
Actions taken / to be taken	For the works period, the Contractor had followed strictly with the mitigation measures listed in CNP, in which the below measures were implemented:				
	<ol> <li>Hand-held grinder and mini robot mounted breaker shall only be operated inside Movable Acoustic Enclosure (SilentCUBE).</li> <li>Idling powered mechanical equipment were switched off. (If any)</li> <li>Construction work was carried out as quickly as possible.</li> <li>The PME shall only be operated as one group at one time.</li> <li>The PME shall not be used more than four days during the valid period of the CNP.</li> </ol>				
	No construction work covered by another CNP was carried out when the work covered by this CNP was in progress.				
	Supporting photo is provided in Appendix A. In addition, as noted from the Contractor, work covered by the CNP (Permit No.: GW-RE1332-21) had been completed in one morning (20 January 2022).				
Remarks	PME used from 1:00 AM to 2:00 AM on 20 January 2022:				
	Breaker, mini-robot mounted x 1				
	PME used in turn from 2:00 AM to 3:30 AM on 20 January 2022:				
	• Grinder, hand-held (electric) x 1				
	• Dump truck with grab x 1  Construction works corried out from 1:00 AM to 2:20 AM on 20 January 2022:				
	Construction works carried out from 1:00 AM to 3:30 AM on 20 January 2022:  • Removal of central divider				
	Works locations:				
	(next page.)				
Prepared by	Katrina Chui				
Date					
Date	2.0000001 2022				

#### **Works Locations:**



### Appendix A Supporting Photos



Figure A: Movable Acoustic Enclosure (SilentCUBE) that the Contractor used at the work site on 20 January 2022

Contract No. HY/2014/08 Central Kowloon Route, Yau Ma Tei East Section

Build King - SKEC Joint Venture

### **Interim Report on Environmental Complaint**

Project	Central Kowloon Route, Yau Ma Tei East Section		
Complaint Code	EC031-CKRYMTE20220126_001		
Complaint description	The complainant complained about the construction noise from the road construction work at Gascoigne Road Flyover opposite to Alhambra Building carried out in the night. The complainant also expressed that no advance notice of night-time construction works was received.		
	"投訴人表示晚上油麻地彌敦道 383-385 平安大廈對出加士居道天橋正在進行工程,噪音滋擾居民,投訴人表示之前晚上工程會收到工程通知,但今次沒有看到有工程通知。要求跟進回覆。"		
Parameter	Construction Noise		
Investigation finding	The complaint concerned about the construction noise generated from the works area at Portion 21.		
	As noted from the contractor, only surveying work had been conducted at the bottom of Gascoigne Road Flyover (GRF). No PME was used, and no prescribed construction works had been carried out, thus no construction noise was generated. Besides, it was noted that some construction works were being carried out on the flyover, which was not belonged to the construction project (Contract No. HY/2014/08). Therefore, the complaint is considered non-project related.		
Actions taken / to be taken	As a precautionary measure, the Contractor shall implement the measure in respect to this complaint case in order to minimize nuisance to the public. The measure includes providing advance notice about upcoming construction works to nearby residents and displaying the valid Construction Noise Permit (CNP) on the construction site for public information. All conditions stipulated in the CNP would be followed by the Contractor whenever construction works during the restricted hours are considered necessary.		
Remarks	Construction works carried out on 25/1: - Surveying work		
	Works locations:		
	(next page.)		
Prepared by	Katrina Chui		
Date	28 January 2022		

#### **Works Locations:**

