
Vol. 3 of 5 FEP-02/457/2013/C Central Kowloon Route Yau Ma Tei East Contract No. HY/2014/08 October 2021





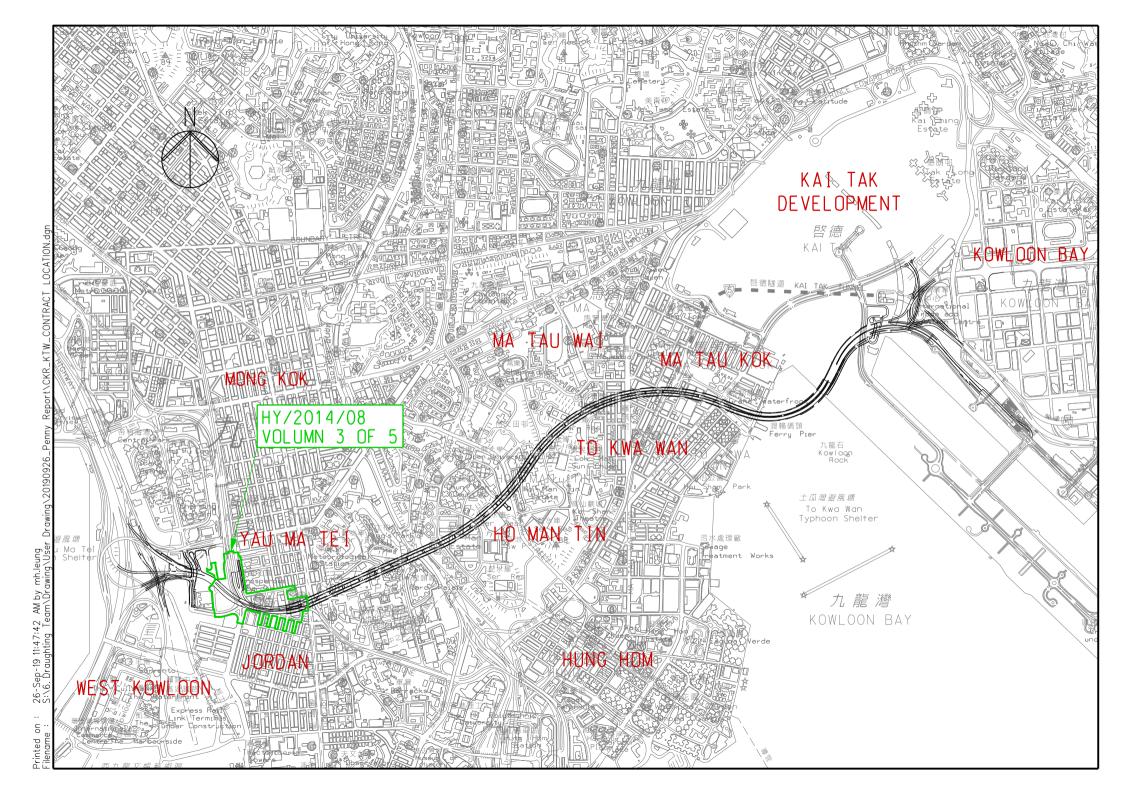

Environmental Permit No. EP-457/2013/D

Central Kowloon Route

Independent Environmental Checker Verification

	,
Reference Document/Plan	
Document/Plan to be Certified/ Verified:	Monthly EM&A Report No.43 (October 2021)
Date of Report:	11 November 2021 (Rev.1)
Date received by IFC:	11 November 2021

Yau Ma Tei East (HY/2014/08)

Reference EP Condition

Works Contract:

Environmental Permit Condition: 3.4

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

IEC Verification

I hereby verify that the above referenced document/plan complies with the above referenced condition of EP-457/2013/D.

Moundy 20.

Ms Mandy To Date: 11 November 2021

Independent Environmental Checker

Our ref: 0436942_IEC Verification Cert_YMTE_Monthly EM&A Rpt No.43.docx



Acuity Sustainability Consulting Limited

Unit C, 11/F, Ford Glory Plaza, No. 37-39 Wing Hong Street, Cheung Sha Wan Kowloon, Hong Kong Tel.: (852) 2698 6833 Fax.: (852) 2333 1316

Build King – SK ecoplant Joint Venture

Central Kowloon Route Contract HY/2014/08 Section of Yau Ma Tei East

Monthly EM&A Report No. 43

(Period from 1 to 31 October 2021)

Rev. 1 (11 November 2021)

	Name	Signature
Prepared by	Katrina K.S. Chui (Assistant Environmental Consultant)	ful.
Checked & Reviewed by	Sally H. S. Mok (Environmental Consultant)	MHS.
Approved & Certified by	Kevin W. M. Li (Environmental Team Leader)	K;

TABLE OF CONTENTS

EXECUTIVE SUMMARY

1.	BASIC PROJECT INFORMATION	7
2.	ENVIRONMENTAL STATUS	. 10
3.	MONITORING RESULTS	12
1 .	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	20
5.	EM&A SITE INSPECTION	22
6.	FUTURE KEY ISSUES	. 24
7.	CONCLUSION AND RECOMMENDATIONS	. 25

LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/08
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month
- Q. Interim Report for the Complaint

EXECUTIVE SUMMARY

- A.1 Build King SK ecoplant Joint Venture ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/08 Section of Yau Ma Tei East ("The Project") on 20 April 2018. This is the 43rd monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 October 2021 to 31 October 2021.
- A.2 A summary of the construction works reported by Main Contractor for the Project during the reporting month is listed below.

Construction Activities undertaken

- Pile Piling, Underpinning of existing pile cap & tam grouting at Yau Ma Tei Police Station (YMTPS)
- Construction of D-wall panels (31 panels) at Zone B
- Site formation, predrilling, remedial works for land contamination, grout curtain wall & guide wall & D-wall at Zone B
- Construction of Stage 3 D-wall panels, soil improvement works, sheet piling at Zone C
- Guide wall, D-wall and pipe piles at Zone D
- Diversion of DN900 Sewer Pipes (ELS, Excavation and Pipe Laying) along Kansu Street at Zone F/B3
- Predrilling, pipe piles & divert DN450 watermain & DN1800 Drainage at Zone G
- ELS, Excavation and Construction of Pad Footing, Piers and Portal Frame for Reprovision of Gascoigne Road Flyover (RGRF)
- CLP Cable Diversion, demolition of subway/ backfill & predrilling at Zone D
- Construct Bridge Deck including Form Traveller Assembly and Trial Panel Construction for RGRF
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

Regular construction noise monitoring during normal working hours

W-N1A, W-P11, W-N18, W-N25A 5 times

Construction dust (24-hour TSP) monitoring

W-A1 5 times W-A6 5 times

Construction dust (1-hour TSP) monitoring

W-A1, W-A6 15 times

- A.4 Dust and noise monitoring on 9 October 2021 was rescheduled to 11 October 2021 due to adverse weather.
- A.5 Bi-weekly inspection of the implementation of landscape and visual mitigation measures

- was conducted on 7 and 21 October 2021. Details of the audit findings and implementation status are presented in Section 5.
- A.6 Joint weekly site inspections were conducted by representatives of Environmental Team (ET), Contractor and Engineer on 7, 18, 21 and 28 October 2021. One joint site inspection with IEC was also undertaken on 18 October 2021. Details of the audit findings and implementation status are presented in Section 5.
- A.7 Details of waste management are presented in Section 3.
- A.8 One Action Level of construction noise were triggered during the reporting period as one documented complaint was received on 22 October 2021 related to construction noise from works areas at Zones B2 and C. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- A.9 One noise-related complaint was received on 22 October 2021. After investigation with Contractor, precautionary measure had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix Q.
- A.10 No non-compliance was reported in the reporting month.
- A.11 No notification of summon or prosecution was received in this reporting month.
- A.12 A summary of the construction activities provided by Main Contractor in the next reporting month is listed below:

Construction Activities to be undertaken

- Removal of bulk head wall and remaining waling & struts at Zone A
- Excavation Works including installation of waling/strut to Tunnel Roof Slab Level and lagging wall construction at Zone B EB1/WB1.
- Continue D-wall construction and construction of pipe piles in lieu of D-wall at Zone B EB2.
- Construction the last D-wall panel P214A at Zone C, Tam Grouting between Zones B2 & C1, install king posts, excavate and construct temporary buttress wall at Zones C1/C2 (P40-P43) & C3 and strengthen the joints of HDPE pipes at C3.
- Tam grouting and underpinning of existing pile caps at YMTPS New Wing.
- Complete ELS works for construction of transfer beam and construct transfer beam for Pier P4L, continue ELS works for construction of transfer beam for P3L and resume D-wall works at Zone D1 Area following implementation of TTA stage 2 along Canton road at Zone D.
- Complete DN900 sewer diversion commence slewing of CLP Cable (11kV & LV) away from existing footpath and 750mm storm drainage diversion along Kansu Street at Zone B3 and F.
- Sheet piling and excavation for diversion of DN1800 drainage (stage 1) at Zone G.
- Works for RGRF at HKAA area: complete reinstatement works, continue construction of temporary traffic deck (Part A), erect temp. support and construct P8L End-span
- Bridge Works:-

Construction Activities to be undertaken

- i. Excavation and construction of pile cap for P6L and Pier P6L construction. Continue construction of P5L bridge deck segments
- ii. Commence pier construction for P1L pier and P4L.
- iii. Construction of pile cap for P6L and pier P6L.
- Continue socket H-piling works for middle / east foundation and west side of Zone 3 F02 Noise Enclosure. Carry out pile load test (1 tensile and 1 compressive) and continue ELS works for pile cap construction for middle foundation for F02 Noise Enclosure.
- Trial Pit and utilities diversions at Column G of Zone 2 Noise Enclosure
- Commence temporary working platform erection for parapet modification works for Noise Enclosure of Zone 3.
- Monitoring of instrumentation for all areas.

1. Basic Project Information

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 July 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was applied for and the EP (EP-457/2013/C) was issued by EPD on 16 January 2017. A Further EP (FEP-02/457/2013/C) was issued by EPD on 5 March 2018. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/D) was issued by EPD on 15 June 2021.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/08 Section of Yau Ma Tei East (YMTE) covers part of the construction activities located at Yau Ma Tei under the EP and FEP which includes:
 - Section of Yau Ma Tei East
 - i. Construction of Cut-and-Cover Tunnel in compliance with all statutory requirements and the requirements specified under the Contract while maintaining the traffic with all necessary provisions
 - ii. Construction and subsequent handover of Yau Ma Tei Access Shaft for facilitating the access and use by the contractor of Central Kowloon Route Central Tunnel contract
 - iii. Demolition of existing buildings including Yau Ma Tei Multi-storey Carpark Building, Yau Ma Tei Specialist Clinic Extension Building and Yau Ma Tei Jade Hawker Bazaars
 - iv. Demolition and re-provisioning of Gascoigne Road Flyover(GRF) and the underpinning works for the existing Ferry Street Flyover and Yau Ma Tei Police Station New Wing Building
 - v. Construction of civil provisions and coordination with the contractor of Central Kowloon Route Tunnel Electrical & Mechanical contract
 - vi. Design and construction of Noise Barrier Works
 - vii. Prepare TTA proposals, discuss at TMLG meeting and obtain its agreement and approval/ endorsement from relevant authorities at suitable times to enable the execution of the Works

The alignment and works area for the Contract No. HY/2014/08 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Construction Activities undertaken

- Pile Piling, Underpinning of existing pile cap & tam grouting at YMTPS
- Construction of D-wall panels (31 panels) at Zone B
- Site formation, predrilling, remedial works for land contamination, grout curtain wall & guide wall & D-wall at Zone B
- Construction of Stage 3 D-wall panels, soil improvement works, sheet piling at Zone C
- Guide wall, D-wall and pipe piles at Zone D
- Diversion of DN900 Sewer Pipes (ELS, Excavation and Pipe Laying) along Kansu Street at Zone F/B3
- Predrilling, pipe piles & divert DN450 watermain & DN1800 Drainage at Zone G
- ELS, Excavation and Construction of Pad Footing, Piers and Portal Frame for RGRF
- CLP Cable Diversion, demolition of subway/ backfill & predrilling at Zone D
- Construct Bridge Deck including Form Traveller Assembly and Trial Panel Construction for RGRF
 - 1.5. The project organisational chart specifying management structure and contact details are shown in Appendix C.
 - 1.6. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2.

Table 1.2 Summary of the Status of Valid Environmental Licence

Notification, Permit and Documentations

Permit/ Licences/	Valid Period			
Notification	From	То	Status	Remark
/Reference No.				
Environmental Permit	ı	, , , , , , , , , , , , , , , , , , , ,		
EP-457/2013/D	15 Jun 2021	End of Project	Valid	-
Further Environmental I	Permit			
FEP-02/457/2013/C	5 Mar 2018	End of Project	Valid	
Wastewater Discharge Li	cense			
WT00030660-2018	28 Mar 2018	31 Mar 2023	Valid	-
Notification of Constructi	on Works under	the Air Pollution	Control (Construct	ion Dust) Regulation
429806	18 Jan 2018	End of Project	Notified	-
Chemical Waste Produce	r Registration			
WPN5213-225-B2526-01	14 Mar 2018	End of Project	Valid	-
Billing Account for Dispo	sal of Constructi	on Waste		
7029997	1 Feb 2018	End of Project	Valid	-
Construction Noise Permit				
GW-RE0333-21	8 Apr 2021	7 Oct 2021	Valid until 7 Oct 2021	Construction Noise Permit at Zone A, B

Permit/ Licences/	Valid	Period		
Notification /Reference No.	From	То	Status	Remark
GW-RE0683-21	12 Jul 2021	11 Jan 2022	Valid	Construction Noise Permit at Zone 3
GW-RE0389-21	22 Apr 2021	20 Oct 2021	Valid until 20 Oct 2021	Construction Noise Permit at Multi-storey Car Park Building
GW-RE0406-21	28 Apr 2021	20 Oct 2021	Valid until 20 Oct 2021	Construction Noise Permit at Zone D & G
GW-RE0741-21	4 Aug 2021	29 Oct 2021	Valid until 29 Oct 2021	Construction Noise Permit at Form traveller Erection at Shanghai Street
GW-RE0665-21	9 Jul 2021	8 Nov 2021	Suspended by GW-RE1038-21	Construction Noise
GW-RE1038-21	21 Oct 2021	20 Jan 2022	Valid from 21 Oct 2021	Permit at Zone C & B2
GW-RE0962-21	24 Sep 2021	23 Nov 2021	Valid	Construction Noise Permit at Shanghai Street for Bridge Works
GW-RE0764-21	12 Aug 2021	11 Nov 2021	Valid	Construction Noise Permit at Jade Hawker Bazaar Building
GW-RE0881-21	10 Sep 2021	9 Mar 2022	Valid	Construction Noise Permit at Zone 3
Marine Dumping Permit				
EP/MD/22-051	8 Sep 2021	7 Mar 2022	Valid	Type 1- Open Sea Disposal

2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/D) and FEP (FEP-02/457/2013/C) as of the reporting period for the Project are summarised in Table 2.1

Table 2.1 Summary of Status of Required Submission for EP-457/2013/D and FEP-02/457/2013/C for the Project

EP/FEP Condition (EP-457/2013/D) (FEP-02/457/2013/C)	Submission	Submission date
Condition 3.4	Monthly EM&A Report (Sep 2021)	13 Oct 2021

2.2. Details of the major construction activities reported by Main Contractor in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Co	nstruction activities undertaken	Remarks on progress
•	Pile Piling, Underpinning of existing pile cap & tam grouting at YMTPS	•80% completion
•	Construction of D-wall panels at Zone B	•98% completion
•	Site formation, predrilling, remedial works for land contamination, grout curtain wall & guide wall & D-wall at Zone B	•75% completion
•	Construction of Stage 3 D-wall panels, soil improvement works, sheet piling at Zone C	•95% completion
•	Guide wall, D-wall and pipe piles at Zone D	•78% completion
•	Diversion of DN900 Sewer Pipes (ELS, Excavation and Pipe Laying) along Kansu Street at Zone F/B3	•77% completion
•	Predrilling, pipe piles & divert DN450 watermain & DN1800 Drainage at Zone G	•50% completion
•	ELS, Excavation and Construction of Pad Footing, Piers and Portal Frame for RGRF	•83% completion
•	CLP Cable Diversion, demolition of subway/ backfill & predrilling at Zone D	•68% completion
•	Construct Bridge Deck including Form Traveller Assembly and Trial Panel Construction for RGRF	•50% completion

2.3. The drawing showing the the project layout and the location of the monitoring station and environmental sensitive receivers are attached in Appendix A and Appendix K. Co-ordinates of the monitoring location are shown in Table 2.3.

Table 2.3 Summary for the location of the monitoring station

Monitoring Location	Location ID	Latitude	Longitude
Yau Ma Tei Catholic Primary School (Hoi Wang Road)	W-A1/ W-N1A	22.313357	114.16409
Man Cheong Building	W-A6	22.308185	114.166033
Hydan Place	W-N18	22.30858	114.170185
Prosperous Garden Block 1	W-N25A	22.309846	114.168072
The Coronation Tower 1	W-P11	22.309824	114.165616

3. MONITORING RESULTS

3.1. Monitoring Parameters

Air Quality

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

Noise

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). Leq (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, Leq (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 3.2. Monitoring Equipment

Air Quality

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificates of dust monitoring equipment are attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
1-hour TSP	LD-5R Digital Dust Indicator	761174	1 Jul 2021
1-nour 13P	LD-5R Digital Dust Indicator	761173	1 Jul 2021
24-hour TSP	TE-5170X High Volume	1084	23 Sep 2021 and 11, 26
	Sampler		Oct 2021
	TE-5170X High Volume	1050	23 Sep 2021 and 11, 26
	Sampler		Oct 2021
	TE-5028A Calibration Kit	3702	3 Aug 2021

Table 3.1 Construction Dust Monitoring Equipment

Noise

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.
- 3.2.6. An acoustic calibrator and sound level meter using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

Monitoring Equipment	Serial Number	Date of Calibration
Nti XL2 Sound Level Meter	A2A-13548-E0	12 Dec 2020
Nti XL2 Sound Level Meter	A2A-13661-E0	23 Sep 2021
Nti XL2 Sound Level Meter	A2A-17638-E0	24 Mar 2021
Svantek 33B Acoustic	83042	20 Mar 2021
Calibrator		
Scarlet ST-120 Sound Level	200504747	31 Dec 2020
Calibrator		
Rion NC-74 Sound Level	34504770	17 Nov 2020
Calibrator		
Pulsar 105 Acoustic Calibrator	63705	7 Aug 2021

Table 3.2 Monitoring Equipment Used in Monitoring

3.3. Monitoring Methodology and QA/QC results

Air Quality

3.3.1. The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R) was used for the impact monitoring. The 1-hour TSP meters provides a real

time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.

- 3.3.2. The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:
 - ◆ The HVS was set at the monitoring location, with electricity supply connected and secured;
 - ♦ HVS was calibrated before commencing the 1st measurement;
 - ◆ The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
 - ◆ The airflow over time during sampling process was recorded by the HVS.
- 3.3.3. HVSs were free-standing with no obstruction. The following criteria were considered in the installation of the HVS:
 - ◆ Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
 - ◆ A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
 - No furnace or incinerator flues was nearby;
 - ◆ Airflow around the sampler was unrestricted; and
 - Permission could be obtained to set up the samplers and gain access to the monitoring station.

3.3.4. Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- ◆ Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- ◆ The filter holder and area surrounding the filter were cleaned;
- ◆ The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- ◆ The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- ◆ The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;

- ◆ The shelter lid was closed and secured with an aluminum strip;
- ◆ The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- ◆ A new flow rate record sheet was inserted into the flow recorder;
- ◆ The flow rates of the HVS was checked and adjusted to between 0.64-1.52m³min⁻¹, which was within the range specified in the EM&A Manual (i.e. 0.6- 1.7m³min⁻¹);
- ◆ The programmable timer was set for a sampling period of 24 hours, and the starting time, weather condition and filter number were recorded;
- ◆ The initial elapsed time was recorded;
- ◆ At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- ◆ The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- ◆ The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

3.3.6. Maintenance and Calibration

- ◆ The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- ◆ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.

3.3.7. Wind Data Monitoring

◆ The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.

Noise

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level (L_{eq}) in decibels dB(A). L_{Aeq(30min)} was used as the monitoring metric for the time period between 0700 –1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB(A).
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms⁻¹ or wind with gusts exceeding 10 ms⁻¹. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms⁻¹.

3.4. Monitoring Locations

Air Quality

3.4.1. During the site visit, both of the original proposed dust monitoring locations were rejected due to the condition at The Coronation was not favorable for monitoring and the access was declined by the management office of Hong Kong Community College (HKCC) of PolyU. Two alternative air monitoring stations Yau Ma Tel Catholic Primary School (Hoi Wang Road) and Man Cheong Building had been proposed by ET and approved by IEC. 2 designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 3.3. The location plan of air quality monitoring stations is shown in Appendix K.

Table 3.3 Location of the Dust Monitoring Stations

Air Quality Monitoring Station	Dust Monitoring Station
W-A1	Yau Ma Tei Catholic Primary School (Hoi Wang Road)
W-A6	Man Cheong Building

Noise

3.4.2. During the site visit, one of the original proposed noise monitoring locations Tak Cheong Building was rejected by the president of the owner's corporation. Alternative noise monitoring station Hydan place had been proposed by ET and approved by IEC. 4 noise sensitive receivers designated noise monitoring locations were identified and agreed with IEC and EPD. The designated monitoring stations are identified and access was granted by the premises. The details of noise monitoring stations are described in Table 3.4 and the location plan of noise monitoring station is shown in Appendix K.

Table 3.4 Noise Monitoring Stations

Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
W-N1A	Yau Ma Tei Catholic Primary School (Hoi Wang Road)	Façade
W-N18	Hydan Place	Façade
W-N25A	Prosperous Garden Block 1	Façade
W-P11	The Coronation Tower 1	Façade

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.5.

Table 3.5 Summary of Impact Monitoring Programme

Impact	Duration	Sampling Parameter	Fraguenay
Monitorin		Samping 1 at ameter	Frequency

Impact Monitoring	Duration	Sampling Parameter	Frequency
Dust	1-hour continuous measurement	1-hour TSP	3 times per six days
Dust	24-hour continuous sampling	24-hour TSP	Once per six days
Noise	30-minute continuous measurement	$L_{\rm eq~30~min},$ $L_{\rm 10}$ and $L_{\rm 90}$ as reference.	Once per week (0700 – 1900)

3.6. Result Summary

Air Quality

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are summarised in Table 3.6.

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source
W-A1	Nearby traffic
W-A6	Nearby traffic

- 3.6.2. Air quality impact monitoring for the reporting month was carried out on 4, 11, 15, 21 and 27 October 2021.
- 3.6.3. Dust monitoring on 9 October 2021 was rescheduled to 11 October 2021 due to adverse weather.
- 3.6.4. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.7 and Table 3.8. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

Table 3.7 Summary of 1-hour TSP Monitoring Results

Monitoring Location	Range(μg/m ³)	Action Level(µg/m3)	Limit Level(µg/m3)
W-A1	55-67	319	500
W-A6	60-74	306	500

Table 3.8 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(μg/m ³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	23-74	167	260
W-A6	29-93	166	260

Noise

3.6.5. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.9:

	<u>e</u>
Monitoring Station	Major Noise Source
W-N1A	Nearby traffic
W-N18	Nearby traffic
W-N25A	Nearby traffic
W-P11	Nearby traffic

Table 3.9 Observation at Noise Monitoring Stations

- 3.6.6. The construction noise impact monitoring for the reporting month was carried out on 4, 11, 15, 21 and 27 October 2021.
- 3.6.7. Noise monitoring on 9 October 2021 was rescheduled to 11 October 2021 due to adverse weather.
- 3.6.8. The result for noise monitoring is summarized in Table 3.10. The measurement data are shown in Appendix M.

Range, dB(A) Time **Monitoring Parameter** Period location L_{eq} L_{10} L_{90} **Action Level** Limit Level# 70dB(A) or 65 W-N1A 60.6-61.1 62.2-63.9 57.8-59.5 dB(A) during examination 69.2-69.9 W-N18 70.8-71.9 73.8-75.1 Normal When one working Leq documented hour from 30min complaint is 0700-1900 received W-N25A 70.2-71.3 73.5-75.1 69.0-69.5 75dB(A)# W-P11 69.5-71.2 71.4-74.4 67.0-68.9

Table 3.10 Summary of Noise Monitoring Results

Remarks:

- 1. # If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit by the Noise Control Authority have to be followed.
- 2. No examination was held at W-N1A so limit levels for all monitoring days were 70 dB(A).

Waste management

3.6.9. The waste generated from this Project includes inert C&D materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types

of waste generated in the reporting month are summarised in Table 3.11. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

Table 3.11 Quantities of waste generated from the Project

	Quantity						
			Non-inert C&D Materials				
			Others,				
	Inert C&D Chemical		e.g.	Recycled materials		S	
D .: 1			General				
Reporting period	Materials	Waste	Refuse				
	(in 'tonnes)	es) (in'000 Kg)	disposed				
		at	Paper/card board	Plastics	Metals		
			Landfill	(in '000 Kg)	(in '000 Kg)	(in '000 Kg)	
			(in				
			'tonnes)				
Oct-2021	10201.1	0.0	38.7	0.6	0.0	0.0	

4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

Table 4.1 Environmental Complaint Handling Procedure

	ι
Complaint Received via Project Hotline	Complaint Received via 1823 or from other
	government departments
Contractor notify ER, ET and IEC	ER notify Contractor, ET and IEC
Contractor log complaint and date of receipt ont	to the complaint database. Contractor, ER and ET to
conduct investi	gation of complaint
If complaint is considered not valid	If complaint is found valid
ET or ER to reply the complainant if necessary	Contractor to identify and implement remedial
	measures in consultation with the IEC, ET and
	ER.
	The ER, ET and IEC to review the effectiveness
	of the Contractor's remedial measures and the
	updated situation; ET to undertake additional
	monitoring and audit to verify the situation if
	necessary, and oversee that circumstances leading
	to the complaint do not recur. ER to conduct
	further inspection as necessary.
If the complaint is referred by the EPD, the Cor	ntractor to prepare interim report on the status of the
complaint investigation and follow-up actions st	ipulated above, including the details of the remedial
measures and additional monitoring identified	or already taken, for submission to EPD within the
time frame ass	signed by the EPD
The ET to record the details of the complaint, res	sults of the investigation, subsequent actions taken to

The ET to record the details of the complaint, results of the investigation, subsequent actions taken to address the complaint and updated situation including the effectiveness of the remedial measures, supported by regular and additional monitoring results in the monthly EM&A reports

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Event and Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. One Action Level of construction noise were triggered during the reporting period as one documented complaint was received on 22 October 2021 related to construction noise from works areas at Zones B2 and C. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- 4.4. One noise-related complaint was received on 22 October 2021. After investigation with Contractor, precautionary measure had been proposed to the Contractor by ET. The interim report for the complaint is shown in Appendix Q.
- 4.5. No non-compliance was reported in the reporting month.
- 4.6. No notification of summons and prosecution was received in the reporting period.
- 4.7. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, four (4) site inspections were carried out on 7, 18, 21 and 28 October 2021, along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 7 and 21 October 2021.
- 5.2. One joint site inspection with IEC also undertaken on 18 October 2021. Minor deficiencies were observed during weekly site inspection. Key observations during the site inspections are summarized in Table 5.1.

Table 5.1 Site Observations

Date	Environmental Observations	Follow-up Status
7 October 2021	 The NRMM label for the generator at Zone B2 was not in good condition. The chemical labels and drip tray for the chemical containers at Zone C were missing. 	 The NRMM label for the generator at Zone B2 had been posted. The chemical containers with label had been placed on drip tray at Zone C.
18 October 2021	 The NRMM labels for the excavators at Zone 3 and Zone D, and crawler crane at Zone D were missing. The noise barrier mat for breaker tip at Zone D was not in good condition. The chemical label and drip tray for chemical container at Zone A were missing. 	 The NRMM labels for the excavators at Zone 3 and Zone D, and crawler crane at Zone D had been posted. The noise barrier mat for breaker tip at Zone D had been wrapped completely. The chemical container with label had been placed into chemical storage cage at Zone B1.
21 October 2021	The NRMM labels for the generators at Zone A and Zone B1 were missing and not in good condition.	The coloured NRMM labels for the generators at Zone A and Zone B1 had been posted.
28 October 2021	The chemical labels and drip trays for chemical containers at Zone B1 and Zone 3 were missing.	1. The chemical container with label had been placed into chemical storage container at Zone B1. The chemical container had been removed at Zone 3 by sub-contractor.

- 5.3. The Contractor had rectified all observation identified during environmental site inspection in the reporting period.
- 5.4. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as


practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.


6. FUTURE KEY ISSUES

- 6.1. The construction activities provided by Main Contractor in the next reporting month are:
- Removal of bulk head wall and remaining waling & struts at Zone A
- Excavation Works including installation of waling/strut to Tunnel Roof Slab Level and lagging wall construction at Zone B EB1/WB1.
- Continue D-wall construction and construction of pipe piles in lieu of D-wall at Zone B EB2.
- Construction of the last D-wall panel P214A at Zone C, TAM grouting between Zones B2 & C1, install king posts, excavate and construct temporary buttress wall at Zones C1/C2 (P40-P43) & C3 and strengthen the joints of HDPE pipes at C3.
- Tam grouting and underpinning of existing pile caps at YMTPS New Wing.
- Complete ELS works for construction of transfer beam and construct transfer beam for Pier P4L, continue ELS works for construction of transfer beam for P3L and resume D-wall works at Zone D1 Area following implementation of TTA stage 2 along Canton road at Zone D.
- Complete DN900 sewer diversion commence slewing of CLP Cable (11kV & LV) away from existing footpath and 750mm storm drainage diversion along Kansu Street at Zone B3 and F.
- Sheet piling and excavation for diversion of DN1800 drainage (stage 1) at Zone G.
- Works for RGRF at HKAA area: complete reinstatement works, continue construction of temporary traffic deck (Part A), erect temp. support and construct P8L End-span
- Bridge Works:
 - i. Excavation and construction of pile cap for P6L and Pier P6L construction. Continue construction of P5L bridge deck segments
 - ii. Commence pier construction for P1L pier and P4L.
 - iii. Construction of pile cap for P6L and pier P6L.
- Continue socket H-piling works for middle / east foundation and west side of Zone 3 F02
 Noise Enclosure. Carry out pile load test (1 tensile and 1 compressive) and continue ELS
 works for pile cap construction for middle foundation for F02 Noise Enclosure.
- Trial Pit and utilities diversions at Column G of Zone 2 Noise Enclosure
- Commence temporary working platform erection for parapet modification works for Noise Enclosure of Zone 3.
- Monitoring of instrumentation for all areas.
- 6.2. Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.
- 6.3. The tentative schedule of regular construction noise monitoring, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.4. The construction programme for the Project for the next reporting month is presented in Appendix B.

7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 43rd monthly EM&A Report presents the EM&A works undertaken during the period from 1 October 2021 to 31 October 2021 in accordance with the EM&A Manual and the requirement under EP- 457/2013/D and FEP-02/457/2013/C.
- 7.2. Air quality (including 1-hour TSP and 24-hour TSP) and noise impact monitoring were carried out in the reporting period. No exceedance of the Action Level and Limit Level was recorded for construction noise and air quality impact monitoring during the reporting month.
- 7.3. Dust and noise monitoring on 9 October 2021 was rescheduled to 11 October 2021 due to adverse weather.
- 7.4. Weekly environmental site inspections were conducted during the reporting period. Joint site inspection with IEC were carried out on 18 October 2021. Minor deficiency was observed during site inspection and was rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.
- 7.5. One Action Levels of construction noise were triggered during the reporting period as one documented complaint was received on 22 October 2021 related to construction noise from drilling and breaking activities at sites near Yau Ma Tei Jockey Club Clinic/ Yau Ma Tei Division Police Station/ the junction of Pak Hoi Street and Ferry Street. No exceedance of Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- 7.6. One noise-related complaint was received on 22 October 2021. After investigation with Contractor, precautionary measure had been proposed to the Contractor by ET. The interim reports for the complaints are shown in Appendix O.
- 7.7. No non-compliance was reported in the reporting month.
- 7.8. No notification of summons or prosecution was received in the reporting month.
- 7.9. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

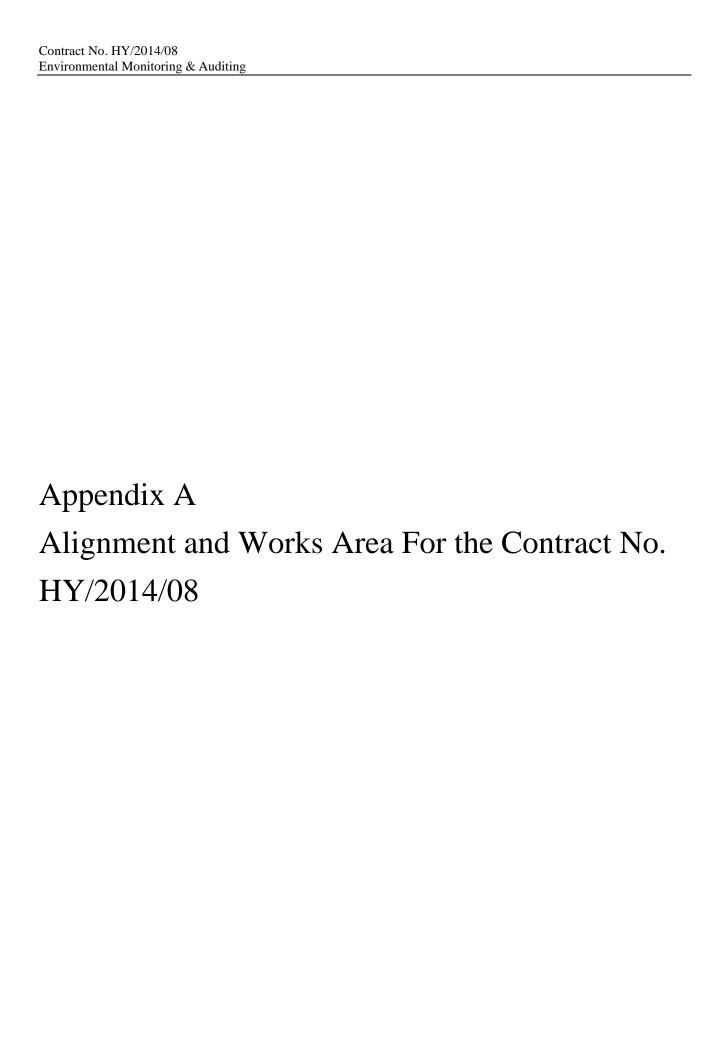

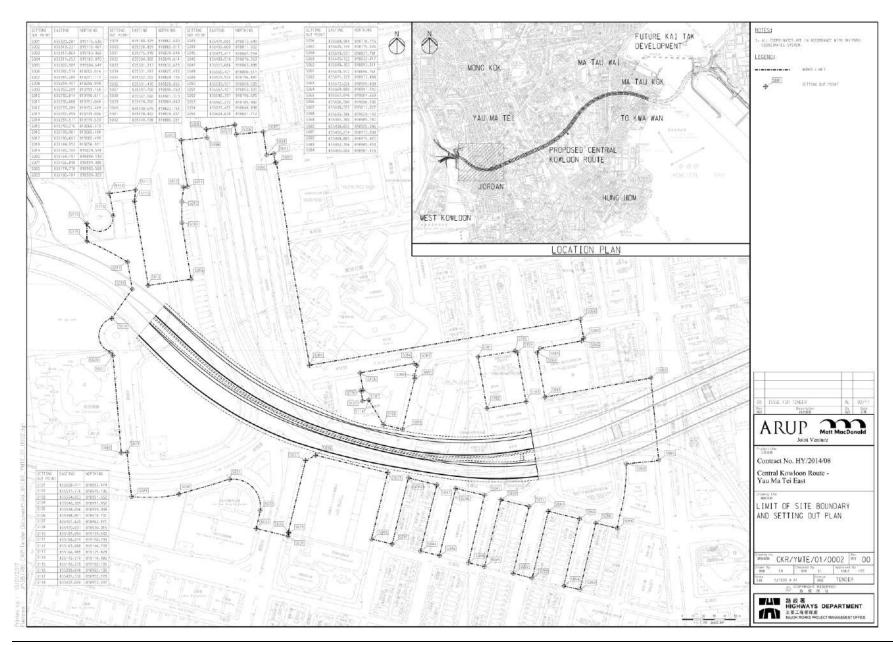




Appendix B Construction Programme


	Cons	truction Pr	ogramme	
Activity Name	Duration	Start	Finish	2021 2022 2023 2024 2025 2026 S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A S O N D J F M A M J J A
HY/2014/08 Central Kowloom Route - Yau Ma Tei East	2990	17-Jan-18	25-Mar-26	
Construction Works	2990	17-Jan-18	25-Mar-26	<u> </u>
Temporary Polifics Management in Gudenground (Portion 11) & 12)	1651	29-Sep-19	5-Apr-24	
Works in MMTSC Ext. and Construct Assessable Ramp and Refuse Collection Asses for Methodomy Chair	683	25-Dan-19	17-Sap-21	
Strewiston of Methadore Clane	1936	17-Jan-18	18-Sep-21	
Works on Normer's & Southern Pairs of YMP Vinita-Storey Car Pady building	592	14-Sep-21	27-Peb-23	
Demolition of Morthern Part of Ex., YMV, Midita/Stoney Can Park Italiating	418	23-141-20	13-Sep-21	
Demolition of Southern Part of Ex. VAIV Malita Storey Cir. Parts Building		27-Aug-22		
Adl Works, within FWESC, Waintenance Densit Area, F. Bilo Square St/Kansu St Rest/Cardon, Access Road	2425	11-Jan-13	7-Sep-24	
Preservation and Protection of Excepting Press	2510	17-Jan-18	30-Nev-24	
Astrophishment Works		6-Feb-25	5-Deb-26	
Alf Works in Olderground		21-Jan-22	25-Hee-2d	
Completion (if Mose Engious)	1515	26-Aug-20	18-Oct-24	
All Romaning Works not Cowered in Other Section		6-Jun-18	5-Feb-25	
Construction of GAC Connel-Constitution	2263	13-Jan-18	25-Minr-24	
Construction of GMC Found, Westfound	2513	10-Jan-18	3-Dige-28	
Cook Turned Works within Portion 124 & 2014, Cite desens at Portion 2015 & 20	1426	7-Apr-18	2-Mar-22	
SEP Reproviously	1603	16- <u>Dec-19</u>	5-May-28	<u> </u>
Completion of Dispiracyn Walls and Boof Slabs of CASC Tormals widing Position 21 and 28	ī	18-Deb-22	13-3e5-22	

Contract No. HY/2014/08 Environmental Monitoring & Auditing		

Appendix C Project Organization Chart

Project O-Chart

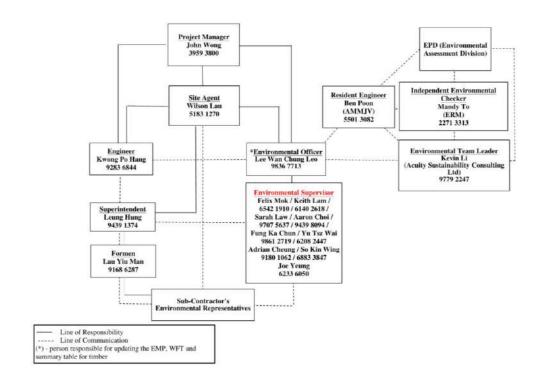

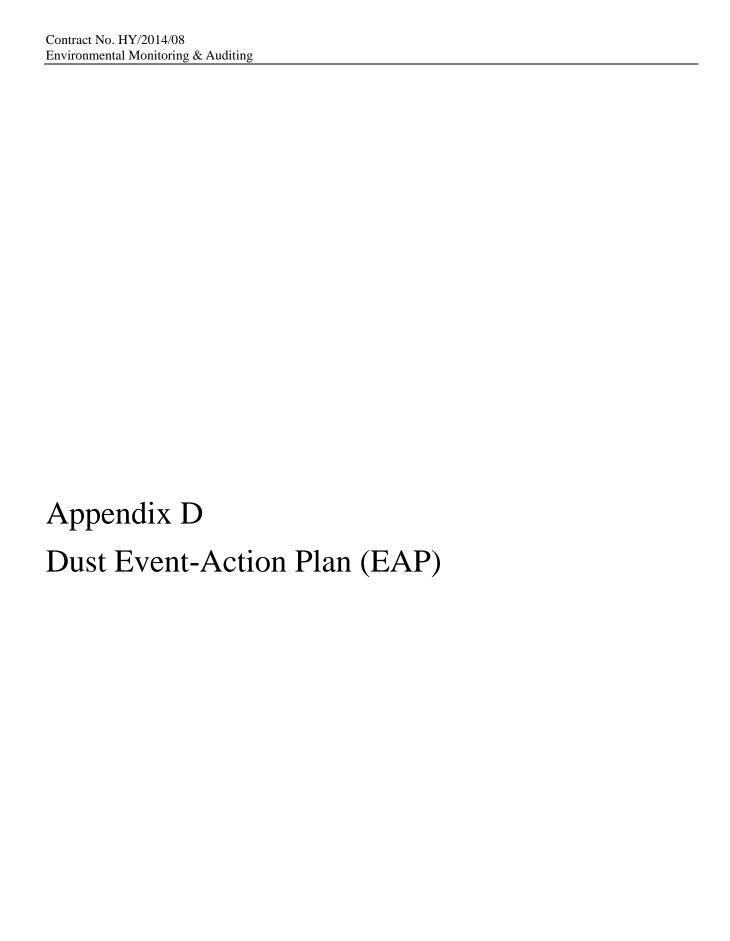

EVENT	ACTION					
EVENI	ET	IEC	ER	CONTRACTOR		
ACTION LEV	EL					
1.Exceedance for one sample	 Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. 	 Check monitoring data submitted by ET; Check Contractor's working method. 	1. Notify Contractor.	 Rectify any unacceptable practice; Amend working methods if appropriate. 		
2.Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	 Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate. 		
LIMIT LEVEL	,		1	•		
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform ER, Contractor and	 Check monitoring data submitted by ET; Check Contractor's working method; 	Confirm receipt of notification of failure in writing; Notify Contractor;	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC		


EVENT	ACTION								
EVENI	ET	IEC	ER	CONTRACTOR					
	 EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 	 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	3. Ensure remedial measures properly implemented.	within 3 working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.					
2.Exceedance for two or more consecutive samples	 Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated. 					

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

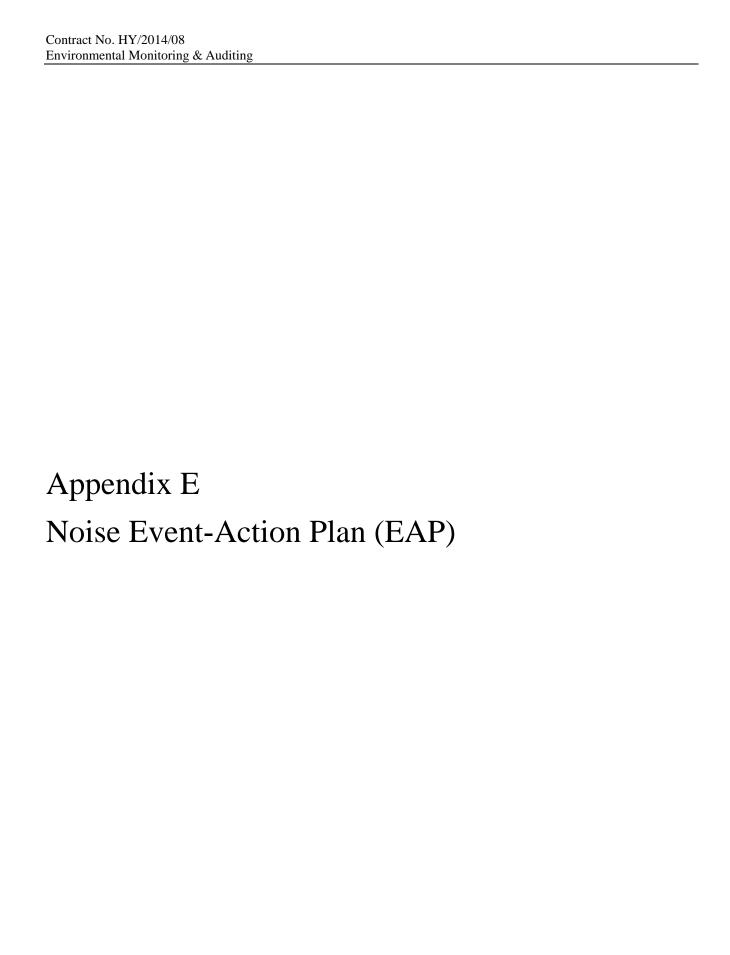

EVENT		ACTIO	ON	
	ET	IEC	ER	CONTRACTOR
Action Level	 Identify source, investigate the causes of exceedance and propose remedial measures; Notify IEC and Contractor; Report the results of investigation to the IEC, ER and Contractor; Discuss with the Contractor and formulate remedial measures; Increase monitoring frequency to check mitigation effectiveness. 	 Review the analysed results submitted by the ET; Review the proposed remedial measures by the Contractor and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented 	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.
Limit Level	 Identify source; Inform IEC, ER, EPD and Contractor; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working procedures to determine 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of

EVENT		ACTIO	ON	
	ET	IEC	ER	CONTRACTOR
	possible mitigation to be		properly implemented;	works as determined by the ER
	implemented;		5. If exceedance continues,	until the exceedance is abated.
	6. Inform IEC, ER and EPD the		consider what portion of the	
	causes and actions taken for the		work is responsible and	
	exceedances;		instruct the Contractor to	
	7. Assess effectiveness of		stop that portion of work	
	Contractor's remedial actions		until the exceedance is	
	and keep IEC, EPD and ER		abated.	
	informed of the results;			
	8. If exceedance stops, cease			
	additional monitoring.			

Note:

ET – Environmental Team

 $IEC-Independent\ Environmental\ Checker$

ER – Engineer's Representative



Appendix F
Environmental Mitigation Implementation
Schedule (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Constru	ction Dust Impact				
S4.3.10	D1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	Implemented, deficiency rectified after observation.
\$4.3.10	D2	 Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of no less than 1.3 L/m² to achieve the dust removal efficiency. 	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	• Implemented
S4.3.10	D3	 Proper watering at exposed spoil should be undertaken throughout the construction phase; Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; A stockpile of dusty material should not be 	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		extended beyond the pedestrian barriers, fencing or traffic cones; The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle. Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period; The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S4.3.10	D6	 continuously; Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; Any skip hoist for material transport should be totally enclosed by impervious sheeting; Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides; Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. Implement regular dust monitoring under EM&A programme during the construction stage. 	Monitoring of dust impact	Contractor	Selected rep. dust monitoring	Construction stage	• TM-EIA	• Implemented
			Constant	tion Noise (Airborn	station			

Acuity Sustainability Consulting Ltd.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S5.4.1	N1	 Implement the following good site practices: Only well-maintained plant should be operated on-site and plant should be serviced regularly during the construction programme; Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; Mobile plant should be sited as far away from NSRs as possible and practicable; Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities. 	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented
S5.4.1	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	Implemented
S5.4.1	N3	Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with 25mm thick internal sound absorptive lining), acoustic mat or full enclosure,	Sreen the noisy plant items to be used at all construction	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented, deficiency rectified after observation.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		screen the noisy plants including air compressors, generators and handheld breakers, etc.	sites					
S5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	Annex 5, TM-EIAO	Implemented
S5.4.1	N5	Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/ unloading activities	Contractor	Mucking out locations	Construction stage	• Annex 5, TM-EIAO	Implemented
S5.4.1	N6	Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM-EIAO	Implemented
S5.4.1	N7	Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected rep. noise monitoring station	Construction stage	• TM-EIAO	Implemented

Water Quality (Construction Phase)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.1		In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following: Construction Runoff • At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction; • The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/ sediment trap. The sediment/ silt traps should be incorporated in the permanent drainage channels to enhance deposition rates; • The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-EIAO TM-DSS	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of 0.1 m3/s a sedimentation basin of 30 m3 would be required and for a flow rate of 0.5 m3/s the basin would be 150 m3. The detailed design of the sand/ silt traps shall be undertaken by the contractor prior to the commencement of construction; • All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. Exposed slope surfaces should be covered by tarpaulin or other means; • The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows, and all traffic areas and access roads protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during prolonged periods of inclement weather and the reduction of surface sheet flows; • All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas; • Measures should be taken to minimize the ingress						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		of site drainage into excavations. If the excavation of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50m3 should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system; Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers; Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes; All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and site wheel washing						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		facilities should be provided at every construction site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains; Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain; Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts; All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby; Adopt best management practices; All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		season (April to September) as far as practicable.						
S6.9.1.2	W2	 Cut-&-cover tunneling work should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable. Uncontaminated discharge should pass through sedimentation tanks prior to off-site discharge; The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater; Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries. 	To minimize construction water quality impact from tunneling works	Contractor	All tunneling portion	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-DSS TM-EIAO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S6.9.1.3	W3	Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance TM-DSS	Implemented
S6.9.1.5	W4	 No direct discharge of groundwater from contaminated areas should be adopted. A discharge license under the WPCO through the Regional Office of EPD for groundwater discharge should be applied. Prior to the excavation works within these potentially contaminated areas, the groundwater quality should be reviewed during the process of discharge license application. The compliance to the Technical Memorandum on Standards for Effluents Discharged into Drainage on Sewerage Systems, Inland and Coastal Waters (TM-DSS) and the existence of prohibited substance should be confirmed. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, the contaminated groundwater should be either properly treated in compliance with the requirements of the TM-DSS or properly 	To minimize groundwater quality impact from contaminated area	Contractor	Excavation areas where contamination is found	Construction stage	Water Pollution Control Ordinance TM-DSS TM-EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 If wastewater treatment is deployed, the wastewater treatment unit shall deploy suitable treatment process (e.g. oil interceptor / activated carbon) to reduce the pollution level to an acceptable standard and remove any prohibited substances (e.g. TPH) to undetectable range. All treated effluent from wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be discharged into the foul sewers. If groundwater recharging wells are deployed, recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in the Section 2.3 of TM-DSS. The baseline groundwater quality shall be determined prior to the selection of the recharge wells, and submit a working plan (including the laboratory analytical results showing the quality of groundwater at the proposed recharge location(s) as well as the pollutant levels of groundwater to be recharged) to EPD for agreement. Pollution levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Prior to recharge, any prohibited substances such as TPH products should be removed as necessary by installing the petrol 						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		interceptor.						
\$6.9.1.6	W6	Accidental Spillage In order to prevent accidental spillage of chemicals, the following is recommended: • All the tanks, containers, storage area should be bunded and the locations should be locked as far as possible from the sensitive watercourse and stormwater drains; • The Contractor should register as a chemical waste producer if chemical wastes would be generated. Storage of chemical waste arising from the construction activities should be stored with suitable labels and warnings. Disposal of chemical wastes should be conducted in compliance with the requirements as stated in the Waste Disposal (Chemical Waste) (General) Regulation.	To minimize water quality impact from accidental spillage	Contractor	All construction site where practicable	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-EIAO TM-DSS	• Implemented
			Waste Manage	ement (Construction	Waste)			
\$7.4.1	WM1	On-site sorting of C&D material Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite	Separation of unsuitable rock from ending up at concrete batching plants and be turned into concrete for	Contractor	All construction sites	Construction stage	• DEVB (W) No. 6/2010	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		dyke rock should be separated at the source sites as far as practicable and stored at designated stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored.	structural use					
S7.5.1	WM2	Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the	Contractor	All construction sites	Construction stage	Land (Miscellaneo us Provisions) Ordinance Waste Disposal Ordinance ETWB TCW No. 19/2005	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM3	recovering broken concrete effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction. C&D Waste Standard formwork or pre-fabrication should be used as far as practicable in order to minimize the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage; The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land (Miscellaneo us Provisions) Ordinance Waste Disposal Ordinance ETWB TCW No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage.						
\$7.5.1	WM5	 Land-based Sediment All construction plant and equipment shall be designed and maintained to minimize the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location; All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; Before moving the vessels which are used for transporting dredged material, excess material shall be cleaned from the decks and exposed fittings of vessels and the excess materials shall never be dumped into the sea except at the approved locations; Adequate freeboard shall be maintained on barges to ensure that decks are not washed by wave action. The Contractors shall monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The Contractor shall keep and produce logs and other records to demonstrate compliance and that journeys are consistent with designated locations 	To control pollution due to marine sediment	Contractor	Along CKR alignment	Construction stage	• ETWB TCW No. 34/2002	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 and copies of such records shall be submitted to the engineers; The Contractors shall comply with the conditions in the dumping licence. All bottom dumping vessels (Hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material; The material shall be placed into the disposal pit by bottom dumping; Contaminated marine mud shall be transported by spit barge of not less than 750m3 capacity and capable of rapid opening and discharge at the disposal site; Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Material adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site. For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping designated mud pit would be a possible arrangement. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal. 						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM6	 Chemical Waste Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes; Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation; The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and arranged so that incompatible materials are adequately separated; Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical 	Control the chemical waste and ensure proper storage, handling and disposal	Contractor	All construction sites	Construction stage	Waste Disposal (Chemical Waste) (General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	Implemented, deficiency rectified after observation.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD.						
\$7.5.1	WM7	 General Refuse General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes; A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible; Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Disposal Ordinance	• Implemented
Land Contamination								
S8.9 & Appendix 8.4	LC2	Excavation of the Contaminated Soil Prior to commencement of the excavation works at the contamination zone, the zone should be clearly marked out on site and the surface levels recorded. Excavation of contaminated material should be undertaken using dedicated earth-moving plant.	The contaminated soil will be excavated for on-site reuse	Contractor	РВН4	Prior to commencement of construction works within the contaminated area	Practice Guide (PG) for Investigation and Remediation	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S8.9 & Appendix 8.4	LC3	 The excavated contaminated soils would be stockpiled at designated area on site and covered by sheet to prevent dispersion of contamination during stockpiling. The Contractor should pay attention to the selection of suitable groundwater lowering schemes and discharge points if the groundwater table is higher than the contaminated soils during excavation. The Contractor should also obtain valid Water Pollution Control Ordinance (WPCC discharge licence from EPD where applicable. Following completion of the excavation to the specified depth, at least one sample from the base of the excavation and four samples even distributed along the boundary of the excavation shall be taken for a closure assessment testing. The acceptance criterion is shown below: Locations Testing Acceptance Criteria PBH4 PCBs RBRGs (Public Park) If the results of analysis below the RBRGs (Public Park), no further excavation will be required. If the analysis indicates presence of contamination (i.e. noncompliance of the acceptance criteria further excavation shall be carried out in 0.5r increment vertically and/or horizontally depending or 					of Contaminate d Land Guidance Notes for Contaminate d Land Assessment and Remediation Guidance Manual for Use of Risk-Based Remediation Goals (RBRGs) for Contaminate d Land Management	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		the location(s) of the sample(s) which has exceeded the acceptance criteria. Further sampling shall also be conducted for compliance testing. The process of excavation, sampling and compliance testing should continue until all contaminated materials are removed and should be supervised by a Land Contamination Specialist.						
Appendix 8.4	LC4	A Remediation Report (RR) to demonstrate adequate clean-up shall be prepared and submitted to EPD for endorsement prior to the commencement of any construction/development works within the sites. No construction/development works shall be carried out prior to the endorsement of the RR by EPD.						Implemented
				Hazard to Life				
\$9.18	H1	Blasting activities regarding transport and use of explosives should be supervised and audited by competent site staff to ensure full compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives handling and transport would be acceptable	Contractor	Works areas at which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A
S9.6, para.4	H2	Detonators shall not be transported in the same vehicle with other Category 1 Dangerous Goods.	To reduce the risk of explosion during the transport of cartridged emulsion	Contractor	-	Construction stage	Dangerous Goods Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.6, para.8	Н3	The explosives delivery trucks should be approved by Mines Division and should meet the regulatory requirements for transport of explosives.	To comply with the requirements for approval of an explosives delivery vehicle	Contractor	-	Construction stage	Dangerous Goods Ordinance	• N/A
S9.10, para.7 and S9.18	H4	Blast cover should be provided for shaft at HMT, and kept closed during blasting. Provision of blast doors or heavy duty blast curtains should be implemented at the shaft to prevent flyrock and control the air overpressure.	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
\$9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	Н9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H10	Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H11	Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H12	Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms and thunderstorms.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
					used			
\$9.18	H13	For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H14	Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H22	It is recommended to explore to minimize the use of the cartridged emulsion explosives and maximize the use of bulk emulsion explosive as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H24	It is recommended to explore to use smaller explosive charges such as 'cast boosters' or 'mini-cast booster' instead of cartridged emulsion as primers for bulk emulsion. This option reduces the quantity of explosives required for transportation for the sections where bulk emulsion will be used.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
			Lan	dscape & Visual				

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S10.10.1	LV3	Good Site Management	Minimize visual	Contractor	Within Project	Construction stage	-	Implemented
Table 10.11		 Large temporary stockpiles of excavated material shall be covered with unobtrusive sheeting to prevent dust and dirt spreading to adjacent landscape areas and vegetation, and to create a neat and tidy visual appearance. Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance. 	impact		site			
S10.10.1 Table 10.11	LV4	 Screen Hoarding Decorative screen hoarding should be erected to screen the public from the construction area. It should be designed to be compatible with the existing urban context. 	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV5	Lighting Control during Construction All lighting in the construction site shall be carefully controlled to minimize light pollution and night-time glare to nearby residencies and GIC. The Contractor shall consider other security measures, which shall minimize the visual impacts.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV6	Erosion Control The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil.	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	Tree Protection & Preservation Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	'Guidelines for Tree Risk Management and Assessment	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		in due course in accordance with ETWB TC no. 3/2006.					Arrangement on an Area Basis and on a Tree Basis', Greening, Landscape and Tree Management (GLTM) Section, DEVB • Latest recommende d horticultural practices from GLTM Section, DEVB	
S10.10.1 Table 10.11	LV8	Tree Transplantation ● For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	ETWB TCW 3/2006 Latest recommende d horticultural practices from Greening, Landscape and Tree	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							Management (GLTM) Section, DEVB • ETWB TCW 2/2004	
S10.10.1 I. Table 10.11	LV9	 Compensatory Planting For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006. Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process. 	Minimize visual impact and also enhance landscape	Contractor	Within Project site	Construction stage	ETWB TCW 3/2006 Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB ETWB TCW 2/2004	• N/A


Cultural Heritage Impact (Construction Phase)

Acuity Sustainability Consulting Ltd.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures The contractor should be alerted during the	Objectives of the Recommende d Measures & Main Concerns to address To preserve any	Implementation Agent Contractor	Location / Timing	Implementation Stage Construction stage	Requirements and/ or standards to be achieved	Implementation Status • Implemented
		construction on the possibility of locating archaeological remains and as a precautionary measure, AMO shall be informed immediately in case of discovery of antiquities or supposed antiquities in the subject sites.	cultural heritage items which may be removed and damaged by the excavation		construction works for cut and cover tunnels	J	requirements	
S12.6.1	CH3	 Protective covering should be provided for the buildings in the form of plastic sheeting; Buffer zones should be provided between the construction works and the external walls of the buildings and should be as large as site restrictions allow and be marked out by temporary fencing or hoarding; An underpinning scheme is required to transfer the existing column loadings to a deeper rock stratum. The supporting system includes cutting the existing ground floor slab to expose the existing pile caps and then construct transfer beams at both sides of the pile caps. The transfer beams will tie up with the existing caps. Loadings of the transfer beams will be transferred to the rock socket piles installed at the two ends of the beams; The AAA settlement and tilting limit should be 6/8/10 mm and1/2000, 1/1500 and 1/1000; Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment; 	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance. 						
\$12.6.1		 Adopting diaphragm wall construction method; Grout curtain should be provided in front of the building; Recharging system should be installed as a contingency measure to mitigate the fluctuation of water table; the AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000; Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;. Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance. 	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented
S12.6.1 Table 12.2		 The Alert, Alarm and Action (AAA) vibration limit will be set at 3/4/5 mm/s and a condition survey shall be carried out by the project proponent prior to the construction phase to confirm this assessment Vibration monitoring of the structure shall be employed during the construction phase to ensure that the level is not exceeded. The monitoring proposal should be sent to AMO for comment. 	Protect the building from damage from construction works	Contractor	Tin Hau Temple (CKR-02)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/or standards to be achieved	Implementation Status
							Proposed Vibration Limits	
	•			EM&A Project				
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual	Control EM&A Performance	Highways Department	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented
S13.2-13.4	EM2	 An Environmental Team needs to be employed as per the EM&A Manual; Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures; An environmental impact monitoring needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with. 	Perform environmental monitoring & auditing	Highways Department/ Contractor	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented

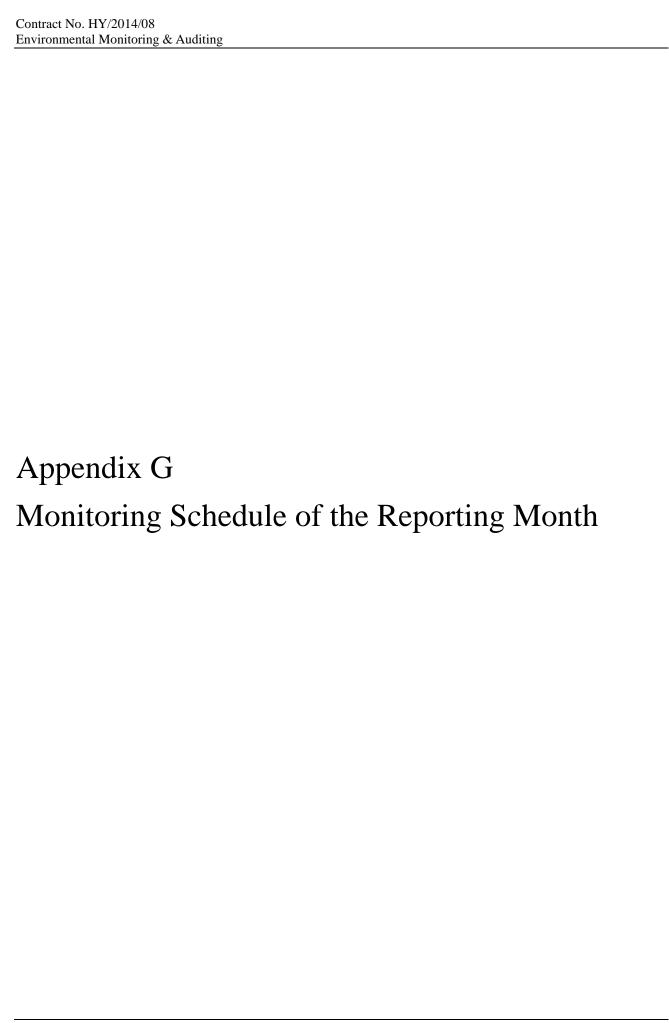

			Impact Monitoring Schedule for YMTE Oct-21			
	1	-		I	I - -	
Sun	Mon	Tue	Wed	Thur	Fri	Sat
					1	2
3	4	5	6	7	8	9
10	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A		13	14		Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A (Rescheduled to 11/10/2021, due to the adverse weather)
10	Impact	12	15	14	Impact Impact	16
	Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A				Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	
17	18	19	20	21	22	23
				Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A		
24	25	26	27	28	29	30
24			Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A			
31						


Remark: The monitoring on 9/10/2021 had been rescheduled to 11/10/2021 due to Typhoon signal 8.


Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix H
Calibration Certificates
(Air Monitoring)





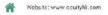

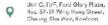

Tel. (852) 2698 6855

Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Jun-21 to 1-Jul-21

Next Verification Test Date:1-Jul-22Unit-under-Test- Model No.Sibata LD-5RUnit-under-Test Serial No.761174Our Report Refrence No.RPT-21-HVS-0004

Standard Equipment Information	T	Tisch's TSP	Tish HVS
Verification Equipment Type		HVS	Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028
Equipment serial no.	MFC	1049	1050
Last Calibration Date		17-Jun-21	24-Sep-20
Next Calibration Date		17-Aug-21	24-Sep-21

Verification	Date	Time			K-Factor Counts/ Minute (R)		Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	27/6/2021	1254.37	1257.37	180.00	0.00098	34.00	6120	R210872/1	33.33
2	27/6/2021	1258.44	1261.44	180.00	0.00095	62.33	11220	R210872/2	59.26
3	27/6/2021	1262.31	1265.31	180.00	0.00122	8.00	1440	R210872/3	9.72
4	1/7/2021	1265.84	1268.84	180.00	0.00100	73.33	13200	R210887/1	73.15
5	1/7/2021	1269.10	1272.10	180.00	0.00116	12.00	2160	R210887/2	13.89
6	1/7/2021	1272.50	1275.50	180.00	0.00103	23.33	4200	R210887/3	24.07
	5 00 000				0.00106				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

1.1

By Linear Regression of y on x:

slope, mh= 0.9476 intercept,ch= 1.9320 *Correlation Coefficient,R= 0.9989

Verification Test Result: Strong Correlation, Results were accepted.


* If the Correlation Coefficient, R is <0.5. Checking and

Re-verification are required.

Verified By:


Technical Manager


Date: 20-07-2021

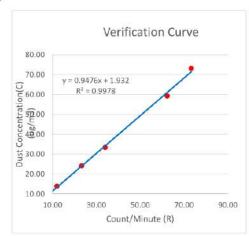





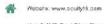

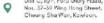

Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Jun-21 to 1-Jul-21

Next Verification Test Date: 1-Jul-22
Unit-under-Test- Model No. Sibata LD-5R
Unit-under-Test Serial No. 761173
Our Report Refrence No. RPT-21-HVS-0003

Standard Equipment Information	,		
Verification Equipment Type		Tisch's TSP HVS	Tish HVS Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028
Equipment serial no.	MFC	1049	1050
Last Calibration Date		17-Jun-21	24-Sep-20
Next Calibration Date		17-Aug-21	24-Sep-21

Verification	Date	Time			K-Factor	Counts/ Minute (R)	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis (TC)	ID No.	y axis	
1	27/6/2021	1254.37	1257.37	180.00	0.00119	27.90	2652	R210872/1	33.33
2	27/6/2021	1258.44	1261.44	180.00	0.00096	61.70	1539	R210872/2	59.26
3	27/6/2021	1262.31	1265.31	180.00	0.00097	10.00	1983	R210872/3	9.72
4	1/7/2021	1265.84	1268.84	180.00	0.00093	78.30	2313	R210887/1	73.15
5	1/7/2021	1269.10	1272.10	180.00	0.00096	14.40	1407	R210887/2	13.89
6	1/7/2021	1272.50	1275.50	180.00	0.00084	28.50	1299	R210887/3	24.07
	6		,		0.00098				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

1.0

By Linear Regression of y on x:

slope, mh= 0.9280 intercept,ch= 1.4222 *Correlation Coefficient,R= 0.9917

Verification Test Result: Strong Correlation, Results were accepted.


* If the Correlation Coefficient, R is <0.5. Checking and

Re-verification are required.

Verified By:

Technical Manager

Date: 20-07-2021

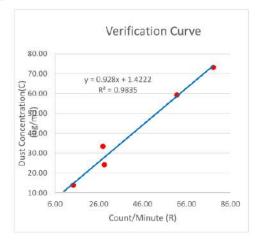



RECALIBRATION DUE DATE:

August 3, 2022

Calibration Certification Information

Cal. Date: August 3, 2021

Rootsmeter S/N: 438320

Ta: 295 Pa: 750.57 °K

Operator: Jim Tisch

Calibration Model #: TE-5028A Calibrator S/N: 3702 mm Hg

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.3170	4.1	1.50
2	3	4	1	1.0350	6.7	2.50
3	5	6	1	0.9420	8.0	3.00
4	7	8	1	0.8650	9.3	3.50
5	9	10	1	0.6540	16.2	6.00

Data Tabulation						
Vstd (m3)	Ostd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tsid}{Ta}\right)}$ (y-axis)	Va	Qa (x-axis)	√∆H(Ta/Pa) (y-axis)	
0.9922	0.7534	1.2233	0.9945	0.7552	0.7678	
0.9887	0.9553	1.5793	0.9911	0.9576	0.9913	
0.9870	1.0478	1.7300	0.9893	1.0503	1.0859	
0.9853	1.1390	1.8686	0.9876	1.1417	1.1729	
0.9761	1.4925	2.4466	0.9784	1.4960	1.5356	
	m=	1.64554		m=	1.03041	
QSTD	b=	-0.00368	QA	b=	-0.00231	
	r=	0.99975	-	r=	0.99975	

Calculation	ons		
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va=	ΔVol((Pa-ΔP)/Pa)	
Qstd= Vstd/ATime	Qa= Va/ΔTime		
For subsequent flow ra	ate calculatio	ns:	
$Qstd = \frac{1}{m} \left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right) - b} \right)$	Qa=	1/m((\(\sqrt{\DH(Ta/Pa}\))\)-b	

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
Pa: actual bar	ometric pressure (mm Hg)
b: intercept	
m: slone	

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30.

Fisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002 www.tisch-env.com

TOLL FREE: (877)263-7610 FAX: (513)467-9009

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

Location:	YMT Catholic Primary School	Site ID:	W-A1	Date:	23-Sep-2021
Serial No:	1084	Mode1:	TE-5170X	Operator:	Tim

Ambient Condition

Corrected Pressure (mm Hg):	759.8	Temperature (deg K):	301.0

Calibration Orifice

Model:	TE-5028A	Slope:	1.03041
Serial No.:	3702	Intercept:	-0.00231
Calibration Due Date:	3-Aug-22	Corr. Coeff:	0.99975

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.21	1.064	39.1	38.90
2	2.53	1.538	40.7	40.49
3	3.33	1.764	41.5	41.29
4	3.74	1.869	41.8	41.59
5	4.41	2.030	42.3	42.08

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m= 3.3191 b= 35.3825 Corr. Coeff= 0.9997

m = sampler slope

b = sampler interceptI = chart response

Pav = average pressure

Tav = average temperature

Sampler set point(SSP)

Calculations

40 CFM

Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pa = actual pressure during calibration (mm Hg)

Tstd = 298 deg K

Pstd = 760 mm Hg

For subsequent calculation of sampler flow:

(1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]

Tim

Checked by: Date: 23-Sep-21

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

	YMT Catholic Primary				
Location:	School	Site ID:	₩-A1	Date:	11-0ct-2021
Serial No:	1084	Model:	TE-5170X	Operator:	Tim

Ambient Condition

Corrected Pressure (mm Hg):	754.1	Temperature (deg K):	301.5

Calibration Orifice

Model:	TE-5028A	Slope:	1.03041
Serial No.:	3702	Intercept:	-0.00231
Calibration Due Date:	3-Aug-22	Corr. Coeff:	0.99975

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.28	1.090	39.9	39.51
2	2.41	1.494	40.9	40.50
3	3.34	1.759	41.5	41.10
4	3.85	1.888	41.8	41.40
5	4.18	1.967	42.0	41.59

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	2.3553	b=	36.9590	Corr. Coeff=	0.9998	

m = sampler slope

b = sampler interceptI = chart response

Pav = average pressure

Tav = average temperature

Sampler set point(SSP)

CFM Calculations

40

 $Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b] \\ IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]$

Qstd = standard flow rate

IC = corrected chart response I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pa = actual pressure during calibration (mm Hg)

Tstd = 298 deg K

Pstd = 760 mm Hg

For subsequent calculation of sampler flow:

(1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]

Tim

Checked by: Date: 11-Oct-21

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

Location:	YMT Catholic Primary School	Site ID:	W-A1	Date:	26-0ct-2021
Serial No:	1084	Mode1:	TE-5170X	Operator:	Tim

Ambient Condition

Corrected Pressure (mm Hg):	762.0	Temperature (deg K):	298.1

Calibration Orifice

Model:	TE-5028A	Slope:	1.03041
Serial No.:	3702	Intercept:	-0.00231
Calibration Due Date:	3-Aug-22	Corr. Coeff:	0.99975

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.38	1.144	38.5	38.54
2	2.35	1.492	40.0	40.05
3	3.57	1.838	41.3	41.35
4	3.88	1.916	41.7	41.75
5	4.32	2.022	42.2	42.25

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m= 4.1439 b= 33.8158 Corr. Coeff= 0.9993

m = sampler slope

b = sampler interceptI = chart response

Pav = average pressure

Tav = average temperature

Sampler set point(SSP)

Calculations

39 CFM

Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b]

IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)]

Qstd = standard flow rate

IC = corrected chart response

I = actual chart response

m = calibrator Qstd slope

b = calibrator Qstd intercept

Ta = actual temperature during calibration (deg K)

Pa = actual pressure during calibration (mm Hg)

Tstd = 298 deg K

Pstd = 760 mm Hg

For subsequent calculation of sampler flow:

(1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]

Time

Checked by: _____ Date: _____26-Oct-21

創新科	儀有限公司					
	HIVOL SAMPLER	CALIE	BRATION :	DATA SHEE	Γ (TSP)	
		Site	Information	1		
Location:	Man Cheong Building	Site ID:	₩- A6	Date:	23-Se ₁	o-2021
Serial No:	1050	Model:	TE-5170X	Operator:	T	im
		Ambie	ent Conditio	n		
Corrected Pre	essure (mm Hg):	759.8	Temperature	(deg K):	301	1.0
		Calibr	ation Orifi	ce		
Model:			E-5028A	Slope:	1.03	041
Serial No.:			3702	Intercept:	-0.00	
Calibration I	Due Date:	3	3-Aug-22	Corr. Coeff:	0.99	
Plate or	In,H2O		bration Data a, X-Axis	I, CFM	IC.	/-Axis
Test #	(in)		m3/min)	(chart)	(corrected)	
1	1.13		1.029	38.4	38.20	
2	2.15		1.418	39.3	39.10	
3	2.64		1.571	39.7	39.50	
5	3.18 4.31		1.724 2.007	40.1 40.8	39.89 40.59	
m=	tion Relationship (Qa on x-axis, 2.4516 pler set point(SSP)	, IC on y-az b= 39	35.6576 CFM	_	Corr. Coeff=	0.9996
			alculations	_		
IC = I[Sqrt(Pa/Ps Qstd = standard f IC = corrected cl I = actual chart r m = calibrator Q b = calibrator Q Ta = actual temp Pa = actual press Tstd = 298 deg k Pstd = 760 mm F For subsequent c	flow rate nart response esponse estd slope std intercept erature during calibration (deg k ure during calibration (mm Hg)	0)	m = sampler sh b = sampler int I = chart respon Tav = average te Pav = average pr	ercept nse emperature		
(1.21 m±0)/[34]	t(298/Tav)(Pav/760)]					

23-Sep-21

Date:

Checked by:

Tim

創新科儀有限公司

	HILLOT CAMPLED	CAL IDD	ATTON D	ARA CIRRE	(EQD)	
	HIVOL SAMPLER		ATION DA	ATA SHEET	(TSP)	
		Site	niormation	1		
Location:	Man Cheong Building	Site ID:	₩- A6	Date:	11-0ct	-2021
Serial No:	1050	Mode1:	TE-5170X	Operator:	Ti	m
		Ambient	Condition			
Corrected Pressu	re (mm Hg):	754.1	Temperature ((deg K):	301	5
		Calibrat	ion Orifice	;		
Model:		TI	E-5028A	Slope:	1.030	041
Serial No.:			3702	Intercept:	-0.00	231
Calibration Due	Date:	3	-Aug-22	Corr. Coeff:	0.99	975
		Calibr	ation Data			
Plate or	In,H2O		, X-Axis	I, CFM	IC, Y-Axis	
Test #	(in)		13/min)	(chart)	(corrected)	
1	1.03		0.978	40.0	39.61	
2	1.85		1.309	40.5	40.11	
3	2.56		1.540	40.9	40.50	
4	3.17		1.713	41.1	40.70	
5	4.38		2.014	41.6	41.2	20
_	Relationship (Qa on x-axis, IC					
m=	1.5231	b= -	38.1233	_	Corr. Coeff=	0.9992
Sample	er set point(SSP)	40	CFM	=		
Qstd = 1/m[Sqrt(H2C IC = I[Sqrt(Pa/Pstd)(T	D(Pa/Pstd)(Tstd/Ta))-b] Fstd/Ta)]	Calc	m = sampler slo b = sampler into I = chart respon	ercept		
Qstd = standard flow IC = corrected chart r I = actual chart responm = calibrator Qstd s b = calibrator Qstd in Ta = actual temperature actual pressure c Tstd = 298 deg K		Tav = average te Pav = average pr	mperature			
Pstd = 760 mm Hg For subsequent calcul (1.21*m+b)/[Sqrt(298	lation of sampler flow: 3/Tav)(Pav/760)]					

11-Oct-21

Date:

Checked by:

創 新 科	儀有限公司					
	HIVOL SAMPLER	CALII	BRATION 1	DATA SHEET	Γ (TSP)	
		Site	Information	1		
Location:	Man Cheong Building	Site ID:	₩-A6	Date:	26-0ct	-2021
Serial No:	1050	Model:	TE-5170X	Operator:	Ti	m
		Ambi	ent Condition	n		
Corrected Pre	essure (mm Hg):	762.0	Temperature	(deg K):	298	.1
		Calib	ration Orifi	ce		
Mode1:			TE-5028A	Slope:	1.030	041
Serial No.:			3702	Intercept:	-0.00	
Calibration D	Oue Date:		3-Aug-22	Corr. Coeff:	0.99	975
.			bration Data	1	T	
Plate or	In,H2O		a, X-Axis	I, CFM	IC, Y-Axis	
Test #	(in) 1.25		(m3/min) 1.089	(chart) 39.1	(corrected) 39.14	
2	2.31		1.479	39.9	39.95	
3	2.51		1.542	40.0	40.05	
4	3.34		1.778	40.4	40.45	
5	4.12		1.974	40.8	40.8	35
Sampler Calibtat	ion Relationship (Qa on x-axis,	IC on v	vio)			
m=	1.8980	b=	37.1018	_	Corr. Coeff=	0.9990
Samp	oler set point(SSP)	39	CFM			
Qstd = 1/m[Sqrt(H2O(Pa/Pstd)(Tstd/Ta))-b] IC = I[Sqrt(Pa/Pstd)(Tstd/Ta)] Qstd = standard flow rate IC = corrected chart response I = actual chart response m = calibrator Qstd slope b = calibrator Qstd intercept Ta = actual temperature during calibration (deg K) Pa = actual pressure during calibration (mm Hg) Tstd = 298 deg K Pstd = 760 mm Hg For subsequent calculation of sampler flow: (1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]			alculations m = sampler sle b = sampler int I = chart respor Tav = average te Pav = average pr	ercept ase mperature		

Date:

26-Oct-21

Checked by:

Environmental Monitoring & Auditing
Appendix I
Appendix I
Calibration Certificates (Noise)
Calibration Certificates (Noise)
Canoration Certificates (1015c)
Canoration Continuates (140150)
Canoration Certificates (14015C)
Canoration Certificates (14015e)
Canoration Certificates (1101se)
Cambration Certificates (1101se)
Canoration Certificates (1401se)
Canoradon Cordineates (1401se)
Canoration Certificates (11015e)
Canonation Certificates (TVOISE)
Canoration Certificates (Troise)
Canoration Certificates (1101se)
Canoration Certificates (Troise)
Canoration Certificates (11015e)
Canoration Certificates (Tvoise)

Contract No. HY/2014/08



Certificate of Calibration

for

Description:

Sound Level Meter

Manufacturer:

NTi Audio

Type No.:

XL2 (Serial No.: A2A-13548-E0)

Microphone:

ACO 7052 (Serial No.: 73780)

Preamplifier:

NTi Audio M2211 MA220 (Serial No.:5235)

Submitted by:

Customer:

Acuity Sustainability Consulting Limited

Address:

Unit C, 11/F., Ford Glory Plaza, No. 37-39 Wing Hong Street.

Cheung Sha Wan, Kowloon

Upon receipt for calibration, the instrument was found to be:

✓ Within

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

 The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 10 December 2020

Date of calibration: 12 December 2020

Calibrated by:____

Calibration Technician

Certified by:

Mr. Ng Yan Wa Laboratory Manager

Date of issue: 12 December 2020

Certificate No.: APJ20-144-CC001

Page 1 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong

Tel: (852) 2668 3423

Fax: (852) 2668 6946

(A+A) * L Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature: 23.7 °C
Air Pressure: 1006 hPa
Relative Humidity: 61.8 %

3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to
Multifunction Calibrator	B&K 4226	2288467	AV200041	HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Sett	ing of U	Jnit-under-t	est (UUT)	Арр	Applied value		IEC 61672 Class 1
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dB.A	SPL	Fast	94	1000	94.0	± 0. 4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	30-130 dBA SPL	Fast	104	1000	104.0	±0.3	
			114		114.0	±0.3	

Time Weighting

Setting of Unit-under-test (UUT)			Арр	lied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
20.120	JD 4	CDI	Fast	0.4	1,000	94.0	Ref
30-130	30-130 dBA SPL Slow	94	1000	94.0	=0.3		

Certificate No.: APJ20-144-CC001

Page 2 of 4

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946
Homepage: http://www.aa-lab.com E-mail: inquiry@aa-lab.com



Frequency Response

Linear Response

Setting of Unit-under-test (UUT)				App	Applied value		IEC 61672 Class 1					
Range, dB	Freq. We	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB					
					31.5	94.1	±2.0					
					63	94.1	±1.5					
					125	94.1	±1.5					
				94	250	94.1	±1.4					
30-130	dB	SPL	Fast		500	94.1	±1.4					
										1000	94.0	Ref
							2000	93.8	±1.6			
			4000	93.4	±1.6							
			8000	92.7	+2.1; -3.1							

A-weighting

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class			
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB			
	<i>b</i>				31.5	54.7	-39.4±2.0			
					63	68.0	-26.2±1.5			
							125	78.0	-16.1±1.5	
										250
30-130	dBA	SPL	Fast	94	500	90.8	-3.2 ±1.4			
					- 100 (M C 100 FG)	13/15/4/20		1000	94.0	Ref
									2000	95.0
			4000	94.4	+1.0±1.6					
			8000	91.6	-1.1+2.1; -3.1					

C-weighting

Setting of Unit-under-test (UUT)				Appl	lied value	UUT Reading,	IEC 61672 Class						
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB						
	1				31.5	91.1	-3.0 ±2.0						
					63	93.3	-0.8 ±1.5						
							125	93.9	-0.2 ±1.5				
			Fast	Fast								250	94.1
30-130	dBC	SPL			Fast 94	500	94,1	-0.0 ±1.4					
					1000	94.0	Ref						
									2000	93.7	-0.2 ±1.6		
			4000	92.6	-0.8±1.6								
		8000	89.7	-3.0 +2.1: -3.1									

Page 3 of 4

Certificate No.: APJ20-144-CC001

Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street , Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946
Homepage: http://www.aa-lab.com E-mail: inquiry@aa-lab.com



5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.10
	63 Hz	± 0.15
	125 Hz	± 0.10
	250 Hz	± 0.10
	500 Hz	± 0.10
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.



Certificate No.: APJ20-144-CC001

Page 4 of 4



Certificate of Calibration

for

Description: Sound Level Meter

Manufacturer: NTi Aua.o

 Type No.:
 XL2 (Serial No.: A2A-13661-E0)

 Microphone:
 ACO 7052 (Serial No.: 73912)

Preamplifier: NTi Audio MA220 (M2211) (Serial No.:5735)

Suomitted by:

Customer: A uity Sustainability Consulting Limited

Address: Unit C, LUF, Ford Glory Plaza, No. 37-39 Wing Hong

Stree. Cheung Sha Wan, Kowloon

Upon receipt for calibration, the in	strument was found to be:
	7
Within (31.5 Hz - 8k Hz)	

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 17 September 2021

Date of calibration: 23 September 2021

Calibration Technician

_ Certified by:

Mr. Ng Yan Wa Laboratory Manager

Date of issue. 27 September 2021

Certificate No.: APJ21-085 CC001

Page 1 of 4

Room 422,Leader In Juritrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946



1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

24.0 °C Air Temperature: Air Pressure: 1001 hPa Relative Humidity: 55.7 %

3. Calibration Equipment:

Calibration Type Serial No. Trace, hle to Report Number Multifunction Calibrator B&K 42.6 AV200041 HOK A.S. 2288467

4. Calibration Results

Sound Pressure Level

Reference Sound Fressure Level

Set ing of Unit-under-test (UUT)			Applied value		UUT Reading.	IEC 61672 Class 1	
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	aBA	SP!	Fast	94	1000	94.0	二(),4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading.	IEC 61672 Class 1	
Range, dB	Freq.	Weighting	Time Weighting	Level, aB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

Time Weignting

Setting of Unit-under-test (UUT)			App	lied value	UUT Reading,	IEC 61672 Class 1	
Range, d'S	Freq. W	eig h ting	Cme Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
39-130	dBA	SPL	Fast	04	1000	94.0	Ref
30-130 an	ubA	uba SPL	Slow	94	1000	94.0	±0.3

Certificate No.: \PJ21-085 CC001

Room 422, Leader In Juntrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com E-mail:inquiry@aa-lab.com



Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

Frequency Response

Linear Response

Sett	ing of Unit-under-	est (UUT)	Appl	ied value	UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. Weighting	Time Weighting	Level, dv	Frequency, Hz	dB	Specification, dB	
			~	31.5	94.1	±2.0	
				63	94.1	±1.5	
	1			125	94.1	±1.5	
				250	94.0	+1.4	
30-130	dB SPL	Fast	94	500	94.0	±1.4	
				1000	94.0	Ref	
		//		2000	94.3	£1.6	
		///		4000	95.1	1.6	
				8000	94.3	24; -3.1	

A-weighting

Sett	ing of Unit-under-t	est (UUT)	Applied value		UUT Reacing,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB/	Specification, dB
	110			31.5	54.7	-39.4 ±2.0
	1			63	67.9	-26.2 ±1.5
				125	73.0	-16.1±1.5
				250	85.4	-8.6 ± 1.4
30-130	∂BA SPL	Fast	94	500	90.8	-3.2 ±1.4
	//			1000	94.0	Ref
	/ /			2000	95.5	+1.2 ±1.6
4				4000	96.1	-1.0 ±1.6
				8000	93.9	-1.1+2.1; -3.1

C-weighting

Sett	ing of Unit-under-t	est (UUT)	Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dl
				31.5	91.1	-3.0 ±2.0
				63	93.3	-0.8 ±1.5
			?	125	93.9	-0.2 ±1.5
				250	94.0	-0.0 ±1.4
30-130	dBC SPL	Foot	94	500	94.0	-0.0 ± 1.4
	7 -			1000	94.0	Ref
				2000	94.2	-0.2 ±1.6
)/		4000	94.3	-0.8 ±1.6
		1/		8000	91.3	-3.0 + 2.1 : -3.1

Certificate No.: !!PJ?1-0%5-CC001



Page 3 of 4

Room 422, Leader In Junitrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T. Hong Kong

Tel: (852) 2668 3423 Homepage: http://www.aa-lab.com

Fax:(852) 2668 6946 E-mail: inquiry@aa-lab.com



5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.05
	63 Hz	± 0.05
	125 Hz	+ 0.05
	250 Hz	+ 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 15% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ21-0% CC001



Page 4 of 4

Room 422, Leader in justrial Centre, 57-59 Au Pul Wan Street, Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946



Certificate of Calibration

for

Description:

Sound Level Meter

Manufacturer:

NTi Audio

Type No.:

XL2 (Serial No.: A2A-17638-E0)

Microphone:

ACO 7052 (Serial No.:68746)

Preamplifier:

NTi Audio M2211 MA220 (Serial No.:7014)

Submitted by:

Customer:

Acuity Sustainability Consulting Limited

Address:

Unit C, 11/F., Ford Glory Plaza, No. 37-39 Wing Hong Street,

Cheung Sha Wan, Kowloon

Upon receipt for calibration, the instrument was found to be:

Within

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 22 March 2021

Date of calibration: 24 March 2021

Calibrated by:_

Calibration Technician

Certified by:

// Mr. Ng Yan Wa Laboratory Manager

Date of issue: 24 March 2021

Certificate No.: APJ20-185-CC001

(A+A)*L Page 1 of 4

Acoustics and Air Testling Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司

1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature:

23.2°C

Air Pressure:

1006 hPa

Relative Humidity:

57.6 %

3. Calibration Equipment:

Туре

Serial No.

Calibration Report Number

Traceable to

Multifunction Calibrator

B&K 4226

2288467

AV200041

HOKLAS

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Sett	ing of Un	it-under-t	est (UUT)	Appl	ied value	UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.1	±0.4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.1	Ref
30-130	dBA	SPL	Fast	104	1000	104.1	±0.3
				114		114.1	±0.3

Time Weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
20 120	JDA	ent	Fast	94	1000	94.1	Ref
30-130	dBA	dBA SPL Slow 94 1000	1000	94.1	±0.3		

Certificate No.: APJ20-185-CC001

Page 2 of 4

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street, Fo Tan, Shatin, N.T., Hong Kong Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com

E-mail: inquiry@aa-lab.com



Frequency Response

Linear Response

Sett	ing of Unit	t-under-t	est (UUT)	App	lied value	UUT Reading,	IEC 61672 Class
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	94.1	±2.0
					63	94.2	±1.5
					125	94.2	±1.5
					250	94.1	±1.4
30-130	dB	SPL	Fast	94	500	94.2	±1.4
					1000	94.1	Ref
					2000	94.3	±1.6
					4000	94.6	±1.6
					8000	92.8	+2.1; -3.1

A-weighting

Setting of Unit-under-test (UUT)				Applied value		UUT Reading,	IEC 61672 Class 1
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	54.7	-39.4 ±2.0
				63	68.0	-26.2 ±1.5	
		A SPL	Fast	94	125	78.1	-16.1 ±1.5
					250	85.5	-8.6 ±1.4
30-130	dBA				500	91.0	-3.2 ±1.4
					1000	94.1	Ref
					2000	95.5	+1.2±1.6
					4000	95.6	+1.0±1.6
					8000	91.8	-1.1+2.1; -3.1

C-weighting

Sett	Setting of Unit-under-test (UUT)			App	Applied value		IEC 61672 Class 1
Range, dB	Freq. V	Veighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	91.1	-3.0 ±2.0
					63	93.3	-0.8 ±1.5
		IBC SPL Fast	Fast		125	94.0	-0.2 ±1.5
				94	250	94.1	-0.0 ±1.4
30-130	dBC				500	94.2	-0.0 ±1.4
10.000000000000000000000000000000000000					1000	94.1	Ref
					2000	94.1	-0.2 ±1.6
				4000	93.8	-0.8 ±1.6	
					8000	89.8	-3.0 +2.1: -3.1

Certificate No.: APJ20-185-CC001



Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong Tel: (852) 2668 3423 Fax:(852) 2668 6946



5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.10
	63 Hz	± 0.05
	125 Hz	± 0.05
	250 Hz	± 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ20-185-CC001

(A+A) *L


Room 422,Leader Industrial Centre, 57-59 Au Pui Wan Street ,Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423
Fax: (852) 2668 6946
Homepage: http://www.aa-lab.com
E-mail: inquiry@aa-lab.com



CALIBRATION CERTIFICATE

Certificate Informa	tion	
Date of Issue	20-Mar-2021	Gerafficate Number MLCN210569S
Customer Informat	ion	11
Company Name Address	Acuity Sustainability Consulting Li Unit C, 11/F., Ford Glory Plaza, Nos. 37-39 Wing Hing Street, Cheung Sha Wan, Kowloon, HX	mileo
Equipment-under-1	Test (EUT)	WORLD TO THE STREET
Description Manufacturer Model Number Serial Number Equipment Number	Sound Calibrator Syantek SV 33B 83042	
Calibration Particu	lar 1	11
Date of Calibration Calibration Equipment	20-Mar-2021 47.5 (MLTE008) / AV200053 / 23-1 13.57(MLTE190) / MLEC20/05/02	
Calibration Procedure	MLCG00, MLCG15	
Calibration Conditions	Laboratory Temperature Relative Normality FUT Shaodizing Time Warm-up Time Power Supply	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicable to ternal cattery
Calibration Result	Calibration data were detailed in the All calibration results were within E	
Approved By & Dat		7
		/A K.O. Lo 20-Mar-2021
"he results on this Calibra not include an "once for overloading, mishandling, " "faxl ab Calibration Central The copy of this Catificat	the EUT long term drift, variatic 1 with environment and the capacity of any other laborate c.Limited sharing be liably for any loss or da	ured at the time of the calibration and the uncertainties quoted will nmental changes, vibration and shock during transportation, ory to repeat the measurement.

Page 1 of 2

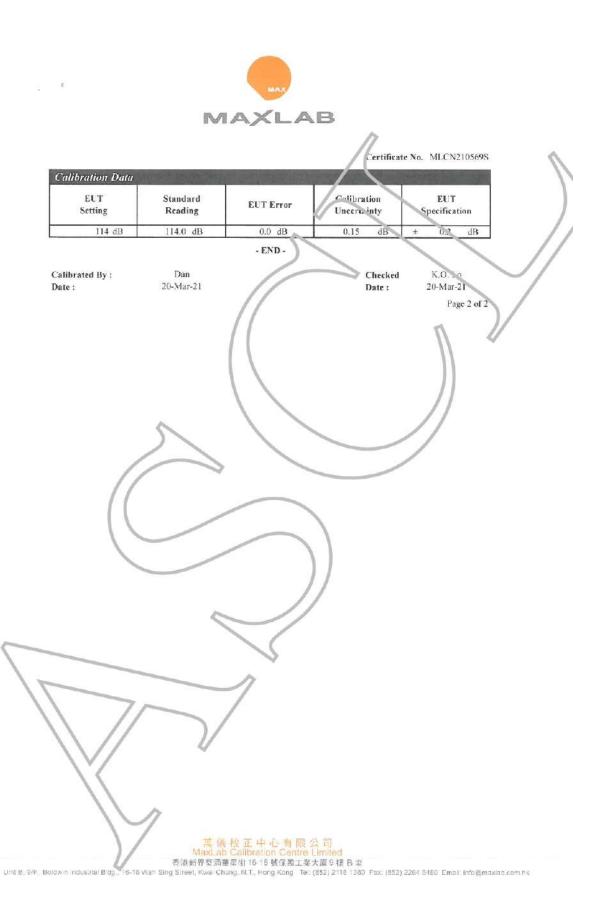



Calibration & Test Certificate

To whom it may concern

We hereby certify that the instrument under mentioned has been certainly calibrated according to our calibration standard and the testing result in the calibration procedure has been good enough within the tolerance regulated in our specification.

Test conditions

Model name	
Model number	ST-120
Serial number	
Temperature	25° C
Humidity	43 %rh
Date of calibration	2020/12/31

Test data

94 dB	Range: 94 dB	PASS
	3111111	FAGG
114 dB	Range: 114 dB	PASS

Calibrator

Model	Model number	Serial number	Due date
Standard SOUND LEVEL METER	B&K 2239	181001638	JAN/30/2022

The standard generators used for calibration procedure are proofed once a year and can be traceable to the standard authorized by public organization.



Approved by

Ethan Lin, Head of Engineering Department



CALIBRATION CERTIFICATE

Date of Issue	17-Nov-2020		Certificate Nun	nber MLCN203081S
Customer Informati	on		THE RELEASE	
Company Name Address		ability Consulting Lir s. 301-305 Castle Peal X.T.		
Equipment-under-T	est (EUT)		(P 1875 5 8875	STATE AND AND AND ADDRESS OF THE PARTY.
Description Manufacturer Model Number Serial Number Equipment Number	Sound Level C Rion NC-74 34504770	alibrator		
Calibration Particul	ar			
Date of Calibration Calibration Equipment		8) / AV200063 / 23-J 0) / MLEC20/05/02 /		
Calibration Procedure Calibration Conditions	MLCG00, ML	Alar ar		
Cantifration Conditions	EUT EUT	Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicable Internal battery	
Calibration Results		a were detailed in the all was within EUT sp		
Approved By & Date		4 (2 (4))		
		/	K.O. Lo	17-Nov-2020
overloading, mishandling, r MaxLab Calibration Centre	on Certificate only received the country of the cou	elate to the values measur iff, variation with environ city of any other laborator liable for any loss or dan b Calibration Centre Limi	ed at the time of the calibration and nental changes, vibration and shock	during transportation,

Page 1 of 2

萬僕校正中心有职公司

MaxLab Calibration Centre Limited

香港新界發滿筆星街 16-18 號保盈工業大廈 9 樓 B 室
Unit B, 9/F, Boldwin Industrial Bidg. 16-18 Wah Sing Sheet, Kwai Chung, N.T. Hong Kong, 1et: (852) 2116-1380 Fox: (852) 2264-6480 Email. Info@maxlab.com.trk



Certificate No.

MLCN203081S

Calibration Data					
EUT Setting			Calibration Uncertainty	EUT Specification	
94 dB	94.0 dB	0.0 dB	0.20 dB	± 0.3 dB	

- END -

Calibrated By: Date:

Dan 17-Nov-20 Checked By: Date:

K.O. Lo 17-Nov-20

Page 2 of 2



CALIBRATION CERTIFICATE

Date of Issue	7-Aug-2021		Con	tificate Numbe	r MLCN212053S
			Cei	timeate Numbe	F MILCN2120338
Customer Informati	on				
Company Name		ability Consulting Lin	nited		
Address		Ford Glory Plaza,			
	Nos. 37-39 Win	an, Kowloon, HK			
	Chedrig Sha W	un, reowieon, rne			
Equipment-under-T	est (EUT)				
Description	Acoustic Calibratic	rator			
Manufacturer	Pulsar				
Model Number	105				
Serial Number	63705				
Equipment Number					
Calibration Particul	ar				
Date of Calibration	7-Aug-2021				
	4231(MLTE008) / AV200063 / 23-Jun-23				
Calibration Equipment					
Calibration Equipment		8) / AV200063 / 23-Ju 0) / MLEC21/05/02 / :			
Calibration Equipment					
•		0) / MLEC21/05/02 /)			
Calibration Procedure	1357(MLTE19) MLCG00, MLC	0) / MLEC21/05/02 / :	26-May-22	6	
Calibration Procedure	1357(MLTE19	0) / MLEC21/05/02 / : CG15 Temperature			
Calibration Procedure	1357(MLTE19) MLCG00, MLC	0) / MLEC21/05/02 / :	26-May-22 23 °C ± 5 °C		
Calibration Procedure	MLCG00, MLC	CG15 Temperature Relative Humidity	26-May-22 23 °C ± 5 °C 55% ± 25%		
Calibration Procedure	MLCG00, MLC	CG15 Temperature Relative Humidity Stabilizing Time	23 °C ± 5 °C 55% ± 25% Over 3 hours	le	
Calibration Procedure Calibration Conditions	MLCG00, MLC Laboratory	CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time	23 °C±5 °C 55%±25% Over 3 hours Not applicabl Internal batte	le ry	
Calibration Procedure Calibration Conditions	MLCG00, MLC Laboratory EUT	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply	23 °C±5 °C 55%±25% Over 3 hours Not applicabl Internal batte continuation pa	le ry ges.	
Calibration Procedure Calibration Conditions	MLCG00, MLC Laboratory EUT	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply a were detailed in the	23 °C±5 °C 55%±25% Over 3 hours Not applicabl Internal batte continuation pa	le ry ges.	
Calibration Procedure Calibration Conditions	MLCG00, MLC Laboratory EUT	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply a were detailed in the	23 °C±5 °C 55%±25% Over 3 hours Not applicabl Internal batte continuation pa	le ry ges.	
Calibration Procedure Calibration Conditions	MLCG00, MLC Laboratory EUT	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply a were detailed in the	23 °C±5 °C 55%±25% Over 3 hours Not applicabl Internal batte continuation pa	le ry ges.	
Calibration Procedure Calibration Conditions Calibration Results	MLCG00, MLC Laboratory EUT Calibration date All calibration	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply a were detailed in the	23 °C±5 °C 55%±25% Over 3 hours Not applicabl Internal batte continuation pa	le ry ges.	
Calibration Procedure Calibration Conditions Calibration Results	MLCG00, MLC Laboratory EUT Calibration date All calibration	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply a were detailed in the	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicabl Internal batter continuation pa	le Ty ges. n.	
Calibration Procedure Calibration Conditions Calibration Results	MLCG00, MLC Laboratory EUT Calibration date All calibration	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply a were detailed in the	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicabl Internal batter continuation pa	le ry ges.	7-Aug-202
Calibration Procedure Calibration Conditions Calibration Results Approved By & Date Statements	MLCG00, MLC Laboratory EUT Calibration data All calibration	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Wann-up Time Power Supply a were detailed in the results were within EU	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicabl Internal batter continuation pa	le rry ges. n. K.O. Lo	7-Aug-202
Calibration Equipment Calibration Procedure Calibration Conditions Calibration Results Approved By & Date Statements Calibration equipment used The results on this Calibrat	MLCG00, MLC Laboratory EUT Calibration data All calibration	O) / MLEC21/05/02 / CG15 Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply a were detailed in the results were within EU	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicabl Internal batter continuation pa IT specification	le ry ges. n. K.O. Lo	

- MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT
 The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior written approval of MaxLab Calibration Centre Limited.

Page 1 of 2



Certificate No.

MLCN212053S

Calibration Data				
EUT Setting	Standard Reading	EUT Error from Setting	Calibration Uncertainty	EUT Specification
94 dB	93.9 dB	-0.1 dB	0.20 dB	± 0.2 dB

- END -


Calibrated By: Date:

Keneth 7-Aug-21 Checked By: Date:

K.O. Lo 7-Aug-21

Page 2 of 2

萬儀校正中心有限公司
MaxLab Calibration Centre Limited
香港新界英涌華星街16-18 號保盈工業大厦 9 楼 B 室
Unit B, 9/F., Boldwin Industrial Bidg., 16-18 Wah Sing Street, Kwai Chung, N.T., Hang Kong Tei (852) 2116-1380 Fax: (852) 2264-6450 ≘mail: Info@maxiab.com.hk

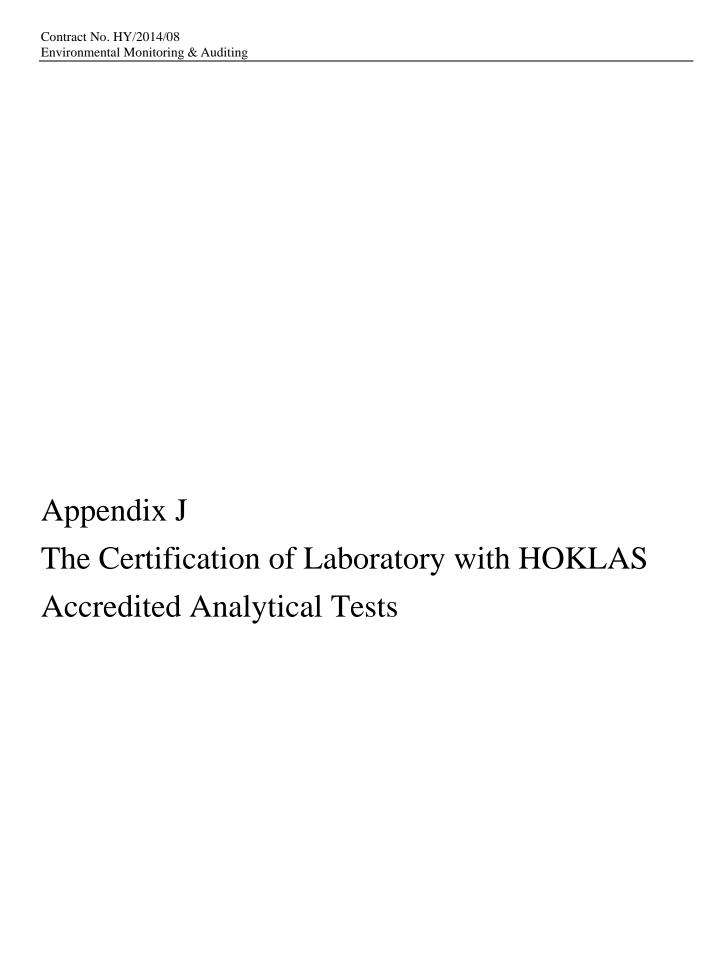



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ALS TECHNICHEM (HK) PTY LIMITED

11/F., Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 為香港認可處執行機關根據認可證詢委員會建議而接受的

> **HOKLAS Accredited Laboratory** 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO / IEC 17025; 2005 - General requirements for the competence 此實驗所符合ISO / IEC 17025:2005 - (測試及校正實驗所能力的適用規定)所訂的要求。 of testing and calibration laboratories and it has been accredited for performing specific tests or calibrations as 機能可進行戰於香港實驗所認可計劃(認可實驗所名冊)內下碰測試類別中的指定 listed in the HOKLAS Directory of Accredited Laboratories within the test category of 测试或校正工作

Environmental Testing 環境測試

This laboratory is accredited in accordance with the recognised international Standard ISO / IEC 17025 : 2005. 本質銀所乃規論公認的短數標準 ISO / IEC 17025 : 2005 獲得認可。 This accreditation demonstrates technical compatence for a defined scope and the operation of a laboratory 透明認可沒值資本在核定製精所需的技術能力及實驗所質量管理體系的運作 quality management system (see joint IAF-ILAC-ISO Communiqué). (是經歷認可論確、國際實驗所認可含作組織及國際標準化結構的聯合公顧)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 香港認可處根據認可處執行機關的權限在此蓋上通用印章

CHAN Sing Sing, Terence, Executive Administrator

執行幹事 陳成城 Issue Date: 5 May 2009

簽發日期:二零零九年五月五日

Registration Number : HOMAS 066

註冊號碼:

Date of First Registration: 15 September 1995

首次註冊日期:一九九五年九月十五日

This certificate is issued subject to the forms and conditions and down by HKAS 本提書按照香港語可應訂立的條款及條件發出

L 000552



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此證明

ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Lot 12, Tam Kon Shan Road, North Tsing Yi, New Territories, Hong Kong 香港新界青衣北担杆山路12路段

has been accepted by the HKAS Executive, on the recommendation of the Accreditation Advisory Board, as a 在認可諮詢委員會的建議下獲香港認可處執行機關接受為

> **HOKLAS Accredited Laboratory** 「香港實驗所認可計劃」認可實驗所

This laboratory meets the requirements of ISO/IEC 17025:2005 and it has been accredited for performing specific tests or calibrations as listed in the scope of accreditation within the test category of

Environmental Testing

此實驗所符合ISO/IEC 17025:2005所訂的要求 並獲認可進行載於認可範圍內下述測試類別中的指定測試或校正工作

環境測試

This accreditation to ISC/IEC 17025:2005 demonstrates technical competence for a defined scope and the operation of a laboratory quality management system (see joint IAF-ILAC-ISO Communiqué). 此項 ISC/IEC 17025:2005 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套實驗所質量管理體系(見國際認可論理、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of the Hong Kong Accreditation Service is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

WONG Wang-wah, Executive Administrator

執行幹事 黃宏華 Issue Date: 16 July 2014

簽發日期:二零一四年七月十六日

註冊號碼:

Registration Number: HOKLAS 241


Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日


L 001195

This certificate is issued subject to the terms and conditions laid down by HKAS 李證書按照香港認可處訂立的條款及條件發出

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix K
Location Plan of Noise and Air Quality
Monitoring Station

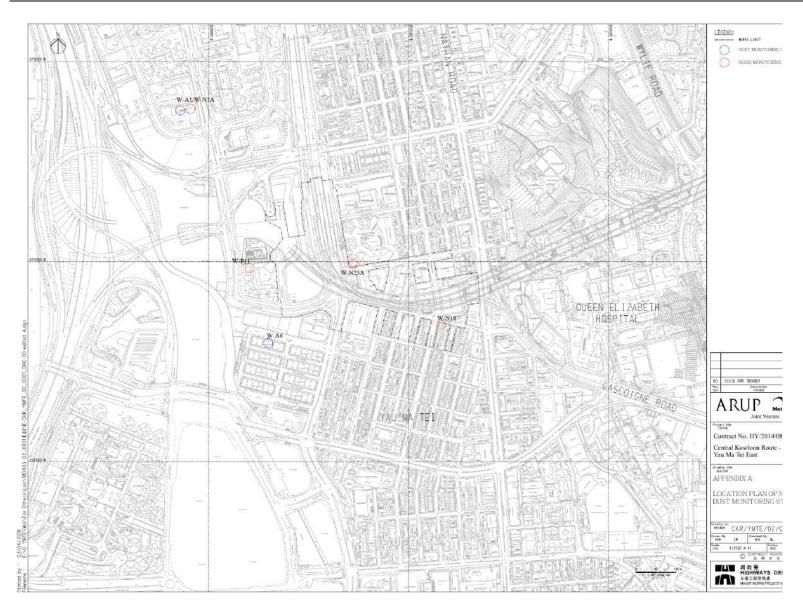

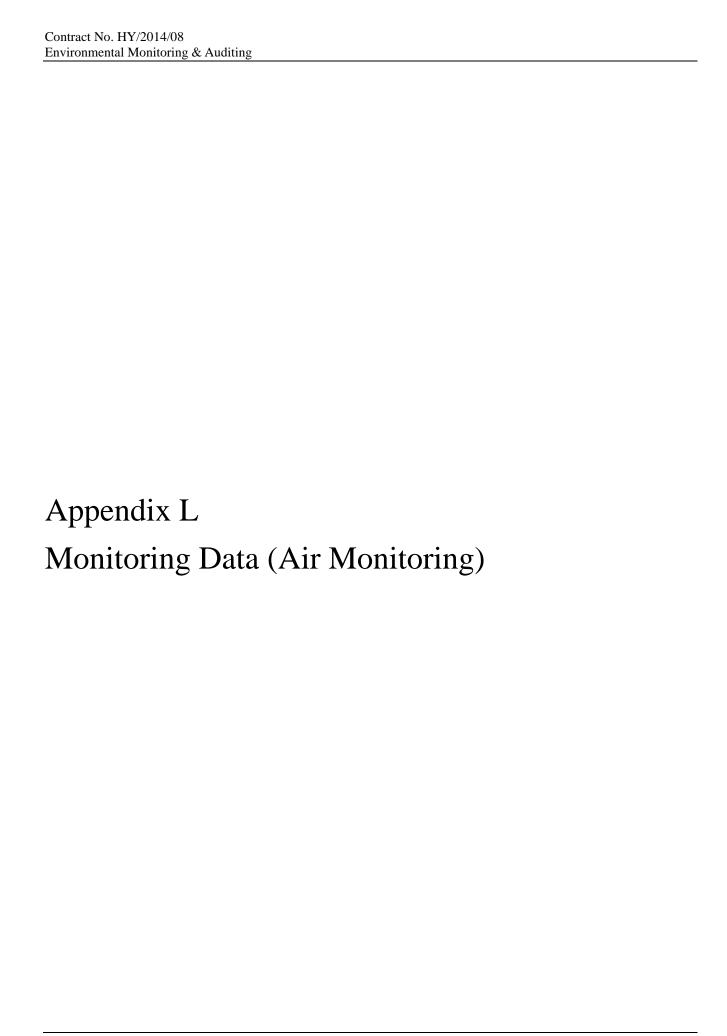

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

Parameter: TSP 1-hour
Other Factors Nearby traffic

			1-hour TSP (µ	g/m^3)				
Date	Weather	Start Time	1 st Hour (μg/m³)	2 nd Hour (μg/m³)	3 rd Hour (μg/m³)			
04/10/2021	Sunny	13:05	58	62	56			
09/10/2021		Rescheduled	d to 11/10/2021 du	ue to adverse weath	er			
11/10/2021	Fine	9:03	60	65	61			
15/10/2021	Sunny	9:02	67	64	61			
21/10/2021	Fine	9:27	62	64	59			
27/10/2021	Sunny	9:03	67	63	55			
Mini	mum: 55 μg/m	3		Maximum: 67μg/m ³				

Location: Man Cheong Building (W-A6)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

Parameter: TSP 1-hour
Other Factors Nearby traffic

			1-hour TS	SP (μg/m ³)	
Date	Weather	Start Time	1 st Hour (μg/m³)	2 nd Hour (μg/m³)	3 rd Hour (μg/m³)
04/10/2021	Sunny	12:33	64	69	73
09/10/2021		Reschedul	ed to 11/10/202	21 due to adverse weather	er
11/10/2021	Fine	9:23	62	65	60
15/10/2021	Sunny	9:46	67	62	74
21/10/2021	Fine	10:11	62	67	65
27/10/2021	Sunny	12:24	67 63		61
1	Minimum: 60	μg/m ³		Maximum: 74 μg	g/m^3

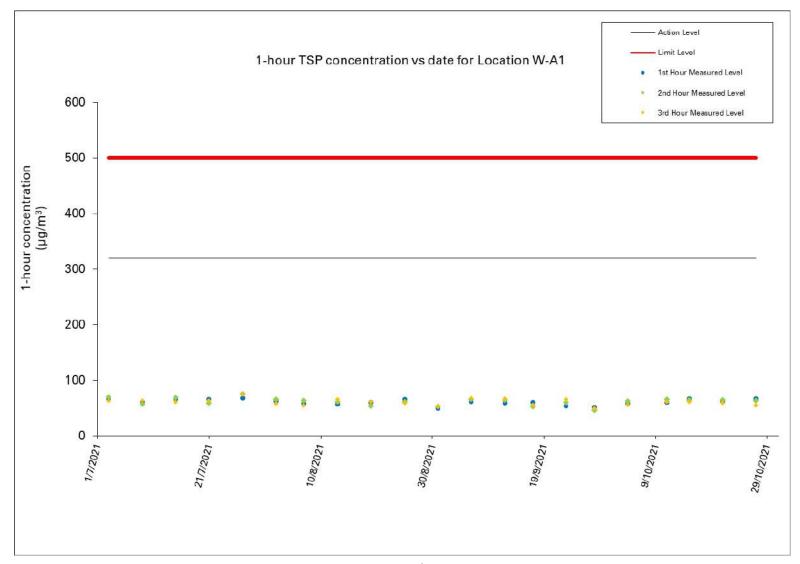


Figure 1: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A1

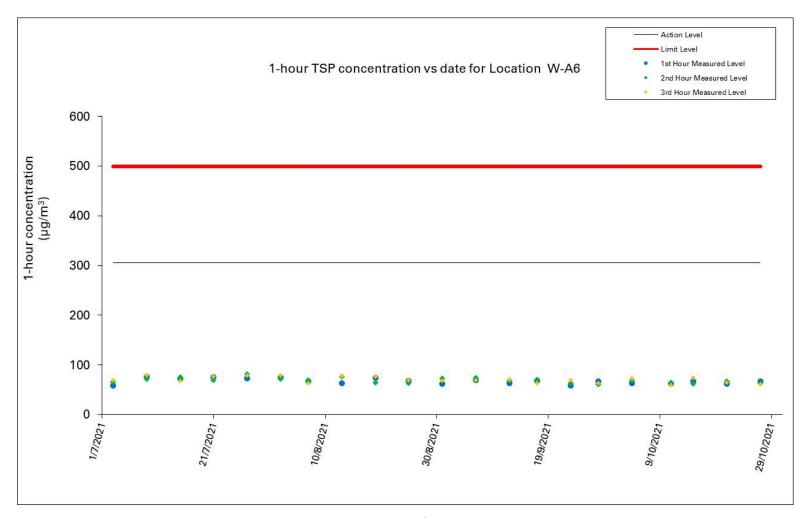


Figure 2: Graphical Illustration of Measured 1-hour TSP ($\mu g/m^3$) Levels at W-A6

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

Parameter: TSP 24-hour
Other Factors Nearby traffic

Date of Calibration:	23-Sep-21	Slope =	3.3191
Calibration due date:	8-Oct-21	Intercept =	35.3825
Date of Calibration:	11-Oct-21	Slope =	2.3553
Calibration due date:	26-Oct-21	Intercept =	36.9590
Date of Calibration:	26-Oct-21	Slope =	4.1439
Calibration due date:	10-Nov-21	Intercept =	33.8158

Start Date	Weather Condition		Elapse Time		Cl	Chart Reading Avg Air Temp		Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter Weig	ht (g)	Particulate weight	Conc.
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m ³)	Initial	Final	(g)	$(\mu g/m^3)$
4/10/2021	Sunny	5733.4	5757.4	1440.0	40	40	40.0	29.8	1012.5	1.29	1852	2.7740	2.8670	0.0930	50
9/10/2021			_	-		Resched	uled to 11/1	10/2021 due	to adverse weath	er	-	•		•	-
11/10/2021	Fine	5757.7	5781.7	1440.0	39	39	39.0	28.5	1005.4	0.64	925	2.7551	2.8238	0.0687	74
15/10/2021	Sunny	5781.7	5805.7	1440.0	39	39	39.0	26.2	1009.2	0.77	1105	2.7674	2.8138	0.0464	42
21/10/2021	Fine	5805.7	5829.7	1440.0	39	40	39.5	24.2	1014.9	1.13	1625	2.7919	2.8290	0.0371	23
27/10/2021	Sunny	5829.9	5853.9	1440.0	39	41	40.0	25.6	1016.7	1.52	2182	2.7976	2.8849	0.0873	40
	•							_		Maximum:	74	$\mu g/m^3$	Minimum:	23	$\mu g/m^3$

Location: Man Cheong Building (W-A6)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

Parameter: TSP 24-hour
Other Factors Nearby traffic

Date of Calibration:	23-Sep-21	Slope =	2.4516
Calibration due date:	8-Oct-21	Intercept =	35.6576
Date of Calibration:	11-Oct-21	Slope =	1.5231
Calibration due date:	26-Oct-21	Intercept =	38.1233
Date of Calibration:	26-Oct-21	Slope =	1.8980
Calibration due date:	10-Nov-21	Intercept =	37.1018

Start Date	Weather Condition		Elapse Time		Cl	Chart Reading I		Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter Weight (g)		Particulate weight	Conc.
	Condition	Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m ³)	Initial	Final	(g)	$(\mu g/m^3)$
4/10/2021	Sunny	5322.6	5346.6	1440.00	42	42	42.0	29.8	1012.5	1.43	2063	2.7652	2.8940	0.1288	62
9/10/2021						Resch	neduled to 1	1/10/2021 d	lue to adverse weat	her				-	
11/10/2021	Fine	5346.9	5370.9	1440.00	40	40	40.0	28.5	1005.4	0.88	1263	2.7650	2.8611	0.0961	76
15/10/2021	Sunny	5370.9	5394.9	1440.00	40	41	40.5	26.2	1009.2	1.40	2017	2.7711	2.8292	0.0581	29
21/10/2021	Fine	5394.9	5418.9	1440.00	39	40	39.5	24.2	1014.9	0.98	1413	2.7931	2.851	0.0579	41
27/10/2021	Sunny	5419.1	5443.1	1440.00	38	39	38.5	25.6	1016.7	0.79	1131	2.7814	2.8871	0.1057	93
	· ·		-						-	Maximum:	93	μg/m ³	Minimum:	29	μg/m ³

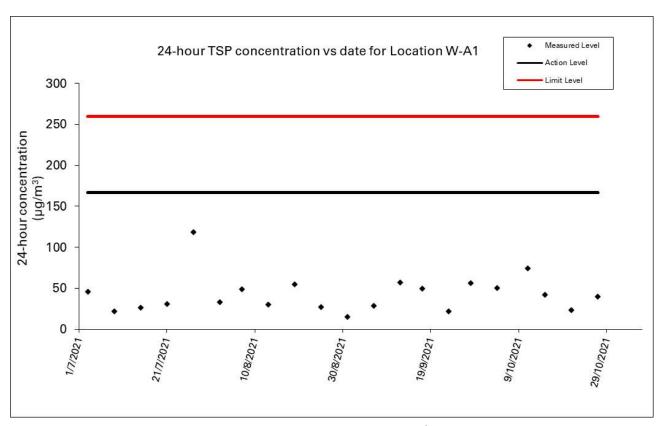


Figure 3: Graphical Illustration of Measured 24-hour TSP (µg/m³) Levels at W-A1


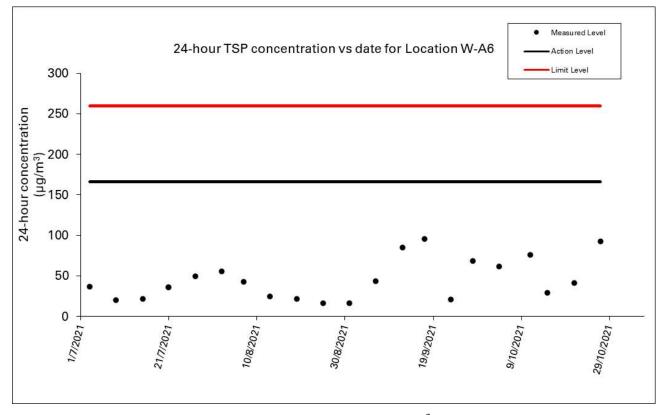



Figure 4: Graphical Illustration of Measured 24-hour TSP (µg/m³) Levels at W-A6


Wind direction data for 4, 5, 11, 12, 15, 16, 21, 22, 27 and 28 October 2021






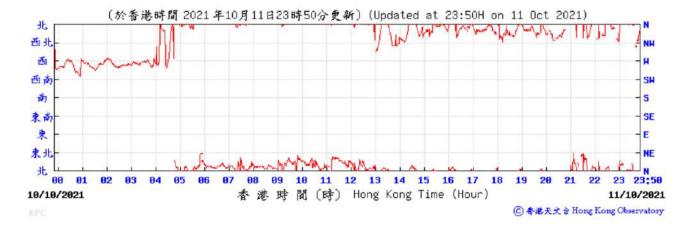


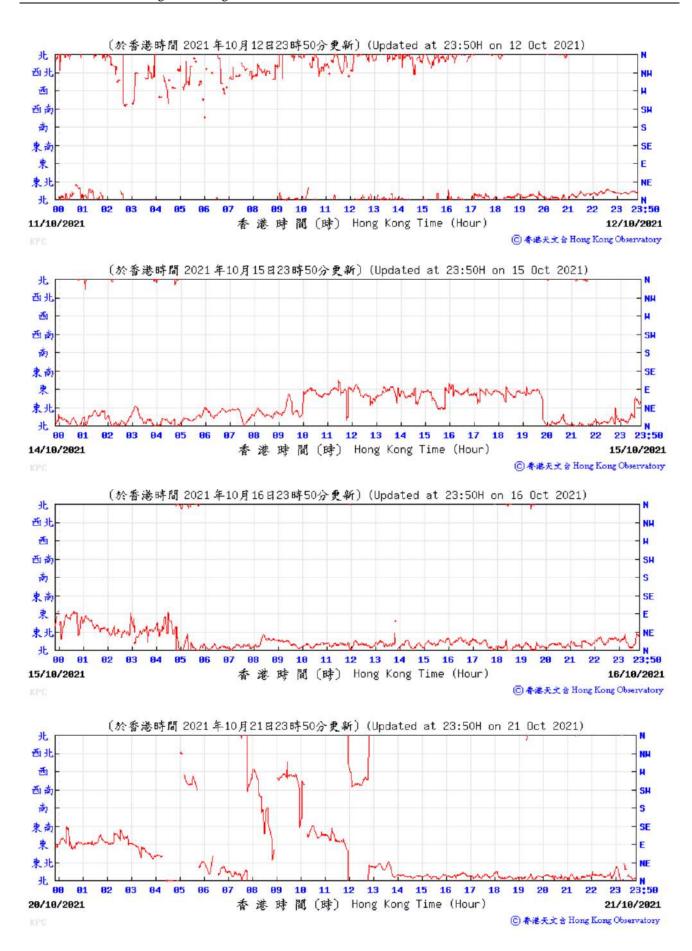


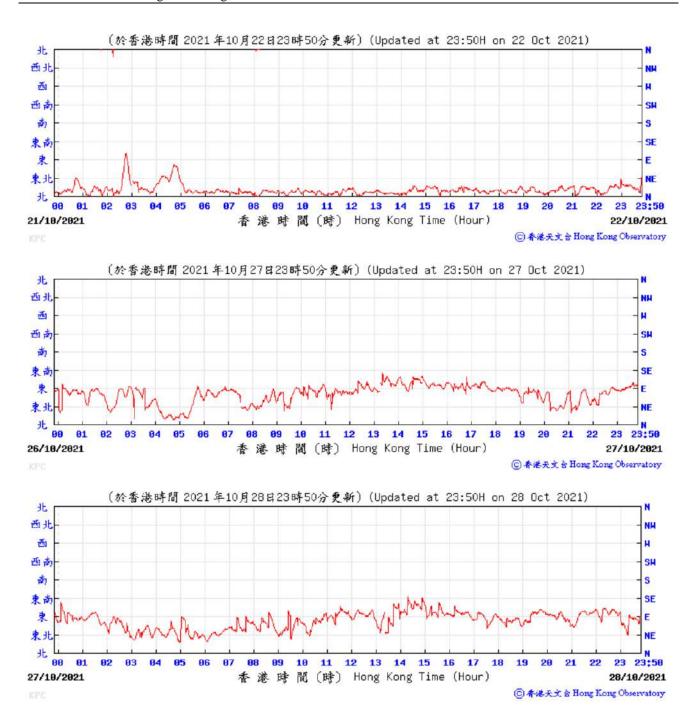


Wind speed data for 4, 5, 11, 12, 15, 16, 21, 22, 27 and 28 October 2021

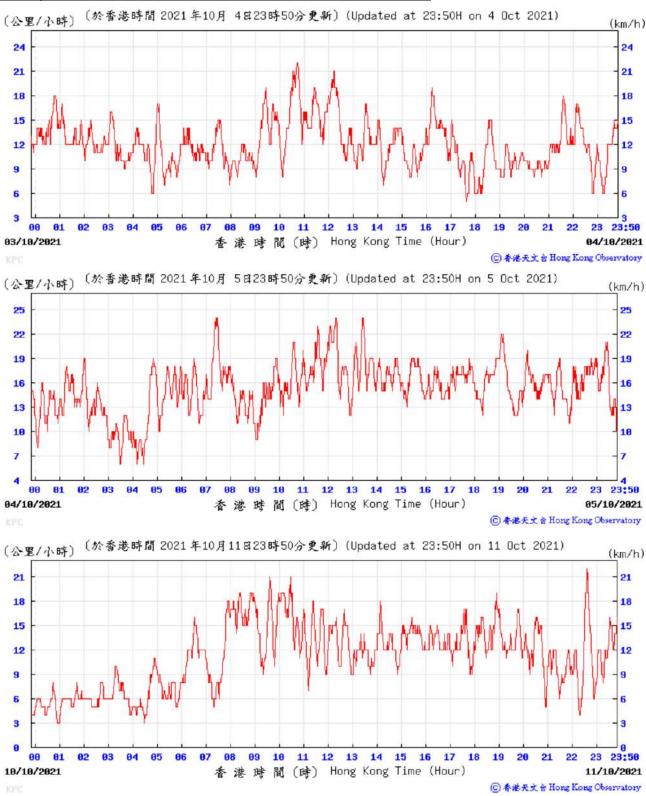

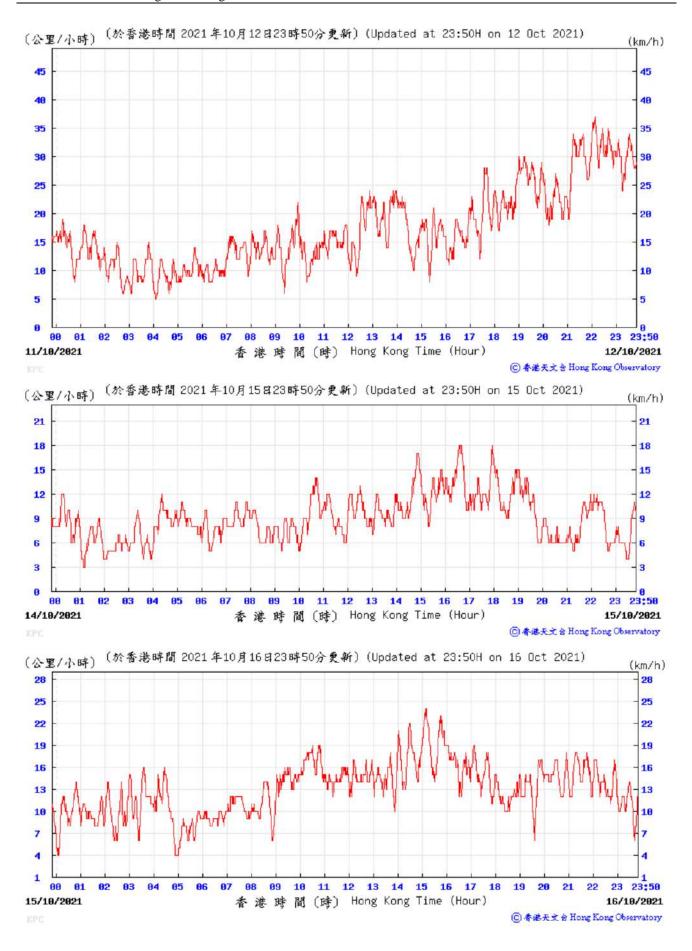

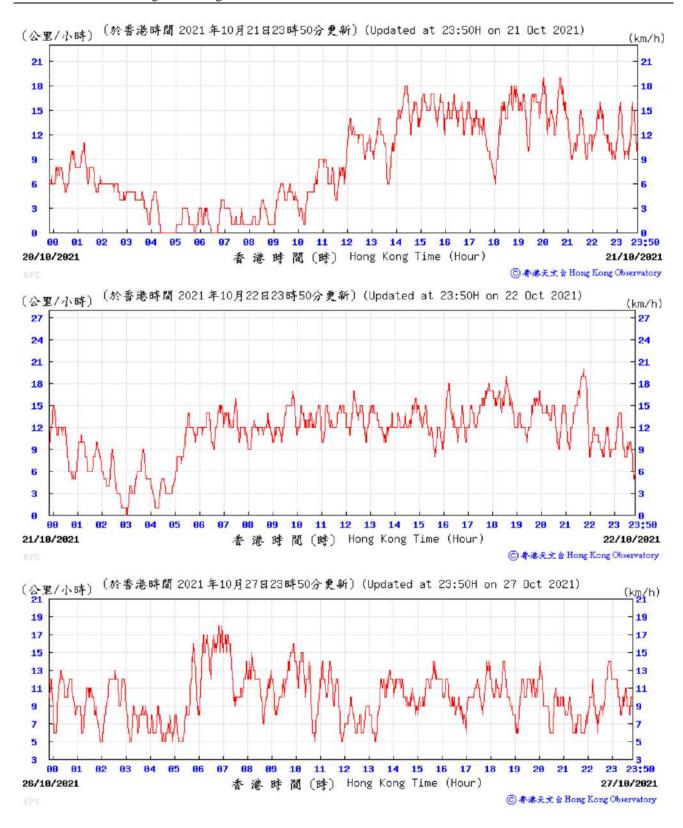

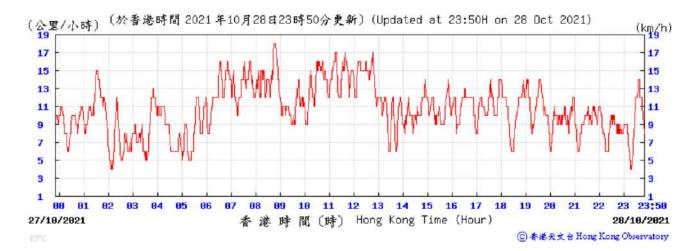

Contract No. HY/2014/08		
Environmental Monitoring & Auditing		

Appendix M
Monitoring Data (Noise)

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-N1A)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

 $\begin{array}{ll} \text{Parameter:} & L_{\text{eq}}, L_{10}, L_{90} \\ \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$

Noise Monitoring data:

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	L ₁₀	L ₉₀	Wind speed (m/s)	
04/10/2021	Sunny	13:07	-	13:37	61.1	62.2	59.1	3.3	
09/10/2021		Rescheduled to 11/10/2021 due to adverse weather							
11/10/2021	Fine	10:02	-	10:32	60.6	63.9	57.8	4.9	
15/10/2021	Sunny	11:04	-	11:34	60.7	62.9	59.5	3.1	
21/10/2021	Fine	12:12	-	12:42	61.1	62.9	59.5	3.3	
27/10/2021	Sunny	12:26	-	12:56	61.1	62.5	58.8	2.5	

Remark: No examination was at W-N1A in the reporting month so limit levels for all monitoring days were 70 dB(A).

Location: Hydan Place (W-N18)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

 $\begin{array}{ll} \mbox{Parameter}: & L_{\mbox{\scriptsize eq}}, L_{10}, \ L_{90} \\ \mbox{Other Factors} & \mbox{Nearby traffic} \end{array}$

Noise Monitoring data:

Date	Weather	Start Time		End Time	T	L_{10}	Ι	Wind	
Date	weamer	Start Time	-	Elia Tillie	$L_{\rm eq}$	L10	L ₉₀	speed (m/s)	
04/10/2021	Sunny	13:48	-	14:18	71.1	73.8	69.3	4.2	
09/10/2021		Rescheduled to 11/10/2021 due to adverse weather							
11/10/2021	Fine	10:53	-	11:23	71.9	75.1	69.9	2.5	
15/10/2021	Sunny	11:51	-	12:21	70.8	74.4	69.3	3.3	
21/10/2021	Fine	14:58	-	15:28	71.2	74.6	69.2	4.4	
27/10/2021	Sunny	9:47	-	10:17	71.1	75.0	69.3	4.2	

Location: Prosperous Garden Block 1 (W-N25A)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

 $\begin{array}{ll} \mbox{Parameter}: & L_{\mbox{\scriptsize eq}}, L_{10}, \ L_{90} \\ \mbox{Other Factors} & \mbox{Nearby traffic} \end{array}$

Noise Monitoring data:

Date	Weather	Start Time		End Time	T	Ι	L ₉₀	Wind
Date	weamer	Start Time	-	Elia Tillie	L_{eq}	L_{10}	L 90	speed (m/s)
04/10/2021	Sunny	14:30	-	15:00	71.3	73.5	69.4	3.9
09/10/2021		Rescheduled to 11/10/2021 due to adverse weather						
11/10/2021	Fine	13:09	-	13:39	71.1	73.9	69.5	3.9
15/10/2021	Sunny	12:37	-	13:07	71.0	75.1	69.4	2.2
21/10/2021	Fine	15:33	-	16:03	71.0	73.7	69.0	4.2
27/10/2021	Sunny	10:29	-	10:59	70.2	73.9	69.0	2.5

Location: The Coronation Tower 1 (W-P11)

Monitoring date: 4, 11, 15, 21 and 27 October 2021

 $\begin{array}{ll} \text{Parameter}: & L_{\text{eq}}, L_{10}, \ L_{90} \\ \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$

Noise Monitoring data:

Date	Weather	Start Time		End Time	L_{eq}	L_{10}	L ₉₀	Wind	
Date	weather	Start Time	-	End Time	Leq	L 10	250	speed (m/s)	
04/10/2021	Sunny	15:26	-	15:56	70.0	71.4	68.6	2.8	
09/10/2021		Rescheduled to 11/10/2021 due to adverse weather							
11/10/2021	Fine	14:00	-	14:30	69.5	72.9	67.0	4.2	
15/10/2021	Sunny	13:36	-	14:06	71.2	74.4	68.4	2.8	
21/10/2021	Fine	16:22	-	16:52	70.8	73.6	68.2	3.6	
27/10/2021	Sunny	11:14	-	11:44	70.9	73.3	68.9	3.3	

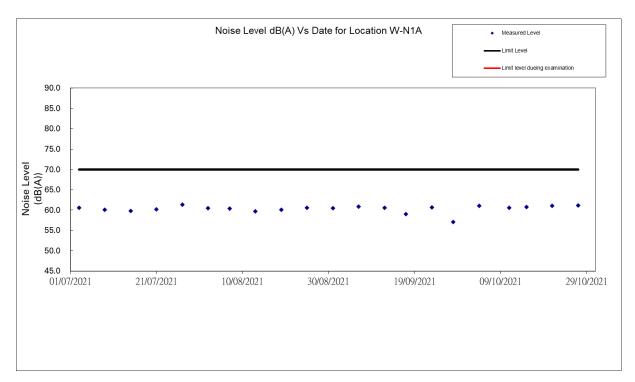


Figure 1: Graphical Illustration of Measured Noise Levels at W-N1A

Remark: No examination was at W-N1A in the reporting month so limit levels for all monitoring days were 70 dB(A).

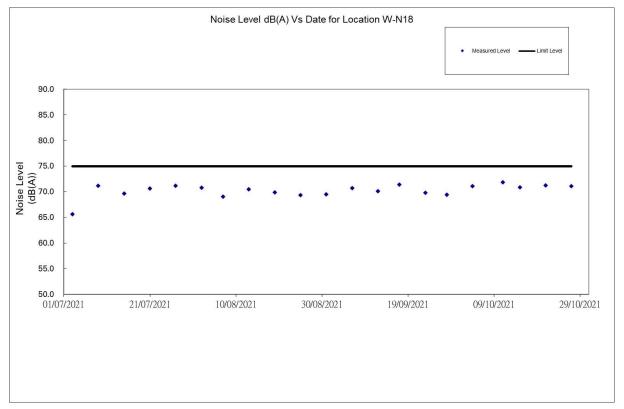


Figure 2: Graphical Illustration of Measured Noise Levels at W-N18

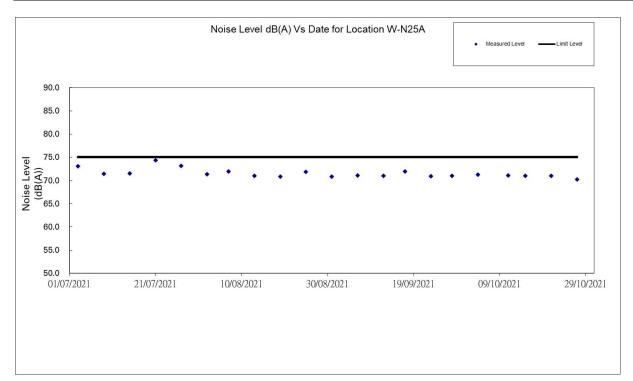


Figure 3: Graphical Illustration of Measured Noise Levels at W-N25A

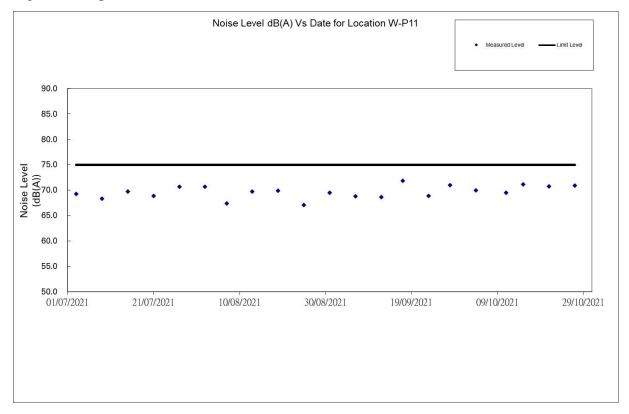


Figure 4: Graphical Illustration of Measured Noise Levels at W-P11

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix N
Waste Flow Table

Monthly Summary Waste Flow Table

Highways Department Name of Department: Contract No. / Works Order No.: <u>HY/2014/08</u>

Monthly Summary Waste Flow Table for October 2021

[to be submitted not later than the 15th day of each month following reporting month] (All quantities shall be rounded off to 1 decimal place.)

	Actual Quantities of <u>Inert</u> Construction Waste Generated Monthly							
Month	(a)=(b)+(c)+(d)+(e)+ (f)+ (g)+ (h)+ (i)+ (j)+ (k) Total Quantity Generated	(b) Hard Rock and Large Broken Concrete	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed of as Public Fill	(f) Imported Fill		
	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)		
Jan-21	9229.4	856.6	0.0	0.0	8262.2	0.0		
Feb-21	4559.4	152.4	0.0	0.0	4274.6	0.0		
Mar-21	9144.7	1428.5	0.0	0.0	6820.2	297.7		
Apr-21	6996.2	408.7	0.0	0.0	6261.1	280.0		
May-21	9933.1	446.4	0.0	0.0	8482.7	961.9		
Jun-21	9814.2	386.5	0.0	0.0	9397.2	0.0		
Sub-total	49677.0	3679.1	0.0	0.0	43498.0	1539.6		
Jul-21	13470.0	620.1	0.0	0.0	12821.0	0.0		
Aug-21	8059.6	116.7	0.0	0.0	7889.7	3.3		
Sep-21	8683.5	673.1	0.0	676.2	7284.0	0.0		
Oct-21	10240.4	406.4	0.0	468.5	9326.2	0.0		
Nov-21								
Dec-21								
Total	90130.5	5495.4	0	1144.7	80818.9	1542.9		
2018	51057.9	0.0	0.0	0.0	47715.6	2877.4		
2019	112830.1	541.0	1523.8	13525.0	93132.9	3155.6		
2020	193021.9	58778.0	1205.6	19108.6	112556.8	0.0		
cumulated Total	447040.4	64814.4	2729.4	33778.3	334224.2	7575.9		

	Actual Quantities of Non-inert Construction Waste Generated Monthly									
Month	(g) Metals (in '000kg)		(h) Paper/ cardboard packaging (in '000kg)		(i) Plastics (in '000kg)		(j) Chemical Waste (in '000kg)		(k) Others, e.g. General Refuse disposed at Landfill (in 'tonnes)	
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated	
Jan-21	0.0	0.0	0.6	0.0	0.0	0.0	20.7	0.0	89.3	
Feb-21	0.0	0.0	0.7	0.0	0.0	0.0	0.0	0.0	131.7	
Mar-21	0.0	0.0	0.1	0.0	0.0	0.0	1.6	0.0	596.6	
Apr-21	15.3	0.0	0.5	0.0	0.0	0.0	0.0	0.0	30.6	
May-21	14.9	0.0	0.3	0.0	0.0	0.0	0.0	0.0	26.9	
Jun-21	0.0	0.0	0.6	0.0	0.0	0.0	0.4	0.0	29.5	
Sub-total	30.2	0.0	2.8	0.0	0.0	0.0	22.7	0.0	904.6	
Jul-21	0.0	0.0	0.3	0.0	0.02	0.0	0.0	0.0	28.6	
Aug-21	0.0	0.0	0.6	0.0	0.0	0.0	0.0	0.0	49.3	
Sep-21	0.0	0.0	0.1	0.0	0.0	0.0	0.0	0.0	50.1	
Oct-21	0.0	0.0	0.6	0.0	0.0	0.0	0.0	0.0	38.7	
Nov-21										
Dec-21										
Total	30.2	0.0	4.4	0.0	0.02	0.0	22.7	0.0	1071.3	
2018	28.4	0.0	0.0	0.0	0.0	0.0	2.0	0.0	434.5	
2019	0.0	9.1	3.4	6.8	0.0	0.0	5.2	0.0	927.3	
2020	69.2	0.0	3.3	0.0	0.02	0.0	25.3	0.0	1275.1	
Accumulated Total	127.8	9.1	11.1	6.8	0.04	0.0	55.2	0.0	3708.2	

Appendix O
Statistics on Complaint, Notifications of
Summons and Successful Prosecutions

Statistical Summary of Exceedances

	Air	· Quality			
Location	Action Level	Limit Level	Total		
W-A1	0	0	0		
W-A6	0	0	0		
	Noise				
Location	Action Level	Limit Level	Total		
W-N1A	0	0	0		
W-N18	0	0	0		
W-N25A	1^	0	0		
W-P11	0	0	0		

Remark: ^W-N25A was the nearest NSR to Zones B2 and C.

Statistical Summary of Environmental Complaints

Donouting Dowied	Environmental Complaint Statistics			
Reporting Period	Frequency	Cumulative	Complaint Nature	
1 October 2021- 31 October 2021	1	27	Construction Noise	

Statistical Summary of Environmental Non-compliance


Donarting Daried	En	Environmental Non-compliance Statistics			
Reporting Period	Frequency	Cumulative	Details		
1 October 2021- 31 October 2021	0	1	N/A		

Statistical Summary of Environmental Summons

Statistical Statis					
Donouting Donied		Environmental Summons Statistics			
Reporting Period	Frequency	Cumulative	Details		
1 October2021-	0	1	NI/A		
31 October 2021	Ü	1	N/A		

Statistical Summary of Environmental Prosecution

Danauting Davied]	Environmental Prosecution Statistics			
Reporting Period	Frequency	Cumulative	Details		
1 October2021-	0	0	NI/A		
31 October 2021	0	U	N/A		

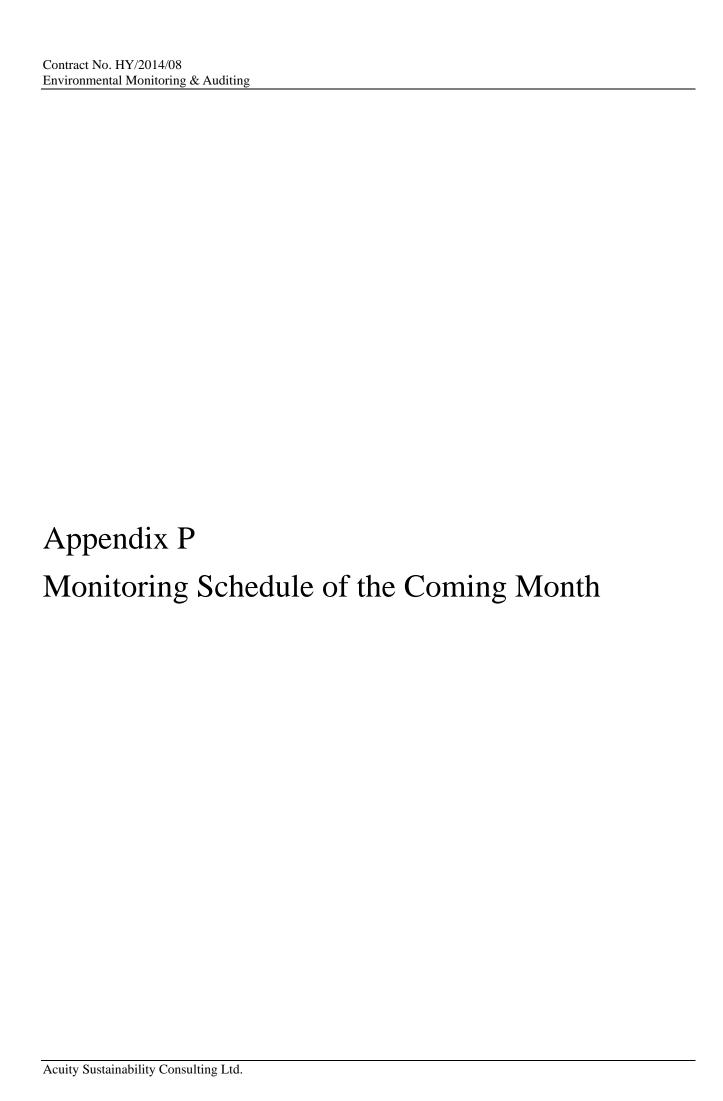

			Impact Monitoring Schedule for YMTE			
-			Nov-21			T.
Sun	Mon	Tue	Wed 3	Thur 4	Fri 5	Sat 6
	1	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	3	4		
_		g	10		12	10
	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	9	10	11	12	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A
14	15	16	17	18	19	20
					Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	
21	22	23	24	25	26	27
				Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A		
28	29	30				

Appendix Q
Interim Report for the Complaint

Interim Report on Environmental Complaint

Project	Central Kowloon Route, Yau Ma Tei East Section
Complaint Code	EC028-CKRYMTE20211022_001
Complaint description	Complainant who lives in Prosperous Garden complained that the noise generated from drilling and breaking activities at sites near Yau Ma Tei Jockey Club Clinic/ Yau Ma Tei Division Police Station/ the junction of Pak Hoi Street and Ferry Street and unknown sites has passed 75db(A) during non-restricted hours. Details of the NCO had been explained to the complainant, but the complainant insisted on EPD following up, otherwise he/she will complain to district councilor.
	"居住駿發花園的投訴者投訴位於油麻地賽馬會診所隔離地盤/油麻地警署隔離地盤/北海街與渡船街交界地盤及其他不知道地點的地盤於非管制時間以幾部機器鑿/鑽地噪音貝過了七十五分貝;已向投訴者解釋 NCO, 但投訴者仍堅持環保署跟,否則會向區議員投訴"
Parameter	Construction Noise
Investigation finding	The complainant made the complaint on 22 October 2021 and was concerned about the noise impacts generated from drilling and breaking activities. The complainant did not specify the concerned dates and therefore we assume the investigation period to be from 11 to 21 October 2021. As noted from the Contractor, no breaking activities were carried out in the areas mentioned by the complainant. The nearest site to Prosperous Garden is Zones B2 and C, where the major and noisiest work was D-wall trimming from 11 to 21 October 2021 and the nearest noise monitoring point to the concerned areas is Prosperous Garden (W-N25A).
	Impact noise monitoring had been carried out on 11, 15 and 21 October 2021 and the monitoring results at W-N25A were 71.1, 71.0 and 71.0dB(A) in L _{eq30min} , which were all below the limit level for the monitoring location at 75dB(A) in L _{eq30min} . As similar works had been conducted from 11 to 21 October 2021, it was believed that the construction noise generated during daytime from 11 to 21 October 2021 did not exceed the noise limit level as stipulated under EM&A manual. In addition, no environmental deficiency regarding construction noise at Zone B2 and C was observed during weekly site inspection conducted on 18 (with IEC) and 21 October 2021.
	As the construction noise generated during daytime from 11 to 21 October 2021 did not exceed the noise limit level as stipulated under EM&A manual, it is concluded that no non-compliance to the EM&A requirement of the Project regarding noise impacts from construction works.
Actions taken / to be taken	The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize nuisance to the public. Noise barrier mat had been erected by the Contractor to reduce impact from the drilling and breaking machines. Supporting photo is provided in Appendix A.
Remarks	PME used in Zone B2 and C from 11 to 21 October 2021 during daytime: Generator x1 Mobile crane x2 Excavator x1 Construction works carried out in Zone B2 and C from 11 to 21 October 2021 during daytime: D-wall trimming
	Works locations: (next page.)
Prepared by	Katrina Chui
Date	26 October 2021



Appendix A Supporting Photo



Figure A1 Noise barrier mat erected along site boundary