
Vol. 3 of 5 FEP-03/457/2013/D Central Kowloon Route Yau Ma Tei East Contract No. HY/2014/08 August 2022





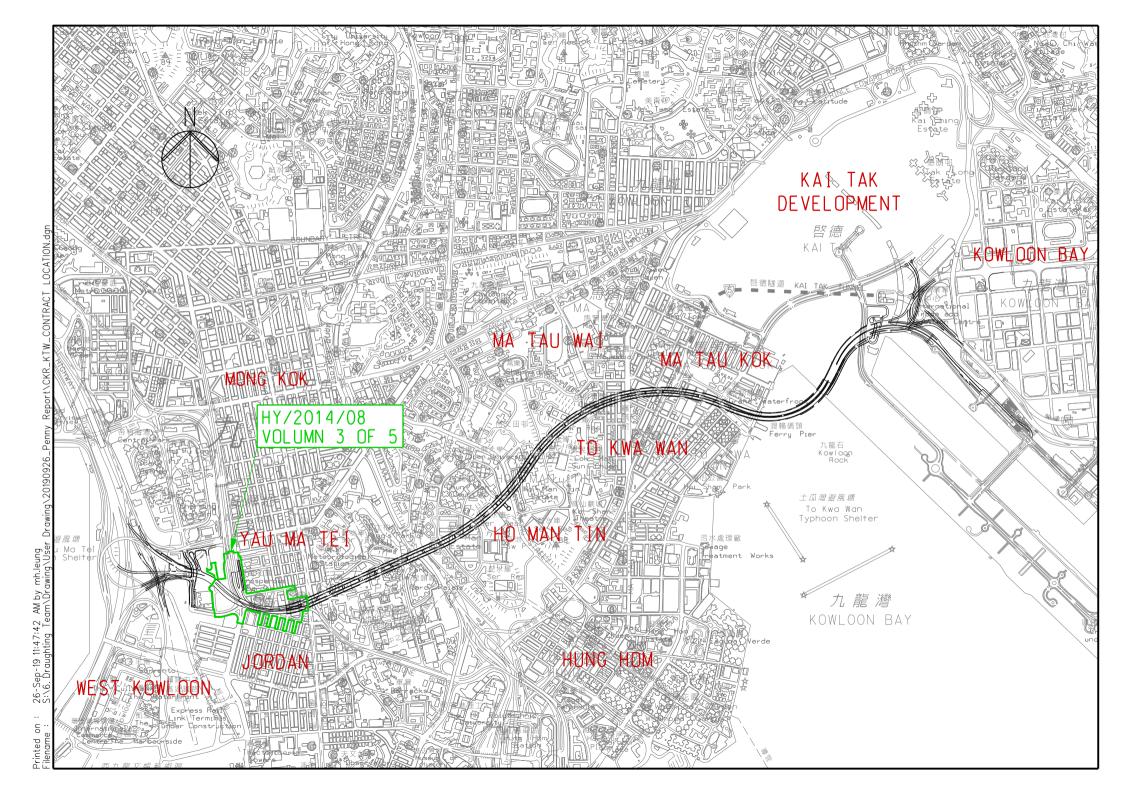

Environmental Permit No. EP-457/2013/D

Central Kowloon Route

Independent Environmental Checker Verification

	` ' '
Reference Document/Plan	
Document/ Plan to be Certified / Verified:	Monthly EM&A Report No.53 (August 2022)
Date of Report:	13 September 2022 (Rev.1)
Date received by IEC:	13 September 2022

Yau Ma Tei East (HY/2014/08)

Reference EP Condition

Works Contract:

Environmental Permit Condition: 3.4

Submission of Monthly EM&A Report of the Project

3.4 Four hard copies and one electronic copy of monthly EM&A Report shall be submitted to the Director within 2 weeks after the end of each reporting month throughout the entire construction period. The EM&A Reports shall include a summary of all non-compliance. The submissions shall be certified by the ET Leader and verified by the IEC as complying with the requirements as set out in the EM&A Manual before submission to the Director. Additional copies of the submission shall be provided to the Director upon request by the Director.

IEC Verification

I hereby verify that the above referenced document/plan complies with the above referenced condition of EP-457/2013/D.

Ms Mandy To

Mondy 20.

Date: 13 September 2022

Independent Environmental Checker

Our ref: 0436942_IEC Verification Cert_YMTE_Monthly EM&A Rpt No.53.docx





Build King – SK ecoplant Joint Venture

Central Kowloon Route Contract HY/2014/08 Section of Yau Ma Tei East

Monthly EM&A Report No. 53

(Period from 1 to 31 August 2022)

Rev. 1 (13 September 2022)

	Name	Signature
Prepared by	Janice K.C. Lee (Environmental Consultant)	p
Checked & Reviewed by	Y.H. Law (Senior Environmental Consultant)	Malan
Approved & Certified by	Kevin W. M. Li (Environmental Team Leader)	\(\)

TABLE OF CONTENTS

EXECUTIVE SUMMARY

1.	BASIC PROJECT INFORMATION	7
2.	ENVIRONMENTAL STATUS	1
3.	MONITORING RESULTS	13
4.	SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS	21
5.	EM&A SITE INSPECTION	23
6.	FUTURE KEY ISSUES	24
7.	CONCLUSION AND RECOMMENDATIONS	26

LIST OF APPENDICES

- A. Alignment and Works Area for the Contract No. HY/2014/08
- B. Construction Programme
- C. Project Organization Chart
- D. Dust Event-Action Plan (EAP)
- E. Noise Event-Action Plan (EAP)
- F. Environmental Mitigation Implementation Schedule (EMIS)
- G. Monitoring Schedules of the Reporting Month
- H. Calibration Certificate (Air Monitoring)
- I. Calibration Certificate (Noise)
- J. The Certification of Laboratory with HOKLAS Accredited Analytical Tests
- K. Location Plan of Noise and Air Quality Monitoring Station
- L. Monitoring Data (Air Monitoring)
- M. Monitoring Data (Noise)
- N. Waste Flow Table
- O. Statistics on Complaint, Notifications of Summons and Successful Prosecutions
- P. Monitoring Schedule of the Coming Month
- Q. Interim Report for the Complaint

EXECUTIVE SUMMARY

- A.1 Build King SK ecoplant Joint Venture ("Contractor") commenced the construction works of Highway Department (HyD) Central Kowloon Route Contract No. HY/2014/08 Section of Yau Ma Tei East ("The Project") on 20 April 2018. This is the 53rd monthly Environmental Monitoring and Audit (EM&A) report presenting the EM&A works carried out during the period from 1 August 2022 to 31 August 2022.
- A.2 A summary of the construction works reported by Main Contractor for the Project during the reporting month is listed below.

Construction Activities undertaken

- Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B
- Construct D-walls, buttress walls, install king posts/ recharge well/observation well/pumping well, construct traffic deck and carry out pumping test at Zone B
- Construct D-walls, buttress walls, install king posts/recharge well/observation well/pumping well, construct roof slab, traffic deck and carry out pumping test at Zone C
- Construct D-walls/Pipe Piles, buttress walls, install king posts/ recharge well/observation well/pumping well, construct traffic deck and carry out pumping test at Zone D
- Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, Dwall construction, install kingposts/recharge well/observation well/pumping well and Pumping Test at Zone F
- Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/recharge well/observation well/pumping well and Pumping Test at Zone G
- Construct portal frame across, demolish existing Gascoigne Road flyover beams and construct end span at Portion 21
- Construct bridge deck for spans P2 to P6 at Gascoigne Road flyover
- Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts of Noise Enclosure at Zone 3
- Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2
- A.3 A summary of regular construction noise and construction dust monitoring activities in this reporting period is listed below:

Regular construction noise monitoring during normal working hours

W-N1A, W-P11, W-N18, W-N25A 6 times

Construction dust (24-hour TSP) monitoring

W-A1 6 times W-A6 6 times

Construction dust (1-hour TSP) monitoring

W-A1, W-A6 18 times

A.4 Bi-weekly inspection of the implementation of landscape and visual mitigation measures was conducted on 4 and 18 August 2022. Details of the audit findings and implementation status are presented in Section 5.

- A.5 Joint weekly site inspections were conducted by representatives of Environmental Team (ET), Contractor and Engineer on 4, 11, 18 and 26 August 2022. One joint site inspection with IEC was also undertaken on 26 August 2022. Details of the audit findings and implementation status are presented in Section 5.
- A.6 Details of waste management are presented in Section 3.
- A.7 One Action Level of construction noise was triggered during the reporting period as a documented complaint was received on 12 August 2022 related to construction noise from works areas at Zone B2 and C. No exceedance of the Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- A.8 One dust related complaint was received on 4 August 2022, one water seepage related complaint, and one noise related complaint were received on 12 August 2022. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim report for the complaint is shown in Appendix Q.
- A.9 No non-compliance was reported in the reporting month.
- A.10 No notification of summon or prosecution was received in this reporting month.
- A.11 A summary of the construction activities provided by Main Contractor in the next reporting month is listed below:

Construction Activities to be undertaken

- Excavation and construction of bottom slab at Zone A
- Installation of Underground Utilities Hanger Support, exposure of box culvert and plugging of abandoned pipe at Zone B
- Installation of recharge well, observation well, pumping well and carry out pumping test at Zone B & Zone D
- TAM grouting between Zones B2 & C1, install recharge well/observation well/pumping well at Zones C1, C2 & C3
- Construction of remaining buttress wall, installation of king posts, recharge well/observation well/pumping well and erection of temporary traffic deck at Zone D
- Pre-boring works and D-wall construction at Zone B3
- Complete reinstatement of partial demolition works of Cable Tunnel A, Pre-boring works and commence D-wall construction at Zone F
- Pre-drilling works, Pipe piling works, Underground Utilities diversion work and ground improvement (TAM Grouting) works at Zone G
- Works for reprovisioning of Gascogine Road Flyover at HKAA area: Temporary footing and falsework erection for P7 end span construction
- Bridge Works:
 - i. FT1- complete bridge deck construction for P4L and relocate FT1 to pier P3
 - ii. FT2- complete bridge deck construction for P6L and relocate FT2 to P2

Construction Activities to be undertaken

- iii. Portal and End-span Deck Construction for P1
- iv. Pier Head Segment including Cross Beam construction for P2
- Continue socketed H-pile works for middle/east foundation and west side of Noise Enclosure in Zone 3, Excavation and Lateral Support and construction works for pile caps and ground beams construction for middle/east foundation for Zone 3 Noise Enclosure
- Erection of Y columns and side columns for Noise Enclosure in Zone 3 (night works)
- Works at Zone 2 Noise Enclosure scheduled as the following:
 - i. Column E Excavation and Lateral Support works and pile cap construction
 - ii. Column G Permanent diversion of uncharted 1200mm dia. drainage pipe
 - iii. Columns C, A1 and D- Temporary socketed H-pile works
 - iv. Column A Proof coring of Barrette Walls and Excavation and Lateral Support works for pile cap construction
- Noise Enclosure steelworks fabrication at Fabrication Yard in Zhuhai, China
- Erection of Y columns and side columns for Noise Enclosure in Zone 3
- Monitoring of instrumentation for all areas

1. Basic Project Information

- 1.1. Central Kowloon Route (CKR) is a 4.7 km long dual 3-lane trunk road in Central Kowloon linking Yau Ma Tei Interchange in West Kowloon with the road network on Kai Tak Development and Kowloon Bay in East Kowloon.
- 1.2. The Central Kowloon Route Design and Construction Environmental Impact Assessment Report (Register No.: AEIAR-171/2013) was approved with conditions by the Environmental Protection Department (EPD) on 11 August 2013. An Environmental Permit (EP 457/2013) was issued on 9 August 2013. Variations of EP (VEP) was applied for and the EP (EP-457/2013/C) was issued by EPD on 16 January 2017. Variations of EP (VEP) was subsequently applied for and the latest EP (EP-457/2013/D) was issued by EPD on 15 June 2021. A Further EP (FEP-03/457/2013/D) was issued by EPD on 5 November 2021.
- 1.3. The construction of the CKR had been divided into different sections. This Contract No. HY/2014/08 Section of Yau Ma Tei East (YMTE) covers part of the construction activities located at Yau Ma Tei under the EP and FEP which includes:
 - · Section of Yau Ma Tei East
 - i. Construction of Cut-and-Cover Tunnel in compliance with all statutory requirements and the requirements specified under the Contract while maintaining the traffic with all necessary provisions
 - ii. Construction and subsequent handover of Yau Ma Tei Access Shaft for facilitating the access and use by the contractor of Central Kowloon Route Central Tunnel contract
 - iii. Demolition of existing buildings including Yau Ma Tei Multi-storey Carpark Building, Yau Ma Tei Specialist Clinic Extension Building and Yau Ma Tei Jade Hawker Bazaars
 - iv. Demolition and re-provisioning of Gascoigne Road Flyover and the underpinning works for the existing Ferry Street Flyover and Yau Ma Tei Police Station New Wing Building
 - v. Construction of civil provisions and coordination with the contractor of Central Kowloon Route Tunnel Electrical & Mechanical contract
 - vi. Design and construction of Noise Barrier Works
 - vii. Prepare temporary traffic arrangement proposals, discuss at Traffic Management Liaison Group meeting and obtain its agreement and approval/endorsement from relevant authorities at suitable times to enable the execution of the Works

The alignment and works area for the Contract No. HY/2014/08 - are shown in Appendix A.

1.4. A summary of the major construction activities undertaken in this reporting period is shown in Table 1.1. The construction programme is presented in Appendix B.

Table 1.1 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Construction Activities undertaken

- Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B
- Construct D-walls, buttress walls, install king posts/recharge well/observation well/pumping well, construct traffic deck and carry out pumping test at Zone B
- Construct D-walls, buttress walls, install king posts/recharge well/observation well/pumping well, construct roof slab, traffic deck and carry out pumping test at Zone C
- Construct D-walls/Pipe Piles, buttress walls, install king posts/recharge well/observation well/pumping well, construct traffic deck and carry out pumping test at Zone D
- Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, Dwall construction, install kingposts/ recharge well/observation well/pumping well and Pumping Test at Zone F
- Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G
- Construct portal frame across, demolish existing Gascoigne Road flyover beams and construct end span at Portion 21
- Construct bridge deck for spans P2 to P6 at Gascoigne Road flyover
- Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts of Noise Enclosure at Zone 3
- Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2
- 1.5. The project organisational chart specifying management structure and contact details are shown in Appendix C.
- 1.6. A summary of the valid permits, licences, and /or notifications on environmental protection for this Project is presented in Table 1.2.

Table 1.2 Summary of the Status of Valid Environmental Licence

Notification, Permit and Documentations

Permit/ Licences/	Valid Period			
Notification	From	То	Status	Remark
/Reference No.	110111	10		
Environmental Permit				
EP-457/2013/D	15 Jun 2021	End of Project	Valid	-
Further Environmental l	Permit			
FEP-03/457/2013/D	5 Nov 2021	End of Project	Valid	
Wastewater Discharge Li	cense			
WT00030660-2018	28 Mar 2018	31 Mar 2023	Valid	-
Notification of Constructi	on Works under	the Air Pollution	Control (Construction	n Dust) Regulation
471691	14 Sep 2021	End of Project	Notified	-
Chemical Waste Produce	r Registration			
WPN5213-225-B2526-01	14 Mar 2018	End of Project	Valid	-
Billing Account for Disposal of Construction Waste				
7029997	1 Feb 2018	End of Project	Valid	-
Construction Noise Permit				
GW-RE0529-22	31 May 2022	26 Nov 2022	Valid	Construction Noise
UW-KE0329-22	31 Way 2022	20 INOV 2022	v anu	Permit at Zone A &

Permit/ Licences/ Valid Period				
Notification /Reference No.	From	То	Status	Remark
/ Iterer circe 1 (0)				B1
GW-RE0643-22	30 Jun 2022	29 Sep 2022	Valid	Construction Noise Permit at Zone B2
GW-RE0716-22	15 Jul 2022	14 Jan 2023	Valid	Construction Noise Permit at Zone 3
GW-RE0492-22	20 May 2022	19 Nov 2022	Valid	Construction Noise Permit at P6
GW-RE0529-22	31 May 2022	26 Nov 2022	Valid	Construction Noise Permit at Zone A & B1
GW-RE0637-22	28 Jun 2022	27 Sep 2022	Supersede by GW-RE0804-22	Construction Noise Permit at Zone D & P4
GW-RE0804-22	12 Aug 2022	11 Nov 2022	Valid	Terrint at Zone D & 14
GW-RE0648-22	27 Jun 2022	31 Aug 2022	Valid	Construction Noise Permit at GRF for Temporary Erection of Bridge Decking
GW-RE0711-22	12 Jul 2022	31 Aug 2022	Valid	Construction Noise Permit for Formtraveller Assembly and Launching at Battery Street
GW-RE0617-22	18 Jun 2022	31 Aug 2022	Valid	Construction Noise Permit for Temporary Shutdown Traffic Light Control
GW-RE0700-22	14 Jul 2022	31 Aug 2022	Valid	Construction Noise Permit for installation of Overhead Traffic Signal at Ferry Street southbound near Kansu Street
GW-RE0707-22	17 Jul 2022	28 Aug 2022	Valid	Construction Noise Permit for TTA Implementation of Stage 4.0
GW-RE0758-22	27 Jul 2022	30 Sep 2022	Valid	Construction Noise Permit for Inspection and Maintenance (Road Resurfacing)
GW-RE0722-22	1 Aug 2022	30 Sep 2022	Valid	Construction Noise Permit for Erection of Enclosure at Zone 3 (2nd renewal)

Permit/ Licences/	Valid	Period		
Notification /Reference No.	From	То	Status	Remark
GW-RE0723-22	23 Jul 2022	30 Sep 2022	Valid	Construction Noise Permit for disassembly, assembly and lanching of Form Traveller at Kansu Street between Shanghai Street and Canton Road
GW-RE0781-22	2 Aug 2022	30 Aug 2022	Valid	Construction Noise Permit at P2
GW-RE0812-22	12 Aug 2022	11 Nov 2022	Valid	Construction Noise Permit at Zone B2
GW-RE0839-22	16 Aug 2022	29 Oct 2022	Valid	Construction Noise Permit for Central Divider Removal at GRF
Marine Dumping Permit	T	T		T
EP/MD/23-016	23 Jun 2022	22 Dec 2022	Valid	Type 1- Open Sea Disposal
EP/MD/23-021	23 Jul 2022	22 Aug 2022	Supersede by EP/MD/23-034	Dumping at Sea Permit (Type 1 – Open Sea Disposal
EP/MD/23-034	23 Aug 2022	22 Sep 2022	Valid	(Dedicated Site) & Type 2 - Confined Marine Disposal)

2. ENVIRONMENTAL STATUS

2.1. Environmental permit (EP) conditions under the EIAO, submission status under the EP and implementation status of mitigation measures had been reviewed and implemented on schedule. The status of required submissions under the EP (EP-457/2013/D) and FEP (FEP-03/457/2013/D) as of the reporting period for the Project are summarised in Table 2.1

Table 2.1 Summary of Status of Required Submission for EP-457/2013/D and FEP-03/457/2013/D for the Project

EP/FEP Condition (EP-457/2013/D) (FEP-03/457/2013/D)	Submission	Submission date
Condition 3.4	Monthly EM&A Report (Jul 2022)	12 Aug 2022

2.2. Details of the major construction activities reported by Main Contractor in this reporting period are shown in Table 2.2.

Table 2.2 Summary of the Construction Activities reported by Main Contractor during the Reporting Month

Construction activities undertaken	Remarks on progress
 Construct D-wall panels, pumping test, excavation to roof slab & construct roof slab at Zone B 	• 92% completion
 Construct D-walls, buttress walls, install king posts/ recharge well/observation well/pumping well, construct traffic deck and carry out pumping test at Zone B 	• 97% completion
 Construct D-walls, buttress walls, install king posts/ recharge well/observation well/pumping well, construct roof slab, traffic deck and carry out pumping test at Zone C 	• 97% completion
 Construct D-walls/Pipe Piles, buttress walls, install king posts/ recharge well/observation well/pumping well, construct traffic deck and carry out pumping test at Zone D 	• 95% completion
 Underground Utilities diversions, CLP Cable Tunnel A demolition, Jet Grouting, Pre-boring, D-wall construction, install kingposts/ recharge well/observation well/pumping well and Pumping Test at Zone F 	• 23% completion
 Underground Utilities diversion, Jet Grouting, Preboring, Pipe Piles / D-wall construction, install king posts/ recharge well/observation well/pumping well and Pumping Test at Zone G 	• 16% completion
 Construct portal frame across, demolish existing Gascoigne Road flyover beams and construct end span at Portion 21 	• 58% completion
Construct bridge deck for spans P2 to P6 at Gascoigne Road flyover	• 50% completion
 Construct socketed H-piles, pile caps, ground beams, reinforced concrete columns and erect steel posts of Noise Enclosure at Zone 3 	• 53% completion
 Underground Utilities diversion, construct permanent & temporary pipe piles, barrette walls for Noise Enclosure at Zone 2 	• 57% completion

2.3. The drawing showing the project layout and the location of the monitoring station and environmental sensitive receivers are attached in Appendix A and Appendix K. Co-ordinates of the monitoring location are shown in Table 2.3.

Table 2.3 Summary for the location of the monitoring station

Monitoring Location	Location ID	Latitude	Longitude
Yau Ma Tei Catholic Primary School (Hoi Wang Road)	W-A1/ W-N1A	22.313357	114.16409
Man Cheong Building	W-A6	22.308185	114.166033
Hydan Place	W-N18	22.30858	114.170185
Prosperous Garden Block 1	W-N25A	22.309846	114.168072
The Coronation Tower 1	W-P11	22.309824	114.165616

3. MONITORING RESULTS

3.1. Monitoring Parameters

Air Quality

- 3.1.1. The impact monitoring had been carried out in accordance with section 5.8 of the approved EM&A Manual to determine the 1-hour and 24-hour total suspended particulates (TSP) levels at the monitoring locations in the reporting month.
- 3.1.2. The sampling frequency of at least once in every 6 days, shall be strictly observed at the monitoring stations for 24-hour TSP monitoring. For 1-hour TSP monitoring, the sampling frequency of at least 3 times in every 6 days should be undertaken when the highest dust impact occurs.
- 3.1.3. General meteorological conditions (wind speed, direction and precipitation) and notes regarding any significant adjacent dust producing sources had also been recorded throughout the impact monitoring period.

Noise

- 3.1.4. Construction noise level shall be measured in terms of the A-weighted equivalent continuous sound pressure level (L_{eq}). Leq (30min) shall be used as the monitoring parameter for the time period between 0700 and 1900 hours on normal weekdays.
- 3.1.5. For all other time periods, Leq (5min) shall be employed for comparison with the Noise Control Ordinance (NCO) criteria.
- 3.1.6. As supplementary information for data auditing, statistical results such as L_{10} and L_{90} shall also be obtained for reference.
- 3.2. Monitoring Equipment

Air Quality

- 3.2.1. 1-hour TSP levels and 24-hour TSP had been measured with direct reading dust meter and High Volume Samplers respectively. It has been demonstrated its capability in achieving comparable results with high volume sampling method as set out in the Title 40 of the Code of Federal Regulations, Chapter 1 (Part 50).
- 3.2.2. The 1-hour TSP meter was calibrated by the manufacturer prior to purchasing. Zero response of the instrument was checked before and after each monitoring event. Operation of the 1-hour TSP meter followed manufacturer's Operation and Service Manual. The 24-hour TSP meter was calibrated against firmware 80570-8100-V1.0.4, annually. Operation of the 24-hour TSP meter followed manufacturer's Operation and Service Manual. Valid calibration certificates of dust monitoring equipment are attached in Appendix H.
- 3.2.3. A summary of the equipment that was deployed for the 24- hour averaged monitoring is shown in Table 3.1. The TSP monitoring was conducted as per the schedule presented in Appendix G.

3.2.4. The equipment used for 1-hour TSP and 24-hour TSP measurement and calibration are summarised in Table 3.1

Monitoring Parameter	Monitoring Equipment	Serial Number	Date of Calibration
1 hour TCD	LD-5R Digital Dust Indicator	992821	19 Sep 2021
1-hour TSP	LD-5R Digital Dust Indicator	982820	3 Apr 2022
	TE-5170X High Volume	1084	30 Jul 2022 and 17
	Sampler		Aug 2022
24-hour TSP	TE-5170X High Volume	1050	30 Jul 2022 and 17
	Sampler		Aug 2022
	TE-5025A Calibration Kit	3465	28 Jun 2022

Table 3.1 Construction Dust Monitoring Equipment

Noise

- 3.2.5. Sound level meter in compliance with the International Electrotechnical Commission Publications 651: 1979 (Type 1) and 804: 1985 (Type 1) specifications has been used for carrying out the noise monitoring. The sound level meter has been checked using an acoustic calibrator. The wind speed and other metrological data has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.
- 3.2.6. Acoustic calibrators and sound level meters using for the monitoring is within the valid period and were calibrated per year. Valid calibration certificate of noise monitoring equipment is attached in Appendix I.
- 3.2.7. The details of equipment using for monitoring are listed in Table 3.2, as below:

Monitoring Equipment	Serial Number	Date of Calibration
Nti XL2 Sound Level Meter	A2A-13661-E0	23 Sep 2021
Lutron SL-4033SD Sound	I.491835	3 Jan 2022
Level Meter		
Rion NC-74 Sound Level	34504770	11 Feb 2022
Calibrator		

Table 3.2 Monitoring Equipment Used in Monitoring

3.3. Monitoring Methodology and QA/QC results

Air Quality

- 3.3.1. The 1-hour TSP monitor, portable dust meters (Sibata Digital Dust Indicator Model LD-5R) was used for the impact monitoring. The 1-hour TSP meters provides a real time 1-hour TSP measurement based on 90° light scattering. Three 1-hour TSP level were logged per every six days.
- 3.3.2. The 24-hour TSP monitor, High Volume Samplers (Tisch TE-5170X High Volume Air Sampler) were used for the impact monitoring. The 24-hour TSP monitoring consists of the following:

- ◆ The HVS was set at the monitoring location, with electricity supply connected and secured:
- ◆ HVS was calibrated before commencing the 1st measurement;
- ◆ The filter paper was weight and provided by HOKLAS lab (Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Ltd) before and after the sampling. Certificate of HOKLAS accredited laboratory can be referred to Appendix J;
- The airflow over time during sampling process was recorded by the HVS.

3.3.3. HVSs were free-standing with no obstruction. The following criteria were considered in the installation of the HVS:

- ◆ Appropriate support to secure the samples against gusty wind needed to be provided the monitoring station;
- ◆ A minimum of 2m separation from walls, parapets and penthouses was required for rooftop samplers;
- ◆ No furnace or incinerator flues was nearby;
- ◆ Airflow around the sampler was unrestricted; and
- Permission could be obtained to set up the samplers and gain access to the monitoring station.

3.3.4. Preparation of Filter Papers

- Glass fiber filters were labelled and sufficient filters that were clean and without pinholes were selected;
- ◆ All filters were equilibrated in the conditioning environment for 24 hours before weighing. The conditioning environment temperature was around 25°C and not varied by more than ±3°C; the relative humidity (RH)was 40%; and
- ◆ Acumen Laboratory and Testing Limited and ALS Technichem (HK) Pty Limited, as HOKLAS accredited laboratory, implemented comprehensive quality assurance and quality control programmes on the filters.

3.3.5. Field Monitoring

- The power supply was checked to ensure that the HVS was working properly;
- The filter holder and area surrounding the filter were cleaned:
- ◆ The filter holder was removed by loosening the foul bolts and a new filter, with stamped number upward, on a supporting screen was aligned carefully;
- ◆ The filter was properly aligned on the screen so that the gasket formed an airtight seal on the outer edges of the filter;
- ◆ The swing bolts were fastened to hold the filter holder down to the frame. The pressure applied should be sufficient to avoid air leakage at the edges;
- The shelter lid was closed and secured with an aluminum strip;
- ◆ The HVS was warmed- up for about 5 minutes to establish run- temperature conditions;
- ◆ A new flow rate record sheet was inserted into the flow recorder;
- ◆ The flow rates of the HVS was checked and adjusted to between 0.64-1.52m³min⁻¹, which was within the range specified in the EM&A Manual (i.e. 0.6-1.7m³min⁻¹);

- ◆ The programmable timer was set for a sampling period of 24 hours, and the starting time, weather condition and filter number were recorded;
- ◆ The initial elapsed time was recorded;
- ◆ At the end of sampling, the sampled filter was removed carefully and folded in half so that only surfaces with collected particulate matter were in contact;
- ◆ The filter paper was placed in a clean plastic envelope and sealed; all monitoring information was recorded on a standard data sheet and
- ◆ The filters were sent to (Acumen Laboratory and Testing Ltd and ALS Technichem (HK) Pty Ltd) for analysis.

3.3.6. Maintenance and Calibration

- ◆ The HVS and their accessories were maintained in a good working condition. For example, motor brushes were replaced routinely and electrical wiring was checked to ensure a continuous power supply; and
- ◆ The flow rate of each HVS with mass flow controller was calibrated using an orifice calibrator, Initial calibrations of the dust monitoring equipment were conducted upon installation and prior to commissioning. Five- point calibration was carried out for HVS using TE-5025 Calibration Kit. HVS is calibrated bimonthly. The calibration records for the HVS is given in Appendix H.

3.3.7. Wind Data Monitoring

◆ The wind speed has been recorded from Hong Kong Observatory- King's Park meteorological station, along with portable wind speed meter stand by as back up when the information are not available from HKO.

Noise

- 3.3.8. All noise measurements by the meter were set to FAST response and on the A-weighted equivalent continuous sound pressure level (L_{eq}) in decibels dB(A). $L_{Aeq(30min)}$ was used as the monitoring metric for the time period between 0700 -1900 hours on normal weekdays. The measured noise levels were logged every 5 minutes throughout the monitoring period.
- 3.3.9. Prior to the noise measurement, the accuracy of the sound level meter was checked using an acoustic calibrator generating a known sound pressure level at a known frequency. Checking was conducted before and after the monitoring. The calibration level before and after the noise measurement is agreed to within 1.0 dB(A).
- 3.3.10. Noise measurements should not be made in presence of fog, rain, wind with a steady speed exceeding 5 ms⁻¹ or wind with gusts exceeding 10 ms⁻¹. The wind speed was checked with a portable wind speed meter capable of measuring with speeds in ms⁻¹.

3.4. Monitoring Locations

Air Quality

3.4.1. During the site visit, both of the original proposed dust monitoring locations were rejected due to the condition at The Coronation was not favourable for monitoring and the access was declined by the management office of Hong Kong Community College (HKCC) of PolyU. Two alternative air monitoring stations Yau Ma Tei Catholic Primary School (Hoi Wang Road) and Man Cheong Building had been proposed by ET and approved by IEC. 2 designated air monitoring locations were identified and agreed with IEC and EPD. Details of air monitoring stations are described in Table 3.3. The location plan of air quality monitoring stations is shown in Appendix K.

Table 3.3 Location of the Dust Monitoring Stations

Air Quality Monitoring Station	Dust Monitoring Station
W-A1	Yau Ma Tei Catholic Primary School (Hoi Wang Road)
W-A6	Man Cheong Building

Noise

3.4.2. During the site visit, one of the original proposed noise monitoring locations Tak Cheong Building was rejected by the president of the owner's corporation. Alternative noise monitoring station Hydan place had been proposed by ET and approved by IEC. 4 noise sensitive receivers designated noise monitoring locations were identified and agreed with IEC and EPD. The designated monitoring stations are identified and access was granted by the premises. The details of noise monitoring stations are described in Table 3.4 and the location plan of noise monitoring station is shown in Appendix K.

Table 3.4 Noise Monitoring Stations

Noise Monitoring Station	Identified Noise Monitoring Station	Type of Measurement
W-N1A	Yau Ma Tei Catholic Primary School (Hoi Wang Road)	Façade
W-N18	Hydan Place	Façade
W-N25A	Prosperous Garden Block 1	Façade
W-P11	The Coronation Tower 1	Façade

- 3.5. Monitoring date, time, frequency and duration
- 3.5.1. A summary of impact monitoring duration, sampling parameter and frequency is presented in Table 3.5.

Impact Duration **Sampling Parameter Frequency Monitoring** 1-hour continuous 1-hour TSP Dust 3 times per six days measurement 24-hour continuous Dust 24-hour TSP Once per six days sampling 30-minute continuous $L_{eq 30 min}$, Noise Once per week (0700 – 1900) measurement L₁₀ and L₉₀ as reference.

Table 3.5 Summary of Impact Monitoring Programme

3.6. Result Summary

Air Quality

3.6.1. According to our field observations, the major dust source identified at the designated air quality monitoring stations in the reporting month are summarised in Table 3.6.

Table 3.6 Observation at Dust Monitoring Stations

Monitoring Station	Major Dust Source
W-A1	Nearby traffic
W-A6	Nearby traffic

- 3.6.2. Air quality impact monitoring for the reporting month was carried out on 1, 6, 12, 18, 24 and 30 August 2022.
- 3.6.3. The results for 1-hour TSP and 24-hour TSP are summarized in Table 3.7 and Table 3.8. The measurement data and details of influencing factors such as weather conditions and site observation are presented in Appendix L.

Table 3.7 Summary of 1-hour TSP Monitoring Results

Monitoring Location	Range(µg/m³)	Action Level(µg/m3)	Limit Level(µg/m3)
W-A1	37-69	319	500
W-A6	49-78	306	500

Table 3.8 Summary of 24-hour TSP Monitoring Results

Monitoring Location	Range(μg/m³)	Action Level(μg/m3)	Limit Level(µg/m3)
W-A1	13-70	167	260
W-A6	17-62	166	260

Noise

3.6.4. According to our field observations, the major noise source identified at the designated noise monitoring station in the reporting month are summarised in Table 3.9:

Monitoring Station	Major Noise Source
W-N1A	Nearby traffic
W-N18	Nearby traffic
W-N25A	Nearby traffic
W-P11	Nearby traffic

Table 3.9 Observation at Noise Monitoring Stations

- 3.6.1. The construction noise impact monitoring for the reporting month was carried out on 1, 6, 12, 18, 24 and 30 August 2022.
- 3.6.2. The result for noise monitoring is summarized in Table 3.10. The measurement data are shown in Appendix M.

Table 3.10 Summary of Noise Monitoring Results

Time	Monitoring	Parameter	Range, dB(A)			Range, dB(A)				
Period	Period location		$\mathbf{L}_{ ext{eq}}$	L_{10}	L ₉₀	Action Level	Limit Level#			
	W-N1A		58.3-61.8	60.6-64.5	56.2-59.0		70dB(A) or 65 dB(A) during examination			
	W-N18	Leq	70.0-72.3	72.4-74.7	66.9-68.3	When one documented				
hour from 0700-1900	W-N25A	30min	67.2-69.4	69.1-71.9	63.6-66.8	complaint is received	75dB(A)#			
	W-P11		64.8-68.2	66.4-69.2	62.7-66.8					

Remarks:

1. # If works are to be carried out during restricted hours, the conditions stipulated in the construction noise permit by the Noise Control Authority have to be followed.

Waste management

3.6.3. The waste generated from this Project includes inert C&D materials, and non-inert C&D materials. Non-inert C&D materials are made up of general refuse, vegetative wastes and recyclable wastes such as plastics and paper/cardboard packaging waste. Steel materials generated from the project are also grouped into non-inert C&D materials as the materials were not disposed of with other inert C&D materials. With reference to relevant handling records and trip tickets of this Project, the quantities of different types of waste generated in the reporting month are summarised in Table 3.11. Details of cumulative waste management data are presented as a waste flow table in Appendix N.

Table 3.11 Quantities of waste generated from the Project

		- -	Quantity				
			Non-inert C&D Materials				
		Others, e.g.	Recycled materials				
Reporting period	Inert C&D Materials (in 'tonnes)	Chemical Waste (in'000 Kg)	General Refuse disposed at Landfill (in 'tonnes)	Paper/card board (in '000 Kg)	Plastics (in '000 Kg)	Metals (in '000 Kg)	
August-2022	12990.60	0.00	113.10	0.20	0.01	0.00	

4. SUMMARY OF COMPLAINTS, NOTIFICATION OF SUMMONS AND PROSECUTIONS

4.1. The Environmental Complaint Handling Procedure is shown in below Table 4.1:

Table 4.1 Environmental Complaint Handling Procedure

					
Complaint Received via Project Hotline		Complaint Received via	a 1823 or from other		
		government departments			
		government departments			
Contractor notify ER, ET	and IEC	ER notify Contractor, ET	and IEC		
Contractor log complaint	t and date of receipt onto	the complaint database. Co	ontractor ER and ET to		
Contractor log complaint	-	-	sittuetoi, Ert una Er to		
	conduct investig	ation of complaint			
If complaint is considered	l not valid	If complaint is found valid	d		
		•			
ET or ER to reply the com	onlainant if necessary	Contractor to identify a	nd implement remedial		
ET of ER to Tepty the con	iipiaiiiaiit ii necessary	Contractor to identify and implement remedial			
		measures in consultation	with the IEC, E1 and		
		ER.			
		The ER, ET and IEC to	review the effectiveness		
		of the Contractor's reme			
		updated situation; ET t			
		monitoring and audit to verify the situation if			
		necessary, and oversee that circumstances leading			
		to the complaint do not recur. ER to conduct			
		further inspection as necessary.			
		Tartiler hispection as nece	Sour J.		
_	•	tractor to prepare interim re	-		
complaint investigation a	and follow-up actions sti	pulated above, including the	e details of the remedial		
measures and additional monitoring identified or already taken, for submission to EPD within the			sion to EPD within the		
	time frame assigned by the EPD				
	time traine assi	Igned by the Li D			

The ET to record the details of the complaint, results of the investigation, subsequent actions taken to address the complaint and updated situation including the effectiveness of the remedial measures, supported by regular and additional monitoring results in the monthly EM&A reports

- 4.2. Should non-compliance of the criteria occur, action in accordance with the Event and Action Plan in Appendix D and Appendix E shall be carried out.
- 4.3. One Action Level of construction noise was triggered during the reporting period as a documented complaint was received on 12 August 2022 related to construction noise from works areas at Zone B2 and C. No exceedance of the Limit Level of construction noise was recorded in the reporting month. No exceedance of the Action and Limit Levels of 24-hour TSP and 1-hour TSP was recorded during the reporting month.
- 4.4. One dust related complaint was received on 4 August 2022, one water seepage related complaint, and one noise related complaint were received on 12 August 2022. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim report for the complaint is shown in Appendix Q.
- 4.5. No non-compliance was reported in the reporting month.
- 4.6. No notification of summons and prosecution was received in the reporting period.
- 4.7. Statistics on complaints, notifications of summons and successful prosecutions are summarized in Appendix O.

5. EM&A SITE INSPECTION

- 5.1. Site inspections were carried out on a weekly basis to monitor the implementation of proper environmental pollution control and mitigation measures under the Contract. In the reporting period, four (4) site inspections were carried out on 4, 11, 18 and 26 August 2022, along with bi-weekly inspection of the implementation of landscape and visual mitigation measures conducted on 4 and 18 August 2022.
- 5.2. One joint site inspection with IEC also undertaken on 26 August 2022. Minor deficiencies were observed during weekly site inspection. Key observations during the site inspections are summarized in Table 5.1.

Date	Environmental Observations	Follow-up Status
4 August 2022	1. The cement bags at Zone B3 should be covered with impervious sheeting at 3 sides.	1. The cement bags at Zone B3 had been covered with impervious sheeting.
11 August 2022	The NRMM label of generator at Zone D are not in good condition.	1. The NRMM label of generator at Zone D had been replaced by new one.
18 August 2022	1. The cement bags at Zone G should be covered with impervious sheeting at 3 sides.	1. The cement bags at Zone G had been covered with impervious sheeting.
26 August 2022	 The NRMM label of excavator at Zone D3 was missing. The stockpile at Zone A should be covered with impervious sheeting at 3 sides. 	 The excavator at Zone D3 had been removed from the site. The stockpile at Zone A had been removed.

Table 5.1 Site Observations

- 5.3. The Contractor had rectified all observation identified during environmental site inspection in the reporting period.
- 5.4. According to the EIA Study Report, Environmental Permit, contract documents and EM&A Manual, the mitigation measures detailed in the documents are implemented as much as practical during the reporting period. An updated Implementation Status of Environmental Mitigation Measures (EMIS) is provided in Appendix F.

6. FUTURE KEY ISSUES


- 6.1. The construction activities provided by Main Contractor in the next reporting month are:
 - Excavation and construction of bottom slab at Zone A
 - Installation of Underground Utilities Hanger Support, exposure of box culvert and plugging of abandoned pipe at Zone B
 - Installation of recharge well, observation well, pumping well and carry out pumping test at Zone B & Zone D
 - TAM grouting between Zones B2 & C1, install recharge well/observation well/pumping well at Zones C1, C2 & C3
 - Construction of remaining buttress wall, installation of king posts, recharge well/observation well/pumping well and erection of temporary traffic deck at Zone D
 - Pre-boring works and D-wall construction at Zone B3
 - Complete reinstatement of partial demolition works of Cable Tunnel A, Pre-boring works and commence D-wall construction at Zone F
 - Pre-drilling works, Pipe piling works, Underground Utilities diversion work and ground improvement (TAM Grouting) works at Zone G
 - Works for reprovisioning of Gascogine Road Flyover at HKAA area: Temporary footing and falsework erection for P7 end span construction
 - Bridge Works:
 - i. FT1- complete bridge deck construction for P4L and relocate FT1 to pier P3
 - ii. FT2- complete bridge deck construction for P6L and relocate FT2 to P2
 - iii. Portal and End-span Deck Construction for P1
 - iv. Pier Head Segment including Cross Beam construction for P2
 - Continue socketed H-pile works for middle/east foundation and west side of Noise Enclosure in Zone 3, Excavation and Lateral Support and construction works for pile caps and ground beams construction for middle/east foundation for Zone 3 Noise Enclosure
 - Erection of Y columns and side columns for Noise Enclosure in Zone 3 (night works)
 - Works at Zone 2 Noise Enclosure scheduled as the following:
 - i. Column E Excavation and Lateral Support works and pile cap construction
 - ii. Column G Permanent diversion of uncharted 1200mm dia. drainage pipe
 - iii. Columns C, A1 and D- Temporary socketted H-pile works
 - iv. Column A Proof coring of Barrette Walls and Excavation and Lateral Support works for pile cap construction
 - Noise Enclosure steelworks fabrication at Fabrication Yard in Zhuhai, China
 - Erection of Y columns and side columns for Noise Enclosure in Zone 3
 - Monitoring of instrumentation for all areas
- 6.2. Potential environmental impacts arising from the above construction activities are mainly associated with dust, construction noise and waste management.

- 6.3. The tentative schedule of regular construction noise monitoring, 1-hour TSP and 24-hour TSP monitoring in the next reporting period is presented in Appendix P.
- 6.4. The construction programme for the Project for the next reporting month is presented in Appendix B.

7. CONCLUSION AND RECOMMENDATIONS

- 7.1. This 53rd monthly EM&A Report presents the EM&A works undertaken during the period from 1 August 2022 to 31 August 2022 in accordance with the EM&A Manual and the requirement under EP- 457/2013/D and FEP-03/457/2013/D.
- 7.2. Air quality (including 1-hour TSP and 24-hour TSP) were carried out in the reporting period. No exceedance of the Action Level and Limit Level was recorded for air quality impact monitoring during the reporting month.
- 7.3. Weekly environmental site inspections were conducted during the reporting period. Joint site inspection with IEC were carried out on 26 August 2022. Minor deficiency was observed during site inspection and was rectified within the specified deadlines. The environmental performance of the Project was therefore considered satisfactory.
- 7.4. One Action Level of construction noise was triggered during the reporting period as a documented complaint was received on 12 August 2022 related to construction noise from works areas at Zone B2 and C. No exceedance of the Limit Level of construction noise was recorded in the reporting month.
- 7.5. One dust related complaint was received on 4 August 2022, one water seepage related complaint, and one noise related complaint were received on 12 August 2022. After investigation with Contractor, precautionary measures had been proposed to the Contractor by ET. The interim report for the complaint is shown in Appendix Q.
- 7.6. No non-compliance was reported in the reporting month.
- 7.7. No notification of summons or prosecution was received in the reporting month.
- 7.8. The ET will keep track on the construction works to confirm compliance of environmental requirements and the proper implementation of all necessary mitigation measures.

Environmental Monitoring & Auditing
Zirvitoimivitai vitoimioting of t thanking
Annandix A
Appendix A
Alignment and Works Area For the Contract No.
HY/2014/08

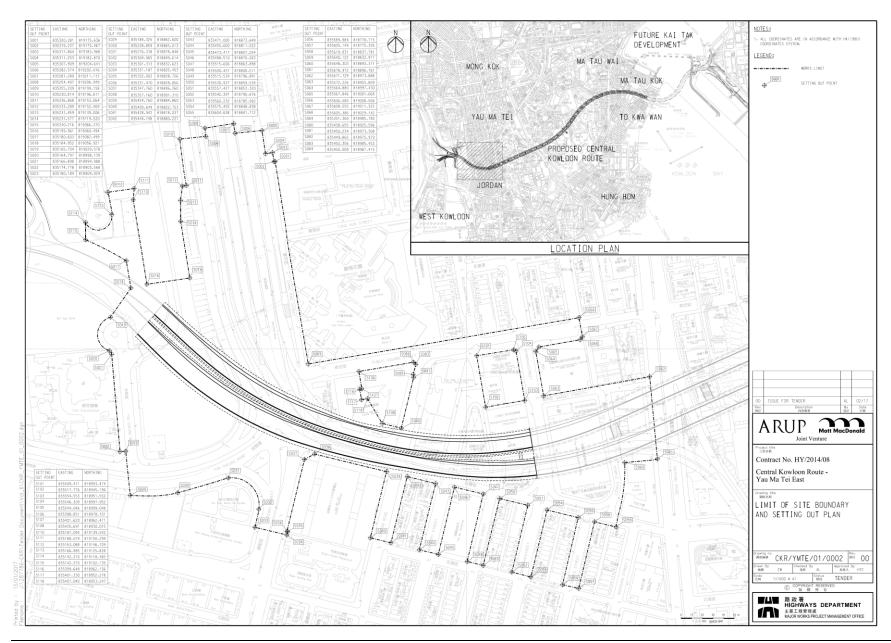





Appendix B Construction Programme

	Construction Programme				
	Activity Name	Durati	on Start	Finish	2022 2023 2024 2025 2026 ASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJITASONOJEMAMJITASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJEMAMJIJASONOJE
	HY/2014/08 Central Kowloom Route - Yau Ma Tei East	3099	8-Jan-18	3-Jul-26	
Section	Construction Works	3062	17-Jan-18	5-Jun-26	
	Pemporary Traffie Management in Underground (Position 11 & 12)	1797	29-Sep-19	29-Aug-24	<u> </u>
Section 3	Works on Northern & Southern Parts of YMT Multi-Storey On Park Building	700	1-Sep-21	1-Aug-23	<u> </u>
Section 4	All Worlds within TMTSC, Maintenance, Depot Area, Poblic Square St/Konsu St Rest Gorden, Access Road	2586	17-Jan-18	14-Feb-25	<u> </u>
Section 5	Pressuration and Protection of Bristing Trees	2697	17-Jan-18	5-Jun-25	<u> </u>
Section 6	Beteldfelment Worlay	365	6-Jun-25	5-Jun-26	<u> </u>
Section 7	All Worls: in Underground	1213	14-Feb-22	10-Jun-25	<u> </u>
Section 7A and 7B	Campletian of Roise Buelosus	1620	26-Aug-20	31-Jan-25	<u> </u>
Scotlen 9	All Remaining Worlds not Covered in Other Section	2557	6-Jun-18	5-Jun-25	<u> </u>
Stage A	Construction of C&C Tunnel Boxbound	2414	17-Jan-18	26-Aug-24	<u> </u>
Stago B	Construction of C&C Tunnel Westbound	2654	17-Jan-18	23-Apr-25	<u> </u>
Stage C	CAC Tunnel Works within Portion 13 & 20A, Cul-dr-sec at Portion 20B & 24	1729	7-Apr-18	30-Dec-22	
Stage E	Demolition of Southern Pari of Bx. YMT Multi-Storey Car Park Building	133	27-Jan-23	8-Jun-23	
Stage F	GRP Requivisioning	1770	16-Dec-19	19-Oct-24	
Stage H	Completion of Displicagen Wells and Roof Slabs of GAC Trumsk within Portion 21 and 28	1.	6-Jan-23	6-Jan-23	

Contract No. HY/2014/08 Environmental Monitoring & Auditing	
A	
Appendix C Project Organization Chart	
Troject Organization Chart	

Project O-Chart

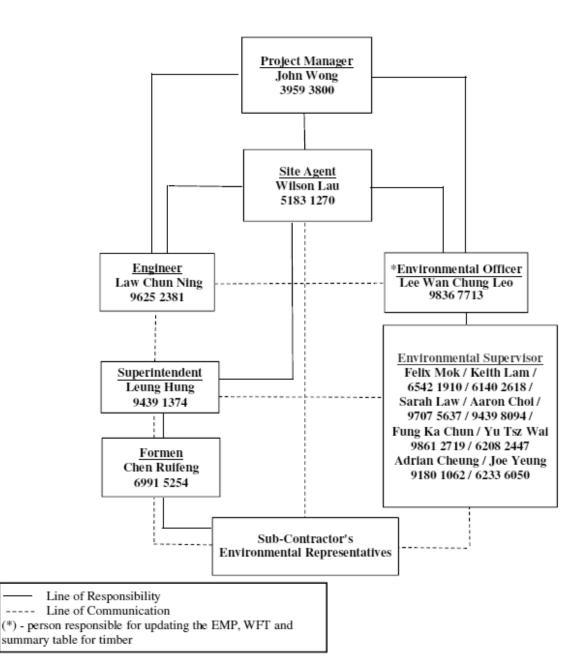

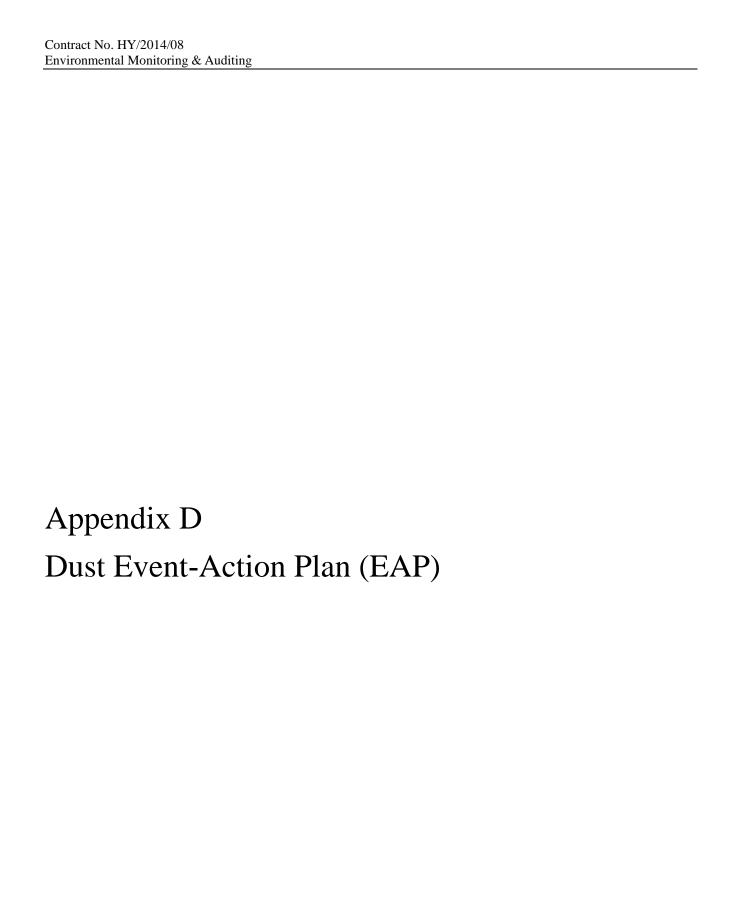

EVENT	ACTION			
EVENI	ET	IEC	ER	CONTRACTOR
ACTION LEV	EL			
1.Exceedance for one sample	 Identify source, investigate the causes of exceedance and propose remedial measures; Inform IEC and ER; Repeat measurement to confirm finding; Increase monitoring frequency to daily. 	 Check monitoring data submitted by ET; Check Contractor's working method. 	1. Notify Contractor.	Rectify any unacceptable practice; Amend working methods if appropriate.
2.Exceedance for two or more consecutive samples	 Identify source; Inform IEC and ER; Advise the ER on the effectiveness of the proposed remedial measures; Repeat measurements to confirm findings; Increase monitoring frequency to daily; Discuss with IEC and Contractor on remedial actions required; If exceedance continues, arrange meeting with IEC and ER; If exceedance stops, cease additional monitoring. 	 Check monitoring data submitted by ET; Check Contractor's working method; Discuss with ET and Contractor on possible remedial measures; Advise the ET on the effectiveness of the proposed remedial measures; Supervise Implementation of remedial measures. 	Confirm receipt of notification of failure in writing; Notify Contractor; Ensure remedial measures properly implemented.	 Submit proposals for remedial to ER within 3 working days of notification; Implement the agreed proposals; Amend proposal if appropriate.
LIMIT LEVEL				
1.Exceedance for one sample	Identify source, investigate the causes of exceedance and propose remedial measures; Inform ER, Contractor and	 Check monitoring data submitted by ET; Check Contractor's working method; 	Confirm receipt of notification of failure in writing; Notify Contractor;	Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC


EVENT	ACTION			
EVENI	ET	IEC	ER	CONTRACTOR
	 EPD; 3. Repeat measurement to confirm finding; 4. Increase monitoring frequency to daily; 5. Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results. 	 3. Discuss with ET and Contractor on possible remedial measures; 4. Advise the ER on the effectiveness of the proposed remedial measures; 5. Supervise implementation of remedial measures. 	3. Ensure remedial measures properly implemented.	within 3 working days of notification; Implement the agreed proposals; 4. Amend proposal if appropriate.
2.Exceedance for two or more consecutive samples	 Notify IEC, ER, Contractor and EPD; Identify source; Repeat measurement to confirm findings; Increase monitoring frequency to daily; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Arrange meeting with IEC and ER to discuss the remedial actions to be taken; Assess effectiveness of Contractor's remedial actions and keep IEC, EPD and ER informed of the results; If exceedance stops, cease additional monitoring. 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractor's remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; In consultation with the IEC, agree with the Contractor on the remedial measures to be implemented; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is abated. 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.

Note:

ET – Environmental Team

ER – Engineer's Representative

IEC – Independent Environmental Checker

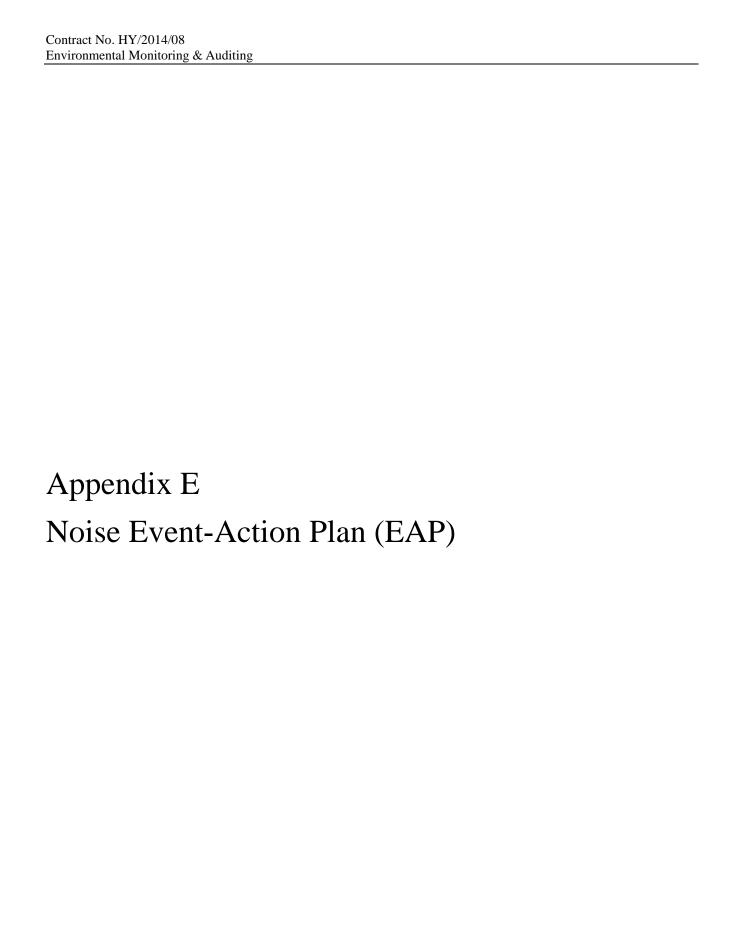

EVENT		ACTIO)N	
	ET	IEC	ER	CONTRACTOR
Action Level	 Identify source, investigate the causes of exceedance and propose remedial measures; Notify IEC and Contractor; Report the results of investigation to the IEC, ER and Contractor; Discuss with the Contractor and formulate remedial measures; Increase monitoring frequency to check mitigation effectiveness. 	 Review the analysed results submitted by the ET; Review the proposed remedial measures by the Contractor and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures are properly implemented 	Submit noise mitigation proposals to IEC; Implement noise mitigation proposals.
Limit	 Identify source; Inform IEC, ER, EPD and Contractor; Repeat measurements to confirm findings; Increase monitoring frequency; Carry out analysis of Contractor's working procedures to determine possible mitigation to be implemented; Inform IEC, ER and EPD the causes and actions taken for the exceedances; Assess effectiveness of Contractor's remedial actions 	 Discuss amongst ER, ET, and Contractor on the potential remedial actions; Review Contractors remedial actions whenever necessary to assure their effectiveness and advise the ER accordingly; Supervise the implementation of remedial measures. 	 Confirm receipt of notification of failure in writing; Notify Contractor; Require Contractor to propose remedial measures for the analysed noise problem; Ensure remedial measures properly implemented; If exceedance continues, consider what portion of the work is responsible and instruct the Contractor to stop that portion of work until the exceedance is 	 Take immediate action to avoid further exceedance; Submit proposals for remedial actions to IEC within 3 working days of notification; Implement the agreed proposals; Resubmit proposals if problem still not under control; Stop the relevant portion of works as determined by the ER until the exceedance is abated.

EVENT	ACTION								
	ET	IEC	ER	CONTRACTOR					
	and keep IEC, EPD and ER informed of the results;		abated.						
	8. If exceedance stops, cease additional monitoring.								

Note:

ET – Environmental Team

IEC – Independent Environmental Checker

ER – Engineer's Representative



Appendix F
Environmental Mitigation Implementation
Schedule (EMIS)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			Constru	ction Dust Impact				
S4.3.10	D1	The contractor shall follow the procedures and requirements given in the Air Pollution Control (Construction Dust) Regulation	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	Implemented, deficiency rectified after observation
\$4.3.10	D2	 Mitigation measures in form of regular watering under a good site practice should be adopted. Watering once per hour on exposed worksites and haul road should be conducted to achieve dust removal efficiencies of 91.7%. While the above watering frequencies are to be followed, the extent of watering may vary depending on actual site conditions but should be sufficient to maintain an equivalent intensity of no less than 1.3 L/m² to achieve the dust removal efficiency. 	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	• Implemented
S4.3.10	D3	 Proper watering at exposed spoil should be undertaken throughout the construction phase; Any excavated or stockpile of dusty material should be covered entirely by impervious sheeting or sprayed with water to maintain the entire surface wet and then removed or backfilled or reinstated where practicable within 24 hours of the excavation or unloading; Any dusty materials remaining after a stockpile is removed should be wetted with water and cleared from the surface of roads; A stockpile of dusty material should not be 	Minimize dust impact at the nearby sensitive receivers	Contractor	All construction sites	Construction stage	APCO To control the dust impact To meet HKAQO and TM-EIA criteria	Implemented, deficiency rectified after observation

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		extended beyond the pedestrian barriers, fencing or traffic cones; The load of dusty materials on a vehicle leaving a construction site should be covered entirely by impervious sheeting to ensure that the dusty materials do not leak from the vehicle. Where practicable, vehicle washing facilities with high pressure water jet should be provided at every discernible or designated vehicle exit point. The area where vehicle washing takes place and the road section between the washing facilities and the exit point should be paved with concrete, bituminous materials or hardcores; When there are open excavation and reinstatement works, hoarding of not less than 2.4m high should be provided and properly maintained as far as practicable along the site boundary with provision for public crossing. Good site practice shall also be adopted by the Contractor to ensure the conditions of the hoardings are properly maintained throughout the construction period; The portion of any road leading only to construction site that is within 30m of a vehicle entrance or exit should be kept clear of dusty materials; Surfaces where any pneumatic or power-driven drilling, cutting, polishing or other mechanical breaking operation takes place should be sprayed with water or a dust suppression chemical						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S4.3.10	D6	 continuously; Any area that involves demolition activities should be sprayed with water or a dust suppression chemical immediately prior to, during and immediately after the activities so as to maintain the entire surface wet; Any skip hoist for material transport should be totally enclosed by impervious sheeting; Every stock of more than 20 bags of cement or dry-pulverised fuel ash (PFA) should be covered entirely by impervious sheeting or placed in an area sheltered on the top and the 3 sides; Loading, unloading, transfer, handling or storage of bulk cement or dry PFA should be carried out in a totally enclosed system or facility, and any vent or exhaust should be fitted with an effective fabric filter or equivalent air pollution control system Exposed earth should be properly treated by compaction, turfing, hydroseeding, vegetation planting or sealing with latex, vinyl, bitumen, shotcrete or other suitable surface stabilizer within six months after the last construction activity on the construction site or part of the construction site where the exposed earth lies. Implement regular dust monitoring under EM&A programme during the construction stage. 	Monitoring of dust impact	Contractor	Selected rep. dust monitoring	Construction stage	• TM-EIA	• Implemented
			Constant	tion Noise (Airborn	station			

Acuity Sustainability Consulting Ltd.

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S5.4.1	N1	 Implement the following good site practices: Only well-maintained plant should be operated onsite and plant should be serviced regularly during the construction programme; Machines and plant (such as trucks, cranes) that may be in intermittent use should be shut down between work periods or should be throttled down to a minimum; Plant known to emit noise strongly in one direction, where possible, be orientated so that the noise is directed away from nearby NSRs; Silencers or mufflers on construction equipment should be properly fitted and maintained during the construction works; Mobile plant should be sited as far away from NSRs as possible and practicable; Material stockpiles, mobile container site office and other structures should be effectively utilized, where practicable, to screen noise from on-site construction activities. 	Control construction airborne noise	Contractor	All construction sites	Construction stage	• Annex 5, TM-EIAO	• Implemented
S5.4.1	N2	Install temporary hoarding located on the site boundaries between noisy construction activities and NSRs. The conditions of hoardings shall be properly maintained throughout the construction period.	Reduce the construction noise levels at low-level zone of NSRs through partial screening	Contractor	All construction sites	Construction stage	Annex 5, TM- EIAO	Implemented
S5.4.1	N3	Install movable noise barriers (typical design is wooden framed barrier with a small-cantilevered on a skid footing with 25mm thick internal sound absorptive lining), acoustic mat or full enclosure,	Sreen the noisy plant items to be used at all construction	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM- EIAO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		screen the noisy plants including air compressors, generators and handheld breakers, etc.	sites					
S5.4.1	N4	Use 'Quiet plant'	Reduce the noise levels of plant items	Contractor	All construction sites where practicable	Construction stage	Annex 5, TM- EIAO	Implemented
S5.4.1	N5	Loading/ unloading activities should be carried out inside the full enclosure of mucking out points.	Reduce the noise levels of loading/ unloading activities	Contractor	Mucking out locations	Construction stage	• Annex 5, TM- EIAO	Implemented
S5.4.1	N6	Sequencing operation of construction plants where practicable.	Operate sequentially within the same work site to reduce the construction airborne noise	Contractor	All construction sites where practicable	Construction stage	• Annex 5, TM- EIAO	Implemented
\$5.4.1	N7	Implement a noise monitoring programme under EM&A programme.	Monitor the construction noise levels at the selected representative locations	Contractor	Selected rep. noise monitoring station	Construction stage	• TM-EIAO	Implemented

Water Quality (Construction Phase)

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.1	W1	In accordance with the Practice Note for Professional Persons on Construction Site Drainage, Environmental Protection Department, 1994 (ProPECC PN1/94), construction phase mitigation measures shall include the following: Construction Runoff • At the start of site establishment, perimeter cut-off drains to direct off-site water around the site should be constructed with internal drainage works and erosion and sedimentation control facilities implemented. Channels (both temporary and permanent drainage pipes and culverts), earth bunds or sand bag barriers should be provided on site to direct stormwater to silt removal facilities. The design of the temporary on-site drainage system will be undertaken by the contractor prior to the commencement of construction; • The dikes or embankments for flood protection should be implemented around the boundaries of earthwork areas. Temporary ditches should be provided to facilitate the runoff discharge into an appropriate watercourse, through a silt/ sediment trap. The sediment/ silt traps should be incorporated in the permanent drainage channels to enhance deposition rates; • The design of efficient silt removal facilities should be based on the guidelines in Appendix A1 of ProPECC PN 1/94, which states that the retention time for silt/ sand traps should be 5 minutes under	To minimize water quality impact from the construction site runoff and general construction activities	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-EIAO TM-DSS	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		maximum flow conditions. Sizes may vary depending upon the flow rate, but for a flow rate of 0.1 m3/s a sedimentation basin of 30 m3 would be required and for a flow rate of 0.5 m3/s the basin would be 150 m3. The detailed design of the sand/silt traps shall be undertaken by the contractor prior to the commencement of construction; • All exposed earth areas should be completed and vegetated as soon as possible after earthworks have been completed, or alternatively, within 14 days of the cessation of earthworks where practicable. Exposed slope surfaces should be covered by tarpaulin or other means; • The overall slope of the site should be kept to a minimum to reduce the erosive potential of surface water flows, and all traffic areas and access roads protected by coarse stone ballast. An additional advantage accruing from the use of crushed stone is the positive traction gained during prolonged periods of inclement weather and the reduction of surface sheet flows; • All drainage facilities and erosion and sediment control structures should be regularly inspected and maintained to ensure proper and efficient operation at all times and particularly following rainstorms. Deposited silt and grit should be removed regularly and disposed of by spreading evenly over stable, vegetated areas; • Measures should be taken to minimize the ingress of site drainage into excavations. If the excavation						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		of trenches in wet periods is necessary, they should be dug and backfilled in short sections wherever practicable. Water pumped out from trenches or foundation excavations should be discharged into storm drains via silt removal facilities; Open stockpiles of construction materials (for example, aggregates, sand and fill material) of more than 50m3 should be covered with tarpaulin or similar fabric during rainstorms. Measures should be taken to prevent the washing away of construction materials, soil, silt or debris into any drainage system; Manholes should always be adequately covered and temporarily sealed so as to prevent silt, construction materials or debris being washed into the drainage system and storm runoff being directed into foul sewers; Precautions be taken at any time of year when rainstorms are likely, actions to be taken when a rainstorm is imminent or forecasted, and actions to be taken during or after rainstorms are summarized in Appendix A2 of ProPECC PN 1/94. Particular attention should be paid to the control of silty surface runoff during storm events, especially for areas located near steep slopes; All vehicles and plant should be cleaned before leaving a construction site to ensure no earth, mud, debris and the like is deposited by them on roads. An adequately designed and site wheel washing facilities should be provided at every construction						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		site exit where practicable. Wash-water should have sand and silt settled out and removed at least on a weekly basis to ensure the continued efficiency of the process. The section of access road leading to, and exiting from, the wheel wash bay to the public road should be paved with sufficient backfall toward the wheel wash bay to prevent vehicle tracking of soil and silty water to public roads and drains; Oil interceptors should be provided in the drainage system downstream of any oil/ fuel pollution sources. The oil interceptors should be emptied and cleaned regularly to prevent the release of oil and grease into the storm water drainage system after accidental spillage. A bypass should be provided for the oil interceptors to prevent flushing during heavy rain; Construction solid waste, debris and rubbish on site should be collected, handled and disposed of properly to avoid water quality impacts; All fuel tanks and storage areas should be provided with locks and sited on sealed areas, within bunds of a capacity equal to 110% of the storage capacity of the largest tank to prevent spilled fuel oils from reaching water sensitive receivers nearby; Adopt best management practices; All earth works should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable.						

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$6.9.1.2	W2	 Tunneling Works and Underground Works Cut-&-cover tunneling work should be conducted sequentially to limit the amount of construction runoff generated from exposed areas during the wet season (April to September) as far as practicable. Uncontaminated discharge should pass through sedimentation tanks prior to off-site discharge; The wastewater with a high concentration of SS should be treated (e.g. by sedimentation tanks with sufficient retention time) before discharge. Oil interceptors would also be required to remove the oil, lubricants and grease from the wastewater; Direct discharge of the bentonite slurry (as a result of D-wall) is not allowed. It should be reconditioned and reused wherever practicable. Temporary storage locations (typically a properly closed warehouse) should be provided on site for any unused bentonite that needs to be transported away after all the related construction activities area completed. The requirements in ProPECC PN 1/94 should be adhered to in the handling and disposal of bentonite slurries. 	To minimize construction water quality impact from tunneling works	Contractor	All tunneling portion	Construction stage	Water Pollution Control Ordinance ProPECC PN 1/94 TM-DSS TM-EIAO	• Implemented
S6.9.1.3	W3	Portable chemical toilets and sewage holding tanks are recommended for handling the construction sewage generated by the workforce. A licensed contractor should be employed to provide	To minimize water quality from sewage effluent	Contractor	All construction sites where practicable	Construction stage	Water Pollution Control Ordinance TM-DSS	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		appropriate and adequate portable toilets and be responsible for appropriate disposal and maintenance.						
S6.9.1.5	W4	 No direct discharge of groundwater from contaminated areas should be adopted. A discharge license under the WPCO through the Regional Office of EPD for groundwater discharge should be applied. Prior to the excavation works within these potentially contaminated areas, the groundwater quality should be reviewed during the process of discharge license application. The compliance to the Technical Memorandum on Standards for Effluents Discharged into Drainage on Sewerage Systems, Inland and Coastal Waters (TM-DSS) and the existence of prohibited substance should be confirmed. If the review results indicated that the groundwater to be generated from the excavation works would be contaminated, the contaminated groundwater should be either properly treated in compliance with the requirements of the TM-DSS or properly recharged into the ground. If wastewater treatment is deployed, the wastewater treatment unit shall deploy suitable treatment process (e.g. oil interceptor / activated carbon) to reduce the pollution level to an 	To minimize groundwater quality impact from contaminated area	Contractor	Excavation areas where contamination is found	Construction stage	Water Pollution Control Ordinance TM-DSS TM-EIAO	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		acceptable standard and remove any prohibited substances (e.g. TPH) to undetectable range. All treated effluent from wastewater treatment plant shall meet the requirements as stated in TM-DSS and should be discharged into the foul sewers. • If groundwater recharging wells are deployed, recharging wells should be installed as appropriate for recharging the contaminated groundwater back into the ground. The recharging wells should be selected at places where the groundwater quality will not be affected by the recharge operation as indicated in the Section 2.3 of TM-DSS. The baseline groundwater quality shall be determined prior to the selection of the recharge wells, and submit a working plan (including the laboratory analytical results showing the quality of groundwater at the proposed recharge location(s) as well as the pollutant levels of groundwater to be recharged) to EPD for agreement. Pollution levels of groundwater to be recharged shall not be higher than pollutant levels of ambient groundwater at the recharge well. Prior to recharge, any prohibited substances such as TPH products should be removed as necessary by installing the petrol interceptor.						
\$6.9.1.6	W6	Accidental Spillage In order to prevent accidental spillage of chemicals, the following is recommended:	To minimize water quality impact from accidental	Contractor	All construction site where practicable	Construction stage	Water Pollution Control Ordinance	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 All the tanks, containers, storage area should be bunded and the locations should be locked as far as possible from the sensitive watercourse and stormwater drains; The Contractor should register as a chemical waste producer if chemical wastes would be generated. Storage of chemical waste arising from the construction activities should be stored with suitable labels and warnings. Disposal of chemical wastes should be conducted in compliance with the requirements as stated in the Waste Disposal (Chemical Waste) (General) Regulation. 	spillage				 ProPECC PN 1/94 TM-EIAO TM-DSS 	
			Waste Manage	ement (Construction	Waste)			
\$7.4.1	WM1	Geological assessment should be carried out by competent persons on site during excavation to identify materials which are not suitable to use as aggregate in structural concrete (e.g. volcanic rock, Aplite dyke rock, etc.). Volcanic rock and Aplite dyke rock should be separated at the source sites as far as practicable and stored at designated stockpile area preventing them from delivering to crushing facilities. The crushing plant operator should also be reminded to set up measures to prevent unsuitable rock from ending up at concrete	Separation of unsuitable rock from ending up at concrete batching plants and be turned into concrete for structural use	Contractor	All construction sites	Construction stage	• DEVB (W) No. 6/2010	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM2	batching plants and be turned into concrete for structural use. Details regarding control measures at source site and crushing facilities should be submitted by the Contractor for the Engineer to review and agree. In addition, site records should also be kept for the types of rock materials excavated and the traceability of delivery will be ensured with the implementation of Trip Ticket System and enforced by site supervisory staff as stipulated under DEVB TC(W) No. 6/2010 for tracking of the correct delivery to the rock crushing facilities for processing into aggregates. Alternative disposal option for the reuse of volcanic rock and Aplite Dyke rock, etc. should be explored. Construction and Demolition Material Maintain temporary stockpiles and reuse excavated fill material for backfilling and reinstatement; Carry out on-site sorting; Make provisions in the Contract documents to allow and promote the use of recycled aggregates where appropriate; Adopt 'selective demolition' technique to demolish the existing structures and facilities with a view to recovering broken concrete effectively for recycling purpose, where possible; Implement a trip-ticket system for each works contract to ensure that the disposal of C&D materials are properly documented and verified; and	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land (Miscellaneo us Provisions) Ordinance Waste Disposal Ordinance ETWB TCW No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		• Implement an enhanced Waste Management Plan similar to ETWBTC (Works) No. 19/2005 – "Environmental Management on Construction Sites" to encourage on-site sorting of C&D materials and to minimize their generation during the course of construction.						
\$7.5.1	WM3	 Standard formwork or pre-fabrication should be used as far as practicable in order to minimize the arising of C&D materials. The use of more durable formwork or plastic facing for the construction works should be considered. Use of wooden hoardings should not be used, as in other projects. Metal hoarding should be used to enhance the possibility of recycling. The purchasing of construction materials will be carefully planned in order to avoid over ordering and wastage; The Contractor should recycle as much of the C&D materials as possible on-site. Public fill and C&D waste should be segregated and stored in different containers or skips to enhance reuse or recycling of materials and their proper disposal. Where practicable, concrete and masonry can be crushed and used as fill. Steel reinforcement bar can be used by scrap steel mills. Different areas of the sites should be considered for such segregation and storage. 	Good site practice to minimize the waste generation and recycle the C&D materials as far as practicable so as to reduce the amount for final disposal	Contractor	All construction sites	Construction stage	Land (Miscellaneo us Provisions) Ordinance Waste Disposal Ordinance ETWB TCW No. 19/2005	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
\$7.5.1	WM5	 All construction plant and equipment shall be designed and maintained to minimize the risk of silt, sediments, contaminants or other pollutants being released into the water column or deposited in the locations other than designated location; All vessels shall be sized such that adequate draft is maintained between vessels and the sea bed at all states of the tide to ensure that undue turbidity is not generated by turbulence from vessel movement or propeller wash; Before moving the vessels which are used for transporting dredged material, excess material shall be cleaned from the decks and exposed fittings of vessels and the excess materials shall never be dumped into the sea except at the approved locations; Adequate freeboard shall be maintained on barges to ensure that decks are not washed by wave action. The Contractors shall monitor all vessels transporting material to ensure that no dumping outside the approved location takes place. The Contractor shall keep and produce logs and other records to demonstrate compliance and that journeys are consistent with designated locations and copies of such records shall be submitted to the engineers; The Contractors shall comply with the conditions in the dumping licence. 	To control pollution due to marine sediment	Contractor	Along CKR alignment	Construction stage	• ETWB TCW No. 34/2002	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 All bottom dumping vessels (Hopper barges) shall be fitted with tight fittings seals to their bottom openings to prevent leakage of material; The material shall be placed into the disposal pit by bottom dumping; Contaminated marine mud shall be transported by spit barge of not less than 750m3 capacity and capable of rapid opening and discharge at the disposal site; Discharge shall be undertaken rapidly and the hoppers shall be closed immediately. Material adhering to the sides of the hopper shall not be washed out of the hopper and the hopper shall remain closed until the barge returns to the disposal site. For Type 3 special disposal treatment, sealing of contaminant with geosynthetic containment before dropping designated mud pit would be a possible arrangement. A geosynthetic containment method is a method whereby the sediments are sealed in geosynthetic containers and, the containers would be dropped into the designated contaminated mud pit where they would be covered by further mud disposal and later by the mud pit capping at the disposal site, thereby fulfilling the requirements for fully confined mud disposal. 						
\$7.5.1	WM6	 Chemical Waste Chemical waste that is produced, as defined by Schedule 1 of the Waste Disposal (Chemical Waste) (General) Regulation, should be handled in 	Control the chemical waste and ensure proper storage,	Contractor	All construction sites	Construction stage	• Waste Disposal (Chemical Waste)	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		accordance with the Code of Practice on the Packaging, Labelling and Storage of Chemical Wastes; Containers used for the storage of chemical wastes should be suitable for the substance they are holding, resistant to corrosion, maintained in a good condition, and securely closed, have a capacity of less than 450 L unless the specification has been approved by EPD, and display a label in English and Chinese in accordance with instructions prescribed in Schedule 2 of the regulation; The storage area for chemical wastes should be clearly labelled and used solely for the storage of chemical waste, enclosed on at least 3 sides, have an impermeable floor and bunding of sufficient capacity to accommodate 110% of the volume of the largest container or 20% of the total volume of waste stored in that area, whichever is the greatest, have adequate ventilation, covered to prevent rainfall entering, and arranged so that incompatible materials are adequately separated; Disposal of chemical waste should be via a licensed waste collector, be to a facility licensed to receive chemical waste, such as the Chemical Waste Treatment Centre which also offers a chemical waste collection service and can supply the necessary storage containers, or be to a reuser of the waste, under approval from EPD.	handling and disposal				(General) Regulation Code of Practice on the Packaging, Labelling and Storage of Chemical Waste	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S7.5.1	WM7	 General Refuse General refuse generated on-site should be stored in enclosed bins or compaction units separately from construction and chemical wastes; A reputable waste collector should be employed by the Contractor to remove general refuse from the site, separately from construction and chemical wastes, on a daily basis to minimize odour, pest and litter impacts. Burning of refuse on construction sites is prohibited by law. Aluminum cans are often recovered from the waste stream by individual collectors if they are segregated and made easily accessible. Separate labelled bins for their deposit should be provided if feasible; Office wastes can be reduced through the recycling of paper if volumes are large enough to warrant collection. Participation in a local collection scheme should be considered by the Contractor. 	Minimize production of the general refuse and avoid odour, pest and litter impacts	Contractor	All construction sites	Construction stage	Waste Disposal Ordinance	• Implemented
	I		Land Contamin	ation		1		
S8.9 & Appendix 8.4	LC2	Prior to commencement of the excavation works at the contamination zone, the zone should be clearly marked out on site and the surface levels recorded. Excavation of contaminated material should be undertaken using dedicated earth-moving plant. The excavated contaminated soils would be stockpiled at designated area on site and covered by sheet to prevent dispersion of contamination	The contaminated soil will be excavated for on-site reuse	Contractor	PBH4	Prior to commencement of construction works within the contaminated area	Practice Guide (PG) for Investigation and Remediation of Contaminate d Land	Implemented

EIA Ref.	EM&A Log Ref.	Reco	mmended Mitigat	tion Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
50.0		selection schemes table is h excavation valid Wat discharge	tractor should pa of suitable gro and discharge poin igher than the cont n. The Contractor ter Pollution Contro licence from EPD w						Guidance Notes for Contaminate d Land Assessment and Remediation Guidance	
S8.9 & Appendix 8.4	LC3	 Following completion of the excavation to the specified depth, at least one sample from the base of the excavation and four samples evenly distributed along the boundary of the excavation shall be taken for a closure assessment testing. The acceptance criterion is shown below: 							Manual for Use of Risk- Based Remediation Goals (RBRGs) for Contaminate	Implemented
		Locations Testing requirement Criteria PBH4 PCBs RBRGs (Public Park) • If the results of analysis below the RBRGs (Public Park), no further excavation will be required. If the analysis indicates presence of contamination (i.e. noncompliance of the acceptance criteria), further excavation shall be carried out in 0.5m increment vertically and/or horizontally depending on the location(s) of the sample(s) which has exceeded the acceptance criteria. Further sampling shall also be conducted for compliance testing. The process of							d Land Management	

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		excavation, sampling and compliance testing should continue until all contaminated materials are removed and should be supervised by a Land Contamination Specialist.						
Appendix 8.4	LC4	A Remediation Report (RR) to demonstrate adequate clean-up shall be prepared and submitted to EPD for endorsement prior to the commencement of any construction/development works within the sites. No construction/development works shall be carried out prior to the endorsement of the RR by EPD.						Implemented
				Hazard to Life				
\$9.18	H1	Blasting activities regarding transport and use of explosives should be supervised and audited by competent site staff to ensure full compliance with the blasting permit conditions.	To ensure that the risks from the proposed explosives handling and transport would be acceptable	Contractor	Works areas at which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A
S9.6, para.4	H2	Detonators shall not be transported in the same vehicle with other Category 1 Dangerous Goods.	To reduce the risk of explosion during the transport of cartridged emulsion	Contractor	-	Construction stage	Dangerous Goods Ordinance	• N/A
S9.6, para.8	Н3	The explosives delivery trucks should be approved by Mines Division and should meet the regulatory requirements for transport of explosives.	To comply with the requirements for approval of an explosives	Contractor	-	Construction stage	Dangerous Goods Ordinance	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
			delivery vehicle					
S9.10, para.7 and S9.18	H4	Blast cover should be provided for shaft at HMT, and kept closed during blasting. Provision of blast doors or heavy duty blast curtains should be implemented at the shaft to prevent flyrock and control the air overpressure.	To ensure safe use of explosives	Contractor	Shaft	Construction stage	-	• N/A
\$9.16	H5	Only the required quantity of explosives for a particular blast should be transported to avoid the return.	To reduce risks during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	Н7	The approved truck dedicated for transport of explosives should comply with the "Guidance Note on Requirements for Approval of an Explosives Delivery Vehicle" issued by CEDD Mines Division. The truck should be periodically inspected and properly maintained in good operation conditions. The fuel carried in the fuel tank should be minimized to reduce the duration of fire. Adequate fire fighting equipment shall be provided, inspected and replaced periodically (e.g. fire extinguishers).	To reduce the risk during explosives transport	Contractor	Works areas of which explosives would be used	Construction stage	Dangerous Goods Ordinance	• N/A
\$9.18	Н8	The driver and his assistant should be physically healthy, experienced and have good safe driving records. The driver should hold a proper driving licence for the approved transport truck. Dedicated training programme and regular road safety briefing	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		sessions/ workshops should be provided to enhance their safe driving attitude and practice. Smoking should be strictly prohibited.						
S9.18	Н9	Emergency response plans in case of road accident should be prepared and implemented. The driver and his assistant should be familiar with the emergency procedures including evacuation, and proper communication/ fire-fighting equipment should be provided to the driver and his assistant.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H10	Close liaison and communication among Mines Division, Contractors for transport of explosives, and working staff of the blasting should be established. In case of any change of work schedule leading to cancellation or variation of explosives required, relevant parties should be informed in time to avoid unused explosives at the work sites.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H11	Close liaison and communication with Fire Services Department should be established to reduce the accidental detonation escalated from a fire. The contractors for transport of explosives should use the preferred transport routes as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H12	Contingency plan should be prepared for transport of explosives under severe weather conditions such as rainstorms and thunderstorms.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S9.18	H13	For explosive transport, all packages of explosives on the truck should be properly stored in the truck compartment as required. Packaging of the explosives should remain intact (i.e. damage free) until they are transferred to the blasting site.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H14	Availability of a parking space should be ensured before commencement of transport of explosives. Location for loading and unloading of explosives should be as close as possible to the shaft. No hot work should be performed in the vicinity during the time of loading and unloading.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
\$9.18	H22	It is recommended to explore to minimize the use of the cartridged emulsion explosives and maximize the use of bulk emulsion explosive as far as practicable.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
S9.18	H24	It is recommended to explore to use smaller explosive charges such as 'cast boosters' or 'mini-cast booster' instead of cartridged emulsion as primers for bulk emulsion. This option reduces the quantity of explosives required for transportation for the sections where bulk emulsion will be used.	To reduce the risk during explosives transport	Contractor	Works areas at which explosives would be used	Construction stage	-	• N/A
			Lan	dscape & Visual				
S10.10.1 Table 10.11	LV3	Good Site Management Large temporary stockpiles of excavated material shall be covered with unobtrusive sheeting to prevent dust and dirt spreading to adjacent landscape areas and vegetation, and to create a neat and tidy visual appearance.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		Construction plant and building material shall be orderly and carefully stored in order to create a neat and tidy visual appearance.						
S10.10.1 Table 10.11	LV4	 Screen Hoarding Decorative screen hoarding should be erected to screen the public from the construction area. It should be designed to be compatible with the existing urban context. 	Minimize visual impact	Contractor	Within Project site	Construction stage	-	Implemented
S10.10.1 Table 10.11	LV5	Lighting Control during Construction All lighting in the construction site shall be carefully controlled to minimize light pollution and night-time glare to nearby residencies and GIC. The Contractor shall consider other security measures, which shall minimize the visual impacts.	Minimize visual impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV6	Erosion Control The potential for soil erosion shall be reduced by minimizing the extent of vegetation disturbance on site and by providing a protective cover over newly exposed soil.	Minimize landscape impact	Contractor	Within Project site	Construction stage	-	• N/A
S10.10.1 Table 10.11	LV7	Tree Protection & Preservation • Carefully protected during construction. Tree protection measures will be detailed at the Tree Removal Application stage and plans submitted to the relevant Government Department for approval in due course in accordance with ETWB TC no. 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site	Construction stage	• 'Guidelines for Tree Risk Management and Assessment Arrangement on an Area Basis and on a Tree Basis', Greening,	Implemented


EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S10.10.1 Table 10.11	LV8	Tree Transplantation • For trees unavoidably affected by the Project that have to be removed, where practical transplantation will be chosen as the top priority method of removal. If this is not possible or practical compensatory planting will be provided for trees unavoidably felled (See LV10). For trees unavoidably affected by the Project works that are transplanted, transplantation must be carried out in accordance with ETWB TCW 2/2004 and 3/2006.	Minimize landscape and visual impact	Contractor	Within Project site and designated off-site locations	Prior to Construction stage	Landscape and Tree Management (GLTM) Section, DEVB Latest recommende d horticultural practices from GLTM Section, DEVB ETWB TCW 3/2006 Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB	• N/A

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
							2/2004	
S10.10.1 Table 10.11	LV9	 Compensatory Planting For trees unavoidably affected by the Project that have to be removed, where practical transportation will be chosen as the top priority method of removal but if this is not possible or practical compensatory planting will be provided for trees unavoidably felled. All felled trees shall be compensated for by planting trees to the satisfaction of relevant Government projects. Required numbers and locations of compensatory trees shall be determined and agreed separately with Government during the Tree Felling Application process under ETWBTC 3/2006. Compensatory tree planting may be incorporated into public open spaces and along roadside amenity areas affected by the construction works and therefore be part of the bigger wider planting plans. Onsite compensation planting is preferred but if necessary, additional receptor sites outside the Works Area shall be agreed separately with Government during the Tree Felling Application process. 	Minimize visual impact and also enhance landscape	Contractor	Within Project site	Construction stage	ETWB TCW 3/2006 Latest recommende d horticultural practices from Greening, Landscape and Tree Management (GLTM) Section, DEVB ETWB TCW 2/2004	• N/A
			Cultural Heritage	Impact (Construct	ion Phase)			

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
S11.4.4	CH1	The contractor should be alerted during the construction on the possibility of locating archaeological remains and as a precautionary measure, AMO shall be informed immediately in case of discovery of antiquities or supposed antiquities in the subject sites.	To preserve any cultural heritage items which may be removed and damaged by the excavation	Contractor	During construction works for cut and cover tunnels	Construction stage	AMOs requirements	Implemented
S12.6.1	СНЗ	 Protective covering should be provided for the buildings in the form of plastic sheeting; Buffer zones should be provided between the construction works and the external walls of the buildings and should be as large as site restrictions allow and be marked out by temporary fencing or hoarding; An underpinning scheme is required to transfer the existing column loadings to a deeper rock stratum. The supporting system includes cutting the existing ground floor slab to expose the existing pile caps and then construct transfer beams at both sides of the pile caps. The transfer beams will tie up with the existing caps. Loadings of the transfer beams will be transferred to the rock socket piles installed at the two ends of the beams; The AAA settlement and tilting limit should be 6/8/10 mm and1/2000, 1/1500 and 1/1000; Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;. 	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status
		 Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance. 						
S12.6.1		 Adopting diaphragm wall construction method; Grout curtain should be provided in front of the building; Recharging system should be installed as a contingency measure to mitigate the fluctuation of water table; the AAA settlement and tilting limit should be 6/8/10 mm and 1/2000, 1/1500 and 1/1000; Monitoring of vibration levels will be undertaken during the construction phase and the Alert, Alarm and Action (AAA) vibration limit will be set at 5/6/7.5 mm/s. The monitoring proposal should be sent to AMO for comment;. Regular site inspections and monitoring works will be carried out by the contractor and the monitoring results will be submitted to the resident site staff of HyD to ensure compliance. 	Protect the building from damage from construction works	Contractor	Yau Ma Tei Police Station (Old Wing) (CKR-01)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO Proposed Vibration Limits	• Implemented
S12.6.1 Table 12.2		 The Alert, Alarm and Action (AAA) vibration limit will be set at 3/4/5 mm/s and a condition survey shall be carried out by the project proponent prior to the construction phase to confirm this assessment Vibration monitoring of the structure shall be employed during the construction phase to ensure that the level is not exceeded. The monitoring proposal should be sent to AMO for comment. 	Protect the building from damage from construction works	Contractor	Tin Hau Temple (CKR- 02)	Prior to commencement of and during the construction phase	Guidelines for Cultural Heritage Impact Assessment EIAO-TM Annex 10 and Annex 19 AMO	Implemented

EIA Ref.	EM&A Log Ref.	Recommended Mitigation Measures	Objectives of the Recommende d Measures & Main Concerns to address	Implementation Agent	Location / Timing	Implementation Stage	Requirements and/ or standards to be achieved	Implementation Status			
							Proposed Vibration Limits				
	EM&A Project										
S13.2	EM1	An Independent Environmental Checker needs to be employed as per the EM&A Manual	Control EM&A Performance	Highways Department	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented			
S13.2-13.4	EM2	 An Environmental Team needs to be employed as per the EM&A Manual; Prepare a systematic Environmental Management Plan to ensure effective implementation of the mitigation measures; An environmental impact monitoring needs to be implemented by the Environmental Team to ensure all the requirements given in the EM&A Manual are fully complied with. 	Perform environmental monitoring & auditing	Highways Department/ Contractor	All construction sites	Construction stage	• EIAO Guidance Note No. 4/2010 • TM-EIAO	Implemented			

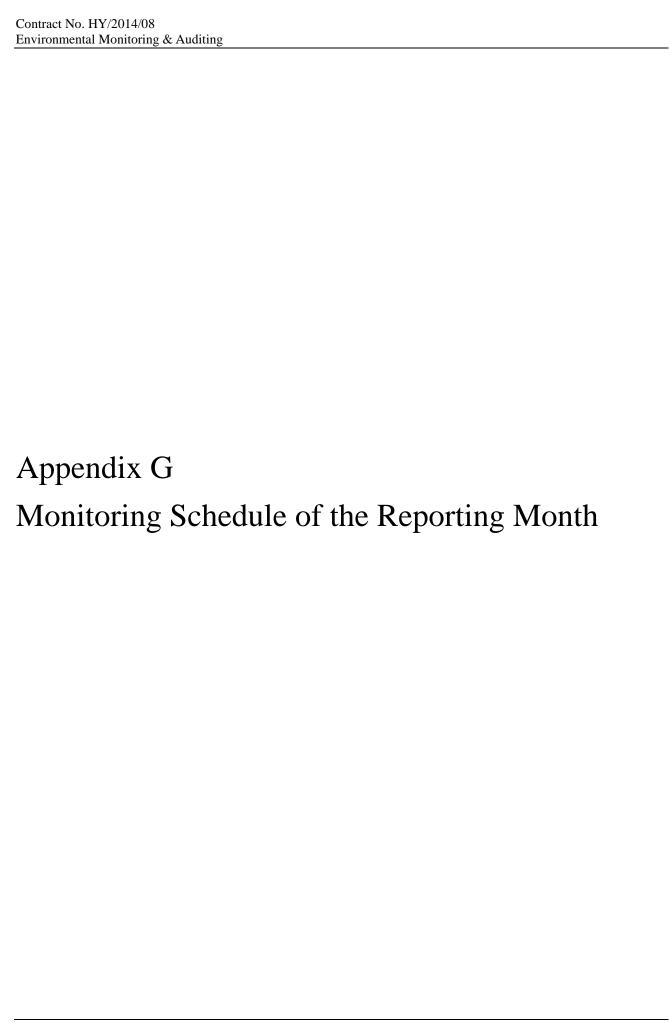

r			Impact Monitoring Schedule for YMTE			
			Aug-22			
Sun	Mon	Tue	Wed	Thur	Fri	Sat
	1	2	3	4	5	6
	Impact					Impact
	Air monitoring for W-A6 &W-A1					Air monitoring for W-A6 &W-A1
	Noise monitoring for W-N1A,					Noise monitoring for W-N1A,
	W-P11,W-N18 & W-N25A					W-P11,W-N18 & W-N25A
7	8	9	10	11	12	13
					Impact	
					Air monitoring for W-A6 &W-A1	
					Noise monitoring for W-N1A,	
					W-P11,W-N18 & W-N25A	
14	15	16	17	18	19	20
				Impact		
				Air monitoring for W-A6 &W-A1		
				Noise monitoring for W-N1A,		
				W-P11,W-N18 & W-N25A		
21	22	23	24	25	26	27
			Impact			
			Air monitoring for W-A6 &W-A1			
			Noise monitoring for W-N1A,			
			W-P11,W-N18 & W-N25A			
28	29	30	31			
		Impact				
		Air monitoring for W-A6 &W-A1				
		Noise monitoring for W-N1A,				
		W-P11,W-N18 & W-N25A				
					1	<u> </u>

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix H
Calibration Certificates
(Air Monitoring)







Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 12-Sep-21 19-Sep-21

Next Verification Test Date: 20-Sep-22 Unit-under-Test- Model No. Sibata LD-5R 992821 Unit-under-Test Serial No. Our Report Refrence No. RPT-21-HVS-0012

Standard Equipment Information			
Verification Equipment Type		Tisch's TSP	Tish HVS
Verification Equipment Type		HVS	Calibrator
Standard Equipment Model No.		TE-5170X	TE-5028
Equipment serial no.	MFC	1049	1050
Last Calibration Date		4-Sep-21	24-Sep-20
Next Calibration Date		4-Nov-21	24-Sep-21

Verification	Date		Time		K-Factor	Counts/ Minute (R)	Total Counts	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis	(TC)	ID No.	y axis
1	12/9/2021	4012.12	4014.84	163.20	0.00115	85.67	13981	R211363/1	98
2	12/9/2021	4014.84	4018.16	199.20	0.00125	93.00	18526	R211363/2	116
3	12/9/2021	4018.16	4021.16	180.00	0.00101	89.00	16020	R211363/3	89
4	19/9/2021	4046.44	4049.65	192.60	0.00040	63.67	12262	R211364/1	26
5	19/9/2021	4049.65	4052.95	198.00	0.00041	65.33	12936	R211364/2	27
6	19/9/2021	4052.95	4055.56	156.60	0.00066	59.33	9291.6	R211364/3	39
		•			0.00081				

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

By Linear Regression of y on x:

2.5858 slope, mh= intercept,ch= -130.6851 *Correlation Coefficient,R= 0.9584


Verification Test Result: Strong Correlation, Results were accepted.

 $\mbox{*}$ If the Correlation Coefficient, R is <0.5. Checking and Re-

verification are required.

Verified By: Technical Manager

Date: 09-10-2021

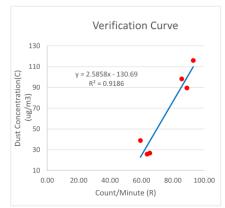









Sibata LD-5R K-Factor Verification Test by Total Suspended Particulates HVS Test Report

Verification Test Date: 27-Mar-22 to 3-Apr-22

Next Verification Test Date: 4-Apr-23
Unit-under-Test- Model No. Sibata LD-5R
Unit-under-Test Serial No. 992820
Our Report Refrence No. RPT-22-HVS-0004

Standard Equipment Information						
Verification Equipment Type	Tisch's TSP	Tish HVS				
verification Equipment Type	HVS	Calibrator				
Standard Equipment Model No.	TE-5170X	TE-5028A				
Equipment serial no.	MFC 1049	3702				
Last Calibration Date	22-Mar-22	3-Aug-21				
Next Calibration Date	21-Jun-22	4-Aug-22				

Verification	Date		Time		K-Factor	Counts/ Minute (R)	te (R) Total Counts (TC)	R) Total	TSP Sample	Dust Concentration (ug/m3), (C)
Test No.		Start-time	End-time	Elapsed Time (in min)	K-Factor (K=C/R)	x-axis		ID No.	y axis	
1	27/3/2022	4945.81	4949.09	196.80	0.00083	61	12005	R220486/1	50	
2	27/3/2022	4949.09	4952.83	224.40	0.00082	65	14586	R220486/2	53	
3	27/3/2022	4952.83	4956.42	215.40	0.00081	58	12493	R220486/3	47	
4	3/4/2022	4991.80	4995.40	216.00	0.00047	48	10296	R220538/1	22	
5	3/4/2022	4995.40	4998.79	203.40	0.00047	50	10102	R220538/2	23	
6	3/4/2022	4998.79	5002.26	208.20	0.00067	56	11590	R220538/3	37	
					0.00068					

K-Factor to be inputted in LD-5R (corrected 1 decimal point):

By Linear Regression of y on x:

slope, mh= 2.0047 intercept,ch= -73.6384


*Correlation Coefficient,R= 0.9763

Verification Test Result: Strong Correlation, Results were accepted.

* If the Correlation Coefficient, R is <0.5. Checking and Reverification are required.

Verified By:

Date: 14-04-2022

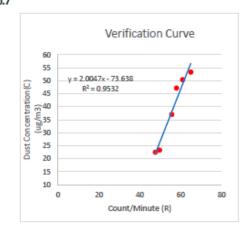



RECALIBRATION DUE DATE:

June 28, 2023

Certificate of Calibration

Calibration Certification Information

Cal. Date: June 28, 2022

Rootsmeter 5/N: 438320

Ta: 296

°K

Operator: Jim Tisch

200 200

Pa: 755.1

mm Hg

Calibration Model #: TE-5025A

Calibrator S/N: 3465

Run	Vol. Init (m3)	Vol. Final (m3)	ΔVol. (m3)	ΔTime (min)	ΔP (mm Hg)	ΔH (in H2O)
1	1	2	1	1.4290	3.2	2.00
2	3	4	1	1.0130	6.4	4.00
3	5	6	1	0.9050	7.9	5.00
4	7	8	1	0.8590	8.8	5.50
5	9	10	1	0.7110	12.8	8.00

Data Tabulation							
Vstd (m3)	Qstd (x-axis)	$\sqrt{\Delta H \left(\frac{Pa}{Pstd}\right) \left(\frac{Tstd}{Ta}\right)}$ (y-axis)	Va	Qa (x-axis)	√∆H(Ta/Pa)		
0.9961	0.6970	1.4144	0.9958	0.6968	0.8854		
0.9918	0.9791	2.0003	0.9915	0.9788	1.2522		
0.9899	1.0938	2.2364	0.9895	1.0934	1.4000		
0.9887	1.1509	2.3456	0.9883	1.1506	1.4683		
0.9834	1.3831	2.8289	0.9830	1.3826	1.7708		
resone !	m=	2.05924		m=	1.28946		
QSTD	b=	-0.01929	QA	b=	-0.01207		
	r=	0.99998		r=	0.99998		

Calculati	ons
Vstd= ΔVol((Pa-ΔP)/Pstd)(Tstd/Ta)	Va= ΔVol((Pa-ΔP)/Pa)
Qstd= Vstd/ΔTime	Qa= Va/ΔTime
For subsequent flow r	ate calculations:
$Qstd= 1/m \left(\left(\sqrt{\Delta H \left(\frac{Pa}{Pstd} \right) \left(\frac{Tstd}{Ta} \right)} \right) \cdot b \right)$	Qa= $1/m\left(\left(\sqrt{\Delta H\left(Ta/Pa\right)}\right)-b\right)$

	Standard Conditions
Tstd:	298.15 °K
Pstd:	760 mm Hg
	Key
ΔH: calibrator	manometer reading (in H2O)
ΔP: rootsmete	er manometer reading (mm Hg)
Ta: actual abs	olute temperature (°K)
	ometric pressure (mm Hg)
b: intercept	
m: slope	

RECALIBRATION

US EPA recommends annual recalibration per 1998 40 Code of Federal Regulations Part 50 to 51, Appendix B to Part 50, Reference Method for the Determination of Suspended Particulate Matter in the Atmosphere, 9.2.17, page 30

Tisch Environmental, Inc. 145 South Miami Avenue Village of Cleves, OH 45002

www.tisch-env.com TOLL FREE: (877)263-7610 FAX: (513)467-9009

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site	Information	l

Location:	Man Cheong Building	Site ID:	W-A6	Date:	30-Ju1-2022
Serial No:	1050	Mode1:	TE-5170X	Operator:	Tim

Ambient Condition

|--|

Calibration Orifice

Model:	TE-5025A	Slope:	1.28946
Serial No.:	3465	Intercept:	-0.01207
Calibration Due Date:	28-Jun-23	Corr. Coeff	0.9998

Calibration Data

Plate or	In,H20	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.25	0.866	39.2	38.74
2	2.09	1.117	40.0	39.53
3	2.26	1.161	40.2	39.72
4	3.14	1.367	40.9	40.42
5	3.73	1.489	41.3	40.81

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	3.3531	b=	35.8175	Corr. Coeff=	0.9996
Samp	oler set point(SSP)	40	CFM		
		Ca	lculations		
Qstd = 1/m[Sqrt	(H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/Ps	td)(Tstd/Ta)]		b = sampler intercept		
			I = chart response		
Qstd = standard	flow rate		Tav = average temperature		
IC = corrected ch	nart response		Pav = average pressure		
I = actual chart response					
m = calibrator (Qstd slope				
b = calibrator C	std intercept				
Ta = actual temp	erature during calibration (d	eg K)			
Pa = actual pres	sure during calibration (mm I	∃g)			
Tstd = 298 deg K					
Pstd = 760 mm H	łg				
For subsequent	calculation of sampler flow:				
(1.21*m+b)/[Sqr	t(298/Tav)(Pav/760)]				
	Tim				
Checked by:	er somethelder		Date:	30-Ju	11-22

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

S	i	t e	Int	fot	·ma	t	ion
\sim	•	·			ши	·	1 0 11

Location:	YMT Catholic Primary School	Site ID:	W - A1	Date:	30-Jul-2022
Serial No:	1084	Model:	TE-5170X	Operator:	Tim

Ambient Condition

			2025
Corrected Pressure (mm Hg):	753.3	Temperature (deg K):	302.5

Calibration Orifice

Model:	TE-5025A	Slope:	1.28946
Serial No.:	3465	Intercept:	-0.01207
Calibration Due Date:	28-Jun-23	Corr. Coeff	0.99998

Calibration Data

Plate or	In,H2O	Qa, X-Axis	I, CFM	IC, Y-Axis				
Test #	(in)	(m3/min)	(chart)	(corrected)				
1	1.19	0.845	39.2	38.74				
2	2.38	1.192	40.3	39.82				
3	3.24	1.389	40.9	40.42				
4	3.65	1.473	41.2	40.71				
5	4.11	1.563	41.5	41.01				

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	3.1507	b=	36.0667	Corr. Coeff=	0.9998
Sampl	er set point(SSP)	40	CFM		
		Ca	lculations		
Qstd = 1/m[Sqrt(House)]	H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slope		
IC = I[Sqrt(Pa/Pst	d)(Tstd/Ta)]		b = sampler intercept		
			I = chart response		
Qstd = standard f	flow rate		Tav = average temperature		
IC = corrected cha	art response		Pav = average pressure		
I = actual chart re	esponse				
m = calibrator Q	std slope				
b = calibrator Qs	std intercept				
Ta = actual tempe	erature during calibration (de	eg K)			
Pa = actual press	ure during calibration (mm F	łg)			
Tstd = 298 deg K					
Pstd = 760 mm H ₈	5				
For subsequent c	alculation of sampler flow:				
(1.21*m+b)/[Sqrt	(298/Tav)(Pav/760)]				
	Tim				
Checked by: _	er troopsame		Date:	30-Ju	11-22

創新科儀有限公司

HIVOL SAMPLER CALIBRATION DATA SHEET (TSP)

Site Information

Location:	Man Cheong Building	Site ID:	₩-A6	Date:	17-Aug-2022
Serial No:	1050	Model:	TE-5170X	Operator:	Tim

Ambient Condition

Corrected Pressure (mm Hg):	754.6	Temperature (deg K):	303.5
corrected riessure (mm ng).	750	romporaturo (dog K).	000.5

Calibration Orifice

Model:	TE-5025A	Slope:	1.28946
Serial No.:	3465	Intercept:	-0.01207
Calibration Due Date:	28-Jun-23	Corr. Coeff	0.99998

Calibration Data

Plate or	In,H20	Qa, X-Axis	I, CFM	IC, Y-Axis
Test #	(in)	(m3/min)	(chart)	(corrected)
1	1.15	0.831	38.5	38.01
2	1.67	0.999	39.1	38.61
3	1.93	1.073	39.4	38.90
4	2.74	1.277	40.1	39.59
5	3.23	1.386	40.6	40.09

Sampler Calibtation Relationship (Qa on x-axis, IC on y-axis)

m=	3.6873	b=	34.9367	_	Corr. Coeff=	0.9991
Sample	er set point(SSP)	40	CFM	•		
		Ca1	culations			
Qstd = 1/m[Sqrt(H2C)(Pa/Pstd)(Tstd/Ta))-b]		m = sampler slo	ope		
IC = I[Sqrt(Pa/Pstd)(rstd/Ta)]		b = sampler inte	ercept		
			I = chart respon	ise		
Qstd = standard flow	v rate		Tav = average ter	mperature		
IC = corrected chart	response		Pav = average pr	essure		
I = actual chart resp	onse					
m = calibrator Qstd	slope					
b = calibrator Qstd	intercept					
Ta = actual temperat	cure during calibration (deg K)					
Pa = actual pressure	during calibration (mm Hg)					
Tstd = 298 deg K						
Pstd = 760 mm Hg						
For subsequent calc	ulation of sampler flow:					

Date:

17-Aug-22

(1.21*m+b)/[Sqrt(298/Tav)(Pav/760)]

Checked by:

Tim

創新科儀有限公司

п	IVOL SAMPLER	CALIDI	O A TT () NI	חאדא כטב	ET (TSP)	
П	IVUL SAMPLER			DATA SHE	EI (ISP)	
		Site	Informatio	o <u>n</u>		
Location:	YMT Catholic Primary School	Site ID:	₩-A1	Date:	17-Aug	-2022
			TE-5170X	Operator:	Ti	
Serial No:	1084	Model:	1E-3170X	operator.	11	ш
		Ambier	nt Conditi	on		
Corrected Pr	ressure (mm Hg):	754.6	Temperatur	e (deg K):	303	.5
		Calibra	ition Orif	ice		
Model:		TI	E-5025A	Slope:	1.289	946
Serial No.:			3465	Intercept:	-0.01	207
Calibration	Due Date:	28	3-Jun-23	Corr. Coeff	0.99	998
					0.55	330
		Calib	ration Dat	a	ı	
Plate or	In,H20	Qa,	X-Axis	I, CFM	IC, Y	-Axis
Test #	(in)	(m	3/min)	(chart)	(corre	cted)
1	1.21		0.852	37.8	37.3	32
2	2.34		1.181	39.1	38.6	51
3	3.48		1.438	40.2	39.6	59
4	3.61		1.464	40.3	39.79	
5	4.33		1.603	40.9	40.3	38
Complex Calibtet	ion Bolotionshin (Oo on v ov	is IC on v ovi	۵۱			
	ion Relationship (Qa on x-ax					
m= -	4.0764	_ b=	33.8295	_	Corr. Coeff=	0.9998
Samp	ler set point(SSP)	39	CFM			
	,			_		
		Ca1	culations			
	H2O(Pa/Pstd)(Tstd/Ta))-b]		m = sampler s			
IC = I[Sqrt(Pa/Pst	td)(Tstd/Ta)]		b = sampler in	•		
Ootd - standard	flouresto		I = chart respo			
Qstd = standard IC = corrected ch			Tav = average t Pav = average p	•		
I = actual chart r	•		rav – average p	Ji essui e		
m = calibrator C	•					
b = calibrator Q						
Ta = actual temp	erature during calibration (deg K)				
Pa = actual press	sure during calibration (mm	Hg)				
Tstd = 298 deg K						
Pstd = 760 mm H	g					
For subsequent of	calculation of sampler flow t(298/Tav)(Pav/760)]					
	Tim					
Checked by:	2.00000		_	Date:	17-Au	ig-22

Environmental Monitoring & Auditing
A 11 T
Appendix I
Calibration Certificates (Noise)
Calibration Continuates (110150)

Contract No. HY/2014/08



Certificate of Calibration

for

Description: Sound Level Meter

Manufacturer: NTi Aua.o

Type No.: XL2 (Serial No.: A24-13661-E0)

Microphone: ACO 7052 (Serial No.: 73912)

Preamplifier: NTi Audio MA220 (M2211) (Serial No.:5735)

Suomitted by:

Customer: A wity Sustainability Consulting Limited

Address: Unit C, In/F, Ford Glory Plaza, No. 37-39 Wing Hong

Street Cheung Sha Wan, Kowloon

Upon receipt for calibration, the instrument was sound to be:

✓ Within (31.5 Hz - 8k Hz)

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

 The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 17 September 2021

Date of calibration: 23 September 2021

Calibration Technician

____ Certified by:

Mr. Ng Yan Wa Laboratory Manager

Date of issue, 27 September 2021

Certificate No.: 14PJ?1-085 CC001

Page 1 of 4

Room 422,Leader In lustrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946

Homepage: http://www.aa-lab.com E-mail:inquiry@aa-lab.com



1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurer exast each calibration point.

2. Calibration Conditions:

Air Temperature: 24.0 °C
Air Pressure: 1001 hPa
Relative Humidity: 55.7 %

3. Calibration Equipment:

Type Serial No. Calibration Report Number Trace, b'e to Multifunction Calibrator B&K 42. 6 2288467 AV200041 HOK AS

4. Calibration Results

Sound Pressure Level

Reference Sound Fressare Level

Set	Set ing of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dE	I req. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	αЗА	SPI	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq.	Weighting	Time Weighting	Level, aB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.0	±0.3
				114		114.0	±0.3

Time Weigning

Sett	Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1	
Range, d5	Freq. W	eighting	Cme Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	Ref
30-130	UDA	SPL	Slow	94	1000	94.0	±0.3

Certificate No.: APJ21-085 CC001

STOOL * Page 2 of 4

Room 422, Leader In Juritrial Centre, 57-59 Au Pui Wan Street ,Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946

Homepage: http://www.aa-lab.com E-mail:inquiry@aa-lab.com



Acoustics and Air Testing Laboratory Co. Ltd. 聲學及空氣測試實驗室有限公司



Frequency Response

Linear Response

Sett	Setting of Unit-under-test (UUT)		Setting of Unit-under-test (UUT) Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. We	ighting	Time Weighting	Level, dr.	Frequency, Hz	dB	Specification, dB
				~	31.5	94.1	±2.0
				^	63	94.1	±1.5
					125	94.1	±1.5
					250	94.6	+1.4
30-130	dB	SPL	Fast	94	500	94.0	±1.4
					1000	94.0	Ref
					2000	94.3	±1.6
			//		4000	95.1	-1.6
			//		8000	94.3	±2.1; -3.1

A-weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reacing,	IEC 61672 Class 1
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				31.5	54.7	-39.4 ±2.0
				63	67.9	-26.2 ±1.5
				125	73.0	-16.1 ±1.5
				250	85.4	-8.6 ±1.4
30-130	&BA SPL	Fast	94	500	90.8	-3.2 ±1.4
				1000	94.0	Ref
	/ /			2000	95.5	+1.2 ±1.6
				4000	96.1	+1.0±1.6
				8000	93.9	-1.1+2.1; -3.1

C-weighting

Setting of Unit-under-test (UUT)			Appl	ied value	UUT Reading,	IEC 61672 Class
Range, dB	Freq. Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				31.5	91.1	-3.0±2.0
				63	93.3	-0.8 ±1.5
			?	125	93.9	-0.2 ±1.5
				250	94.0	-0.0 ±1.4
30-130	dBC SPL	Fost	94	500	94.0	-0.0 ± 1.4
	7 -			1000	94.0	Ref
				2000	94.2	-0.2 ±1.6
)/		4000	94.3	-0.8 ±1.6
		//		8000	91.3	-3.0 +2.1: -3.1

Certificate No.: 19571-085-CC001



Page 3 of 4

Room 422, Leader In Ju Itrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong

Tel: (852) 2668 3423 Homepage: http://www.aa-lab.com

Fax:(852) 2668 6946 E-mail: inquiry@aa-lab.com



5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.05
	63 Hz	± 1.05
	125 Hz	+ 0.05
	250 Hz	+ 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
	4000 Hz	± 0.05
	8000 Hz	± 0.10
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 35% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ21-085 CC001



Page 4 of 4



Certificate of Calibration

for

Description:

Sound Level Meter

Manufacturer:

Lutron

Type No.:

SL-4033SD (Serial No.: I.491835)

Submitted by:

Customer:

Acuity Sustainability Consulting Limited

Address:

Unit C, 11/F., Ford Glory Plaza, No. 37-39 Wing Hong Street,

Cheung Sha Wan, Kowloon

Upon receipt for calibration, the instrument was found to be:

☑ Within (A-Weighting, 31.5Hz to 2000Hz)

☐ Outside

the allowable tolerance.

The test equipment used for calibration are traceable to National Standards via:

- The Government of The Hong Kong Special Administrative Region Standard & Calibration Laboratory

Date of receipt: 30 December 2021

Date of calibration: 3 January 2022

Calibrated by:____

Calibration Technician

Certified by:

Mr. Ng Yan Wa Laboratory Manager

Date of issue: 3 January 2022

Certificate No.: APJ21-132-CC002

MR TESTING LAGOR

Page 1 of 3



1. Calibration Precaution:

- The unit-under-test (UUT) was allowed to stabilize in the laboratory for over 24 hours, and switched on to warm up for over 10 minutes before the commencement of the test.
- The results presented are the mean of 3 measurements at each calibration point.

2. Calibration Conditions:

Air Temperature: $22.6\,^{\circ}\text{C}$ Air Pressure: $1006\,\text{hPa}$ Relative Humidity: $53.6\,\%$

3. Calibration Equipment:

	Type	Serial No.	Calibration Report Number	Traceable to	
Multifunction Calibrator	B&K 4226	2288467	AV200041	HOKLAS	

4. Calibration Results

Sound Pressure Level

Reference Sound Pressure Level

Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq.	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
30-130	dBA	SPL	Fast	94	1000	94.0	±0.4

Linearity

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Freq. V	Weighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
				94		94.0	Ref
30-130	dBA	SPL	Fast	104	1000	104.1	±0.3
				114		113.8	±0.3

Time Weighting

Setting of Unit-under-test (UUT)			Applied value		UUT Reading,	IEC 61672 Class 1	
Range, dB	Range, dB Freq. Weighting Time Weightin		Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
20 120	4D A	CDI	Fast	94	1000	94.0	Ref
30-130 dBA SPL	Slow	94	1000	94.0	±0.3		

Certificate No.: APJ21-132-CC002

A+A) *L

Room 422, Leader Industrial Centre, 57-59 Au Pui Wan Street , Fo Tan, Shatin, N.T., Hong Kong
Tel: (852) 2668 3423 Fax: (852) 2668 6946



Frequency Response

A-weighting

Setting of Unit-under-test (UUT)		Applied value		UUT Reading,	IEC 61672 Class 1		
Range, dB	Freq. W	eighting	Time Weighting	Level, dB	Frequency, Hz	dB	Specification, dB
					31.5	55.4	-39.4 ±2.0
					63	67.9	-26.2 ±1.5
0					125	77.9	-16.1 ±1.5
30-130	dBA	SPL	Fast	94	250	85.3	-8.6 ±1.4
					500	91.0	-3.2 ±1.4
					1000	94.0	Ref
					2000	94.4	+1.2 ±1.6

5. Calibration Results Applied

The results apply to the particular unit-under-test only. All calibration points are within manufacture's specification as IEC 61672 Class 1.

Uncertainties of Applied Value:

94 dB	31.5 Hz	± 0.05
	63 Hz	± 0.10
	125 Hz	± 0.05
	250 Hz	± 0.05
	500 Hz	± 0.05
	1000 Hz	± 0.05
	2000 Hz	± 0.05
104 dB	1000 Hz	± 0.05
114 dB	1000 Hz	± 0.05

The uncertainties are evaluated for a 95% confidence level.

Note:

The values given in this certification only related to the values measured at the time of the calibration and any uncertainties quoted will not allow for the equipment long-term drift, variations with environmental changes, vibration and shock during transportation, overloading, mis-handling, or the capability of any other laboratory to repeat the calibration. (A+A)*L shall not be liable for any loss or damage resulting from the use of the equipment.

Certificate No.: APJ21-132-CC002



Room 422,Leader Industrial Centre,57-59 Au Pui Wan Street ,Fo Tan, Shatin,N.T.,Hong Kong
Tel: (852) 2668 3423 Fax:(852) 2668 6946



CALIBRATION CERTIFICATE

Certificate Informat	ion		203 100	L'aux de
Date of Issue	11-Feb-2022]	Certificate Number	MLCN220284S
Customer Information	on			
Company Name Address	Acuity Sustainal Unit E, 12/F., Fo Nos. 37-39 Wing Cheung Sha Wa Kowloon, HK	g Hong Street,	ited	
Equipment-under-To	est (EUT)			
Description Manufacturer Model Number Serial Number Equipment Number	Sound Level Cal Rion NC-74 34504770	librator		
Calibration Particul	ar			
Date of Calibration Calibration Equipment) / AV200063 / 23-Ju) / MLEC21/05/02 / /		
Calibration Procedure	MLCG00, MLC	G15		
Calibration Conditions	Laboratory	Temperature Relative Humidity Stabilizing Time Warm-up Time Power Supply	23 °C ± 5 °C 55% ± 25% Over 3 hours Not applicable Internal battery	
Calibration Results		were detailed in the of twas within EUT sp	1 5	
Approved By & Date				
		16	K.O. Lo	11-Feb-2022
	on Certificate only re	late to the values measur	nternational standards. ed at the time of the calibration and the unental changes, vibration and shock duri	

Page 1 of 2

overloading, mishandling, misuse, and the capacity of any other laboratory to repeat the measurement.

MaxLab Calibration Centre Limited shall not be liable for any loss or damage resulting from the use of the EUT.

The copy of this Certificate is owned by MaxLab Calibration Centre Limited. No part of this Certificate may be reproduced without the prior written approval of MaxLab Calibration Centre Limited.



Certificate No. MLCN220284S

Calibration Data				
EUT Setting	Standard Reading	EUT Error from Setting	Calibration Uncertainty	EUT Specification
94 dB	94.0 dB	0.0 dB	0.20 dB	± 0.3 dB

- END -


Calibrated By: Date :

Dan 11-Feb-22 Checked By: Date:

K.O. Lo 11-Feb-22

Page 2 of 2

萬 儀 校 正 中 心 有 限 公 司 MaxLab Calibration Centre Limited 香港新界葵滿華星街 16-18 號保盈工業大厦 9 樓 B 室 Unit B, 9/F., Boldwin Industrial Bldg., 16-18 Wah Sing Street, Kwai Chung, N.T., Hong Kong Tel: (852) 2116 1380 Fax: (852) 2264 6480 Email: info@maxlab.com.hk

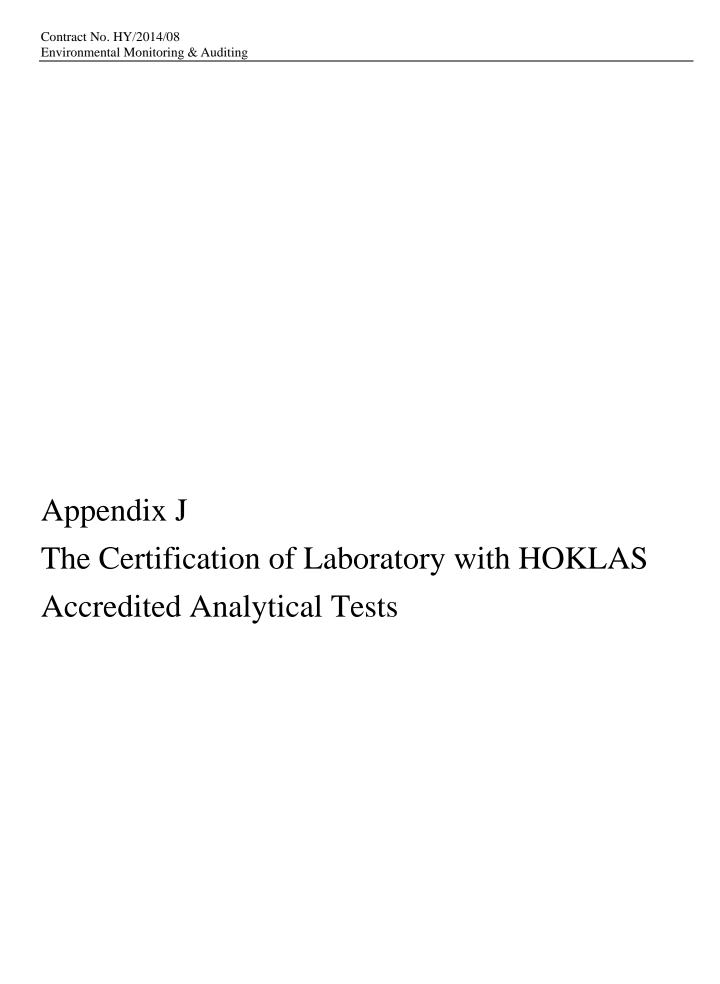



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation 認可證書

This is to certify that 特此證明

ACUMEN LABORATORY AND TESTING LIMITED

浩科檢測中心有限公司

Flat/Rm D, 12/F, Ford Glory Plaza, Nos. 37-39 Wing Hong Street, Cheung Sha Wan, Kowloon, Hong Kong

香港九龍長沙灣永康街37-39號福源廣場12樓D室

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下述測試類別中的指定實驗所活動

Environmental Testing

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to laboratory operation (see joint IAF-ILAC-ISO Communiqué).

此项 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理關系 (見國際認可結婚・國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可慮的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date: 15 November 2021

簽發日期:二零二一年十一月十五日

Registration Number : HOKLAS 241

Date of First Registration: 16 July 2014 首次註冊日期:二零一四年七月十六日

This certificate is issued subject to the terms and conditions laid down by HKAS 本體書級照香港認可盡訂立的條款及條件發出

L002316



Hong Kong Accreditation Service 香港認可處

Certificate of Accreditation

認可證書

This is to certify that 特此間明

ALS TECHNICHEM (HK) PTY LIMITED

11/F, Chung Shun Knitting Centre, 1-3 Wing Yip Street, Kwai Chung, New Territories, Hong Kong 香港新界葵涌永業街1-3號忠信針織中心11樓

is accredited by the Hong Kong Accreditation Service (HKAS) to ISO/IEC 17025:2017 for performing specific laboratory activities as listed in the scope of accreditation within the test category of 獲香港認可處根據ISO/IEC 17025:2017認可 進行戰於認可範圍內下述測試類別中的指定實驗所活動

Environmental Testing

環境測試

This accreditation to ISO/IEC 17025:2017 demonstrates technical competence for a defined scope and the implementation of a management system relevant to isboratory operation (see joint IAF-ILAC-ISO Communiqué).

此項 ISO/IEC 17025:2017 的認可資格證明此實驗所具備指定範疇內所須的技術能力並 實施一套與實驗所運作相關的管理體系 (見國際認可論壇、國際實驗所認可合作組織及國際標準化組織的聯合公報)。

The common seal of HKAS is affixed hereto by the authority of the HKAS Executive 現經香港認可處執行機關授權在此蓋上香港認可處的印章

SHUM Wai-leung, Executive Administrator

執行幹事 沈偉良

Issue Date : 28 February 2020

签發日期:二零二零年二月二十八日

註冊號碼:

Registration Number : HOKLAS 066


Date of First Registration: 15 September 1995 首次註冊日期:一九九五年九月十五日


This certificate is issued subject to the terms and conditions laid down by HKAS. 本證書按照香港認可處訂立的條款及條件發出

L001934

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix K
Location Plan of Noise and Air Quality
Monitoring Station

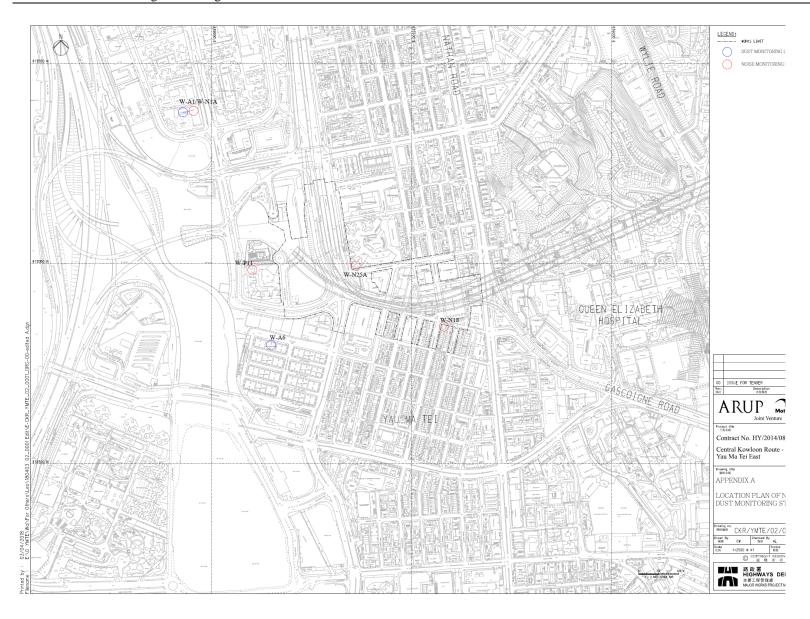

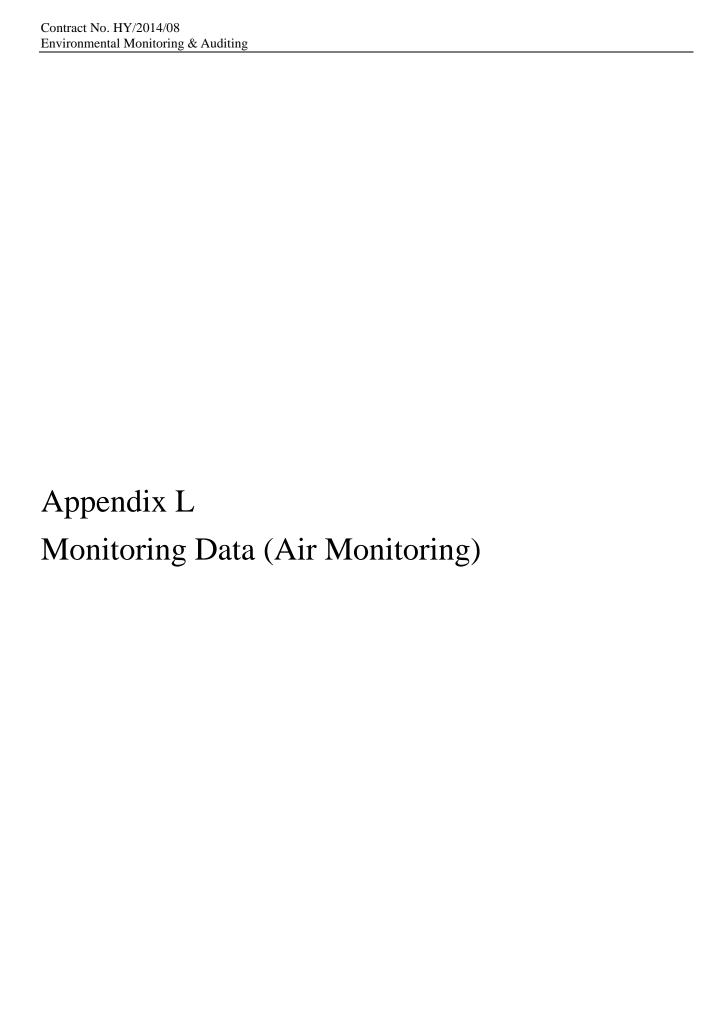

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

Parameter: TSP 1-hour Other Factors Nearby traffic

	1-hour TSP (μg/m³)						
Date	Weather	Start Time	1 st Hour (μg/m³)	2 nd Hour (μg/m³)	3 rd Hour (μg/m³)		
01/08/2022	Sunny	13:39	55	67	61		
06/08/2022	Sunny	10:27	42	58	60		
12/08/2022	Cloudy	9:33	48	41	37		
18/08/2022	Fine	10:40	49	58	55		
24/08/2022	Sunny	15:10	57	66	59		
30/08/2022	Fine	12:31	64	69	60		
Minimum: 37 μg/m ³				Maximum: 69 μg	$/\mathrm{m}^3$		

Location: Man Cheong Building (W-A6)
Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

Parameter: TSP 1-hour Other Factors Nearby traffic

	1-hour TSP (μg/m³)							
Date	Weather	Start Time	1 st Hour (μg/m³)	2 nd Hour (μg/m³)	3 rd Hour (μg/m³)			
01/08/2022	Sunny	12:56	61	78	69			
06/08/2022	Sunny	9:46	59	64	68			
12/08/2022	Cloudy	12:07	49	57	62			
18/08/2022	Fine	10:08	55	67	66			
24/08/2022	Sunny	9:32	67	69	71			
30/08/2022	Fine	12:00	60	69	69			
Minimum: 49 μg/m ³				Maximum: 78 μg	$/\mathrm{m}^3$			

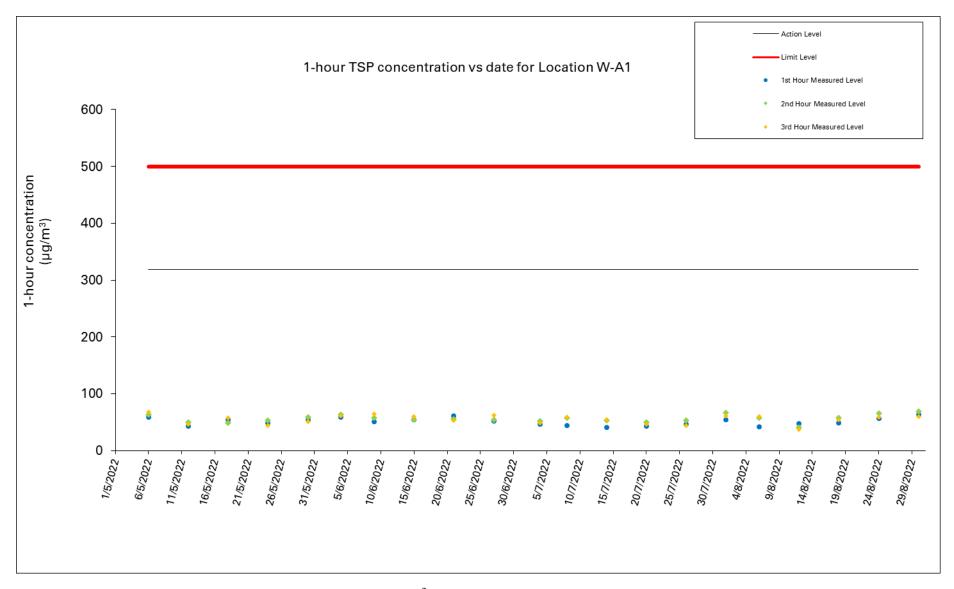


Figure 1: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A1

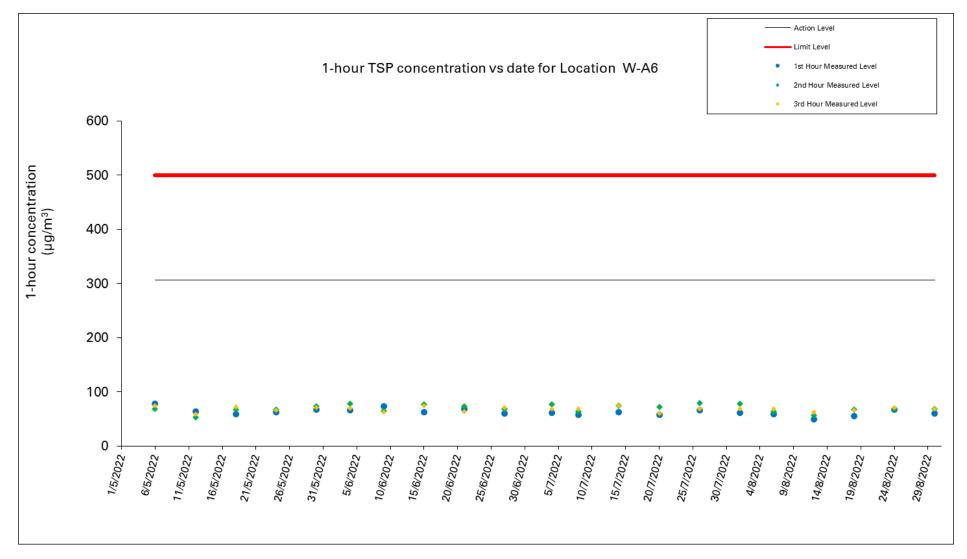


Figure 2: Graphical Illustration of Measured 1-hour TSP (μg/m³) Levels at W-A6

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-A1)

Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

Parameter: TSP 24-hour Other Factors Nearby traffic

Date of Calibration:	30-Jul-22	Slope =	3.1507
Calibration due date:	14-Aug-22	Intercept =	36.0667
Date of Calibration:	17-Aug-22	Slope =	4.0764
Calibration due date:	1-Sep-22	Intercept =	33.8295

Start Date	Weather Condition	Elapse Time			Chart Reading		Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Volume	Filter Weight (g)		Particulate weight	Conc.		
		Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m ³)	Initial	Final	(g)	$(\mu g/m^3)$	
1/8/2022	Sunny	6986.6	7010.6	1440.0	39	40	39.5	27.2	1000.7	0.89	1280	2.7501	2.7964	0.0463	36	
6/8/2022	Sunny	7010.6	7034.6	1440.0	39	39	39.0	28.8	1005.7	0.76	1096	2.7641	2.8218	0.0577	53	
12/8/2022	Cloudy	7034.6	7058.6	1440.0	41	41	41.0	26.4	1009.6	1.49	2144	2.7586	2.8044	0.0458	21	
18/8/2022	Fine	7058.9	7082.9	1440.0	40	40	40.0	27.7	1005.6	1.40	2010	2.7458	2.7721	0.0263	13	
24/8/2022	Sunny	7082.9	7106.9	1440.0	40	41	40.5	30.6	1002.4	1.44	2072	2.7512	2.8316	0.0804	39	
30/8/2022	Fine	7106.9	7130.9	1440.0	38	39	38.5	30.9	1006.3	0.99	1425	2.7525	2.8524	0.0999	70	
										Maximum: $70 \mu g/m^3$ Minimum: 1						

Location: Man Cheong Building (W-A6)
Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

Parameter: TSP 24-hour Other Factors Nearby traffic

Date of Calibration:	30-Jul-22	Slope =	3.3531
Calibration due date:	14-Aug-22	Intercept =	35.8175
Date of Calibration:	17-Aug-22	Slope =	3.6873
Calibration due date:	1-Sep-22	Intercept =	34.9367

Start Date	Weather Condition	Elapse Time			Chart Reading		Avg Air Temp	Avg Atmospheric Pressure	Flow Rate	Standard Air Filter Weigh Volume		ght (g) Particulate weight		Conc.	
		Initial	Final	Actual (min)	Min	Max	Avg	(°C)	(hPa)	(m³/min)	(m ³)	Initial	Final	(g)	$(\mu g/m^3)$
1/8/2022	Sunny	6598.9	6622.9	1440.00	41	41	41.0	27.2	1000.7	1.35	1944	2.7541	2.8055	0.0514	26
6/8/2022	Sunny	6622.9	6646.9	1440.00	40	41	40.5	28.8	1005.7	1.23	1772	2.7545	2.7846	0.0301	17
12/8/2022	Cloudy	6646.9	6670.9	1440.00	40	41	40.5	26.4	1009.6	1.32	1908	2.7632	2.8045	0.0413	22
18/8/2022	Fine	6671.3	6695.3	1440.00	40	40	40.0	27.7	1005.6	1.24	1790	2.7401	2.7723	0.0322	18
24/8/2022	Sunny	6695.3	6719.3	1440.00	41	41	41.0	30.6	1002.4	1.42	2050	2.7372	2.8416	0.1044	51
30/8/2022	Fine	6719.3	6743.3	1440.00	38	39	38.5	30.9	1006.3	0.79	1143	2.7233	2.7946	0.0713	62
										Maximum:	62	Minimum:	17	μg/m ³	

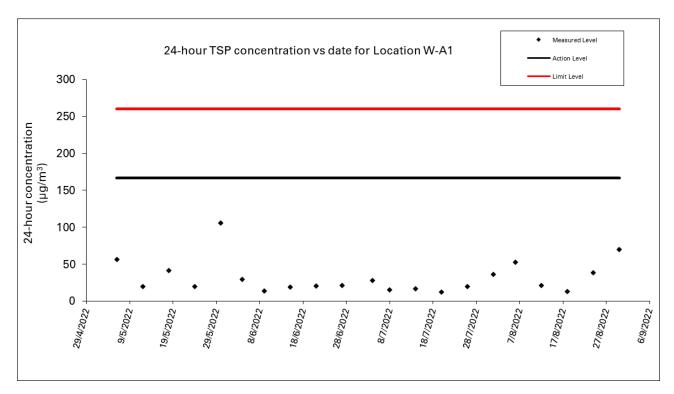


Figure 3: Graphical Illustration of Measured 24-hour TSP ($\mu g/m^3$) Levels at W-A1


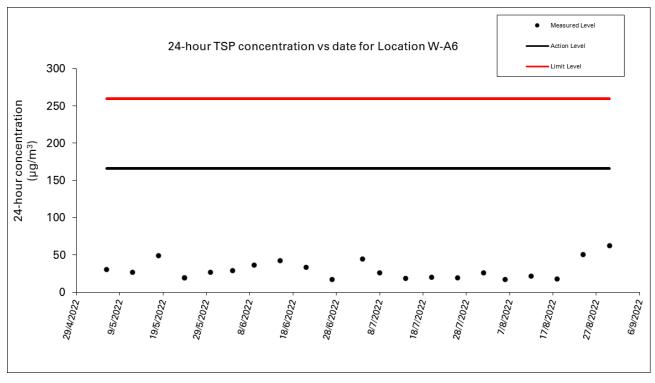



Figure 4: Graphical Illustration of Measured 24-hour TSP (μg/m³) Levels at W-A6


Wind direction data for 1, 2, 6, 7, 12, 13, 18, 19, 24, 25, 30 and 31 August 2022







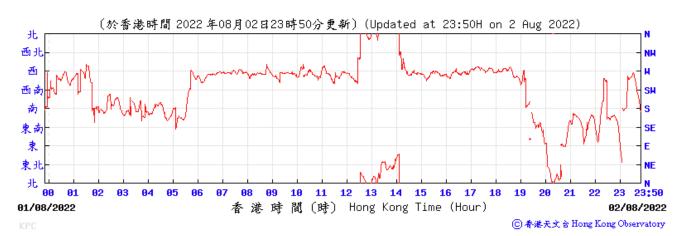

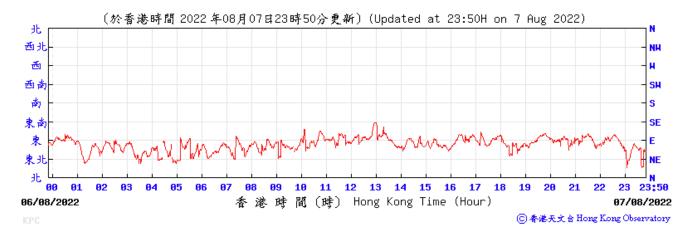


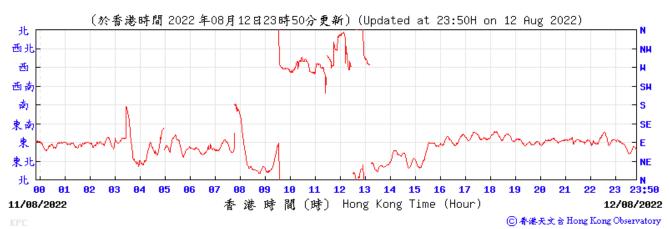

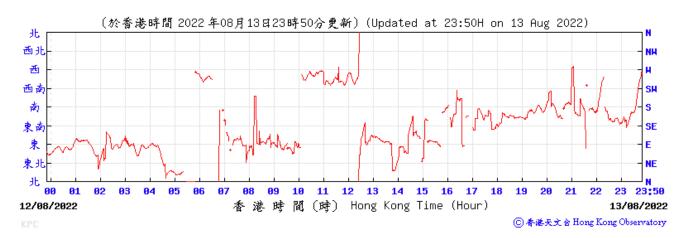


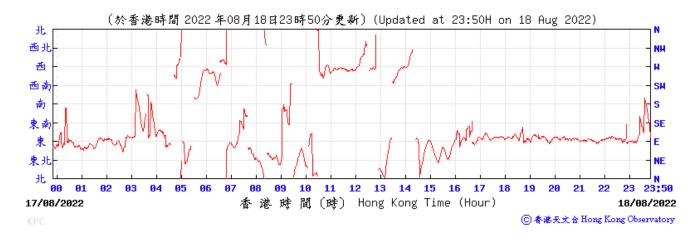



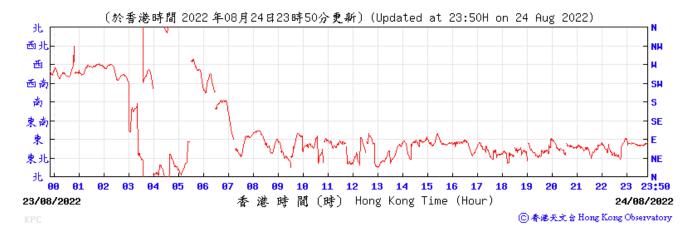




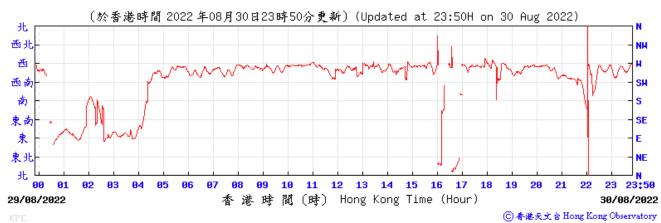






Wind speed data for 1, 2, 6, 7, 12, 13, 18, 19, 24, 25, 30 and 31 August 2022




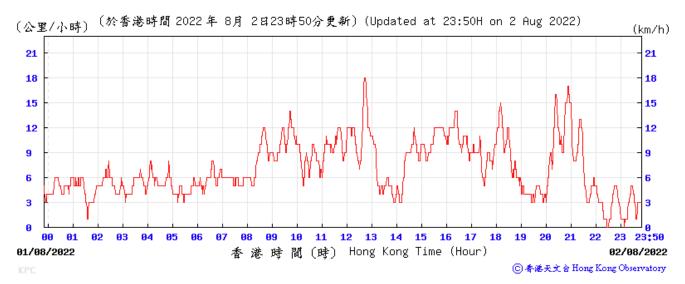


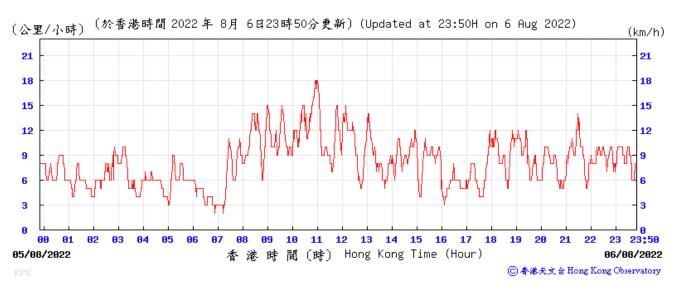


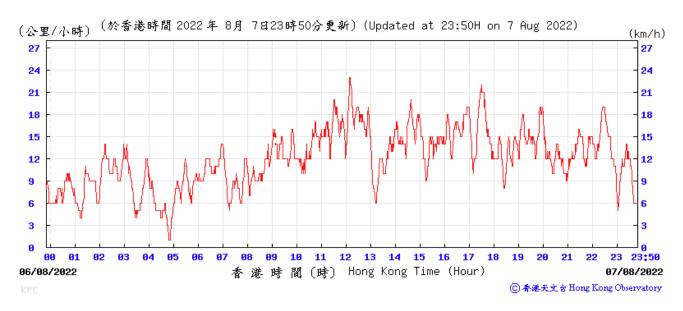


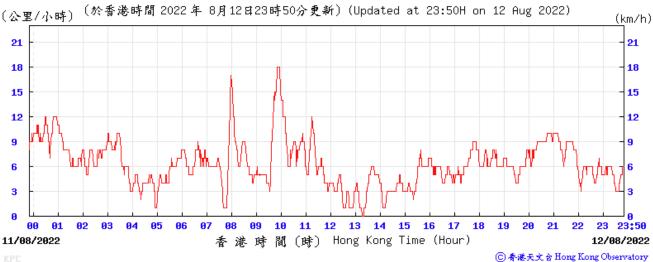


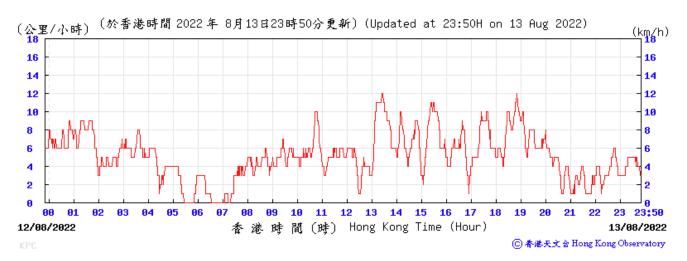

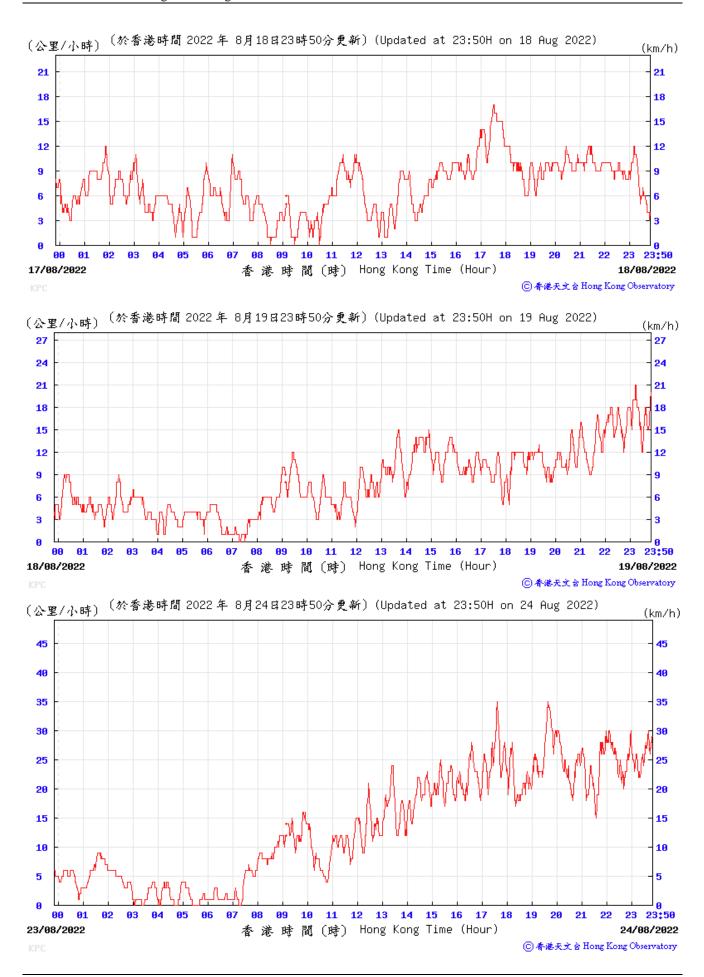

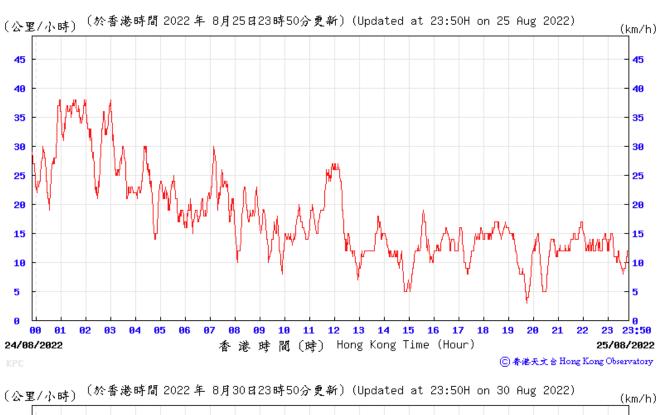

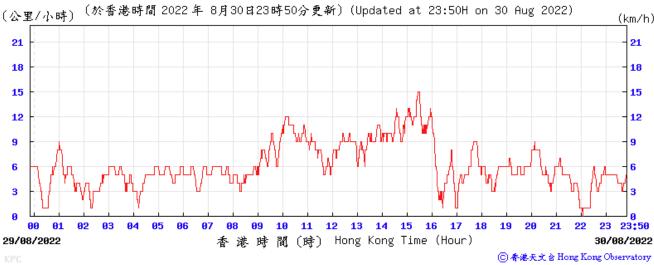

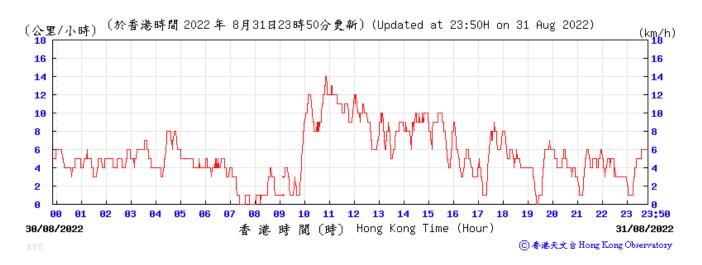

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix M
Monitoring Data (Noise)

Location: Yau Ma Tei Catholic Primary School (Hoi Wang Road) (W-N1A)

Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

 $\begin{array}{ll} \text{Parameter:} & L_{\text{eq}},\,L_{10},\,L_{90} \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	L_{10}	L ₉₀	Wind speed (m/s)
01/08/2022	Sunny	13:41	-	14:11	59.7	62.1	56.8	3.3
06/08/2022	Sunny	10:35	-	11:05	59.7	61.5	56.8	3.8
12/08/2022	Cloudy	9:41	-	10:11	61.8	64.5	59.0	1.7
18/08/2022	Fine	10:44	-	11:14	58.3	60.6	56.2	1.4
24/08/2022	Sunny	15:19	-	15:49	60.1	61.5	56.8	4.9
30/08/2022	Fine	12:34	-	13:04	61.2	62.8	58.3	2.5

Location: Hydan Place (W-N18)

Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

 $\begin{array}{ll} Parameter: & L_{eq}, L_{10}, \ L_{90} \\ Other \ Factors & Nearby \ traffic \end{array}$

Date	Weather	Start Time	-	End Time	Leq	L_{10}	L ₉₀	Wind speed (m/s)
01/08/2022	Sunny	15:28	-	15:58	70.9	73.4	67.4	3.4
06/08/2022	Sunny	11:29	-	11:59	70.2	73.0	66.9	2.3
12/08/2022	Cloudy	13:28	-	13:58	70.6	72.9	67.0	1.6
18/08/2022	Fine	13:21	-	13:51	70.0	72.4	67.0	1.1
24/08/2022	Sunny	9:58	-	10:28	72.3	74.7	68.3	4.0
30/08/2022	Fine	15:21	-	15:51	71.1	73.5	67.8	3.9

Location: Prosperous Garden Block 1 (W-N25A)

Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

 $\begin{array}{ll} \text{Parameter:} & L_{\text{eq}}, L_{10}, \ L_{90} \\ \text{Other Factors} & \text{Nearby traffic} \end{array}$

Date	Weather	Start Time	-	End Time	$L_{\rm eq}$	L_{10}	L ₉₀	Wind speed (m/s)
01/08/2022	Sunny	14:42	-	15:12	69.1	71.7	66.4	2.9
06/08/2022	Sunny	13:39	-	14:09	68.9	71.4	66.5	2.4
12/08/2022	Cloudy	14:19	-	14:49	68.7	71.3	66.2	0.8
18/08/2022	Fine	14:17	-	14:47	69.1	71.9	66.6	1.3
24/08/2022	Sunny	11:01	-	11:31	67.2	69.1	63.6	3.1
30/08/2022	Fine	14:35	-	15:05	69.4	71.9	66.8	3.2

Location: The Coronation Tower 1 (W-P11)

Monitoring date: 1, 6, 12, 18, 24 and 30 August 2022

 $\begin{array}{ll} Parameter: & L_{eq.}\,L_{10,}\,L_{90} \\ Other \ Factors & Nearby \ traffic \end{array}$

Date	Weather	Start Time	-	End Time	Leq	L_{10}	L ₉₀	Wind speed (m/s)
01/08/2022	Sunny	16:23	-	16:53	66.4	67.8	64.2	3.2
06/08/2022	Sunny	12:27	-	12:57	65.3	67.0	62.9	2.5
12/08/2022	Cloudy	10:35	-	11:05	68.2	69.2	66.8	1.7
18/08/2022	Fine	9:11	-	9:41	64.8	66.4	63.0	0.9
24/08/2022	Sunny	16:14	-	16:44	65.0	66.6	62.7	4.9
30/08/2022	Fine	13:41	-	14:11	65.4	66.9	63.0	2.9

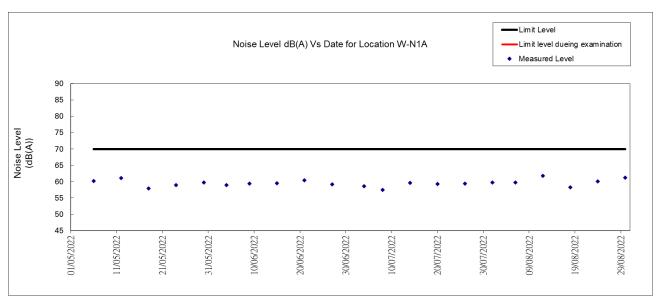


Figure 1: Graphical Illustration of Measured Noise Levels at W-N1A

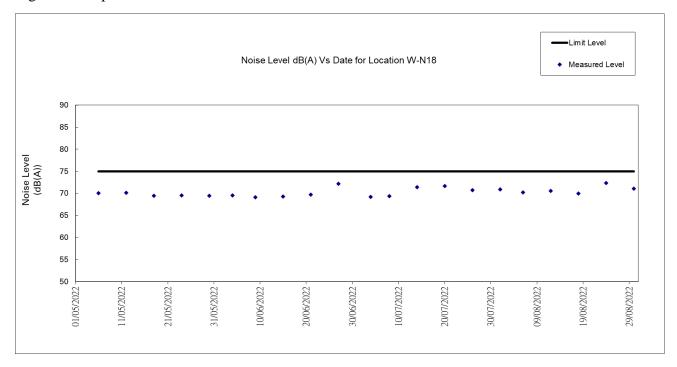


Figure 2: Graphical Illustration of Measured Noise Levels at W-N18

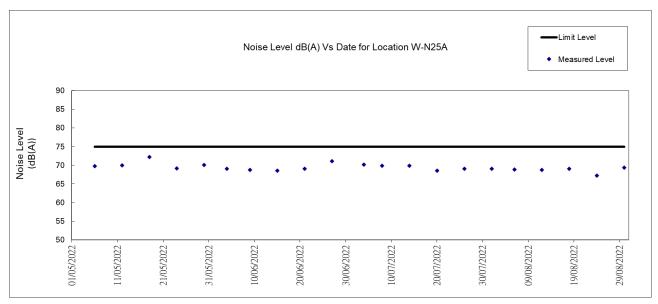


Figure 3: Graphical Illustration of Measured Noise Levels at W-N25A

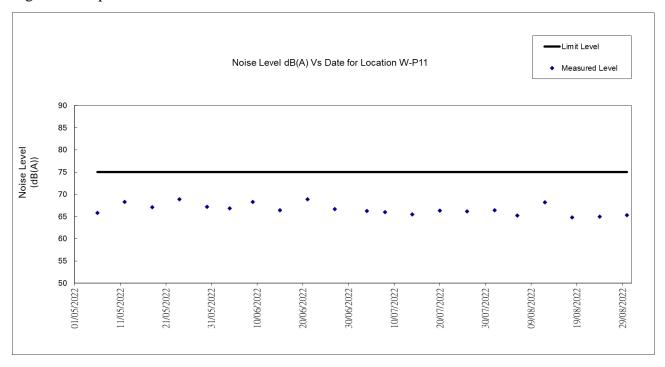


Figure 4: Graphical Illustration of Measured Noise Levels at W-P11

Contract No. HY/2014/08
Environmental Monitoring & Auditing

Appendix N Waste Flow Table

Monthly Summary Waste Flow Table

Name of Department: Highways Department Contract No. / Works Order No.: <u>HY/2014/08</u>

Monthly Summary Waste Flow Table for August 2022

[to be submitted not later than the 15th day of each month following reporting month] (All quantities shall be rounded off to 1 decimal place.)

		Actual Quantities of <u>Inert</u> Construction Waste Generated Monthly					
Month	(a)=(b)+(c)+(d)+(e)+ (f)+ (g)+ (h)+ (i)+ (j)+ (k) Total Quantity Generated	(b) Hard Rock and Large Broken Concrete	(c) Reused in the Contract	(d) Reused in other Projects	(e) Disposed of as Public Fill	(f) Imported Fill	
	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	(in 'tonnes)	
Jan-22	7033.91	116.10	232.40	4412.20	2227.40	0.00	
Feb-22	1764.90	157.80	435.30	590.60	557.10	0.00	
Mar-22	4333.20	39.20	99.00	1114.20	3043.30	0.00	
Apr-22	15634.90	214.50	995.80	9387.70	4998.00	0.00	
May-22	11192.20	55.20	42.00	2335.40	8719.30	0.00	
Jun-22	8364.40	378.70	0.00	0.00	7942.70	0.00	
Sub-total	48324.51	961.50	1804.50	17840.10	27487.80	0.00	
Jul-22	5848.10	444.30	0.00	0.00	5359.40	0.00	
Aug-22	13103.91	1222.40	0.00	0.00	11768.20	0.00	
Sep-22							
Oct-22							
Nov-22							
Dec-22							
Total	67277.02	2628.20	1804.50	17840.10	44615.40	0.00	
2018	51057.90	0.00	0.00	0.00	47715.60	2877.40	
2019	112830.10	541.00	1523.80	13525.00	93132.90	3155.60	
2020	193021.92	58778.00	1205.60	19108.60	112556.80	0.00	
2021	104679.02	6461.30	1393.70	1144.70	92950.20	1542.90	
Accumulated Total	528865.96	68408.50	5927.60	51618.40	390970.90	7575.90	

		Actual Quantities of Non-inert Construction Waste Generated Monthly								
Month	(g) Metals		(l Paper/ cardbo	n) ard packaging	(i) Plastics		(j) Chemical Waste		(k) Others, e.g. General Refuse disposed at Landfill	
	(in '0	000kg)	(in '0	00kg)	(in '00	00kg)	(in '0	00kg)	(in 'tonnes)	
	generated	recycled	generated	recycled	generated	recycled	generated	recycled	generated	
Jan-22	0.00	0.00	0.00	0.00	0.01	0.00	0.00	0.00	45.80	
Feb-22	0.00	0.00	0.60	0.00	0.00	0.00	0.00	0.00	23.50	
Mar-22	0.00	0.00	0.20	0.00	0.00	0.00	0.80	0.00	36.50	
Apr-22	0.00	0.00	0.60	0.00	0.00	0.00	0.40	0.00	38.70	
May-22	0.00	0.00	0.20	0.00	0.00	0.00	0.00	0.00	40.30	
Jun-22	0.00	0.00	0.50	0.00	0.00	0.00	0.00	0.00	43.00	
Sub-total	0.00	0.00	2.10	0.00	0.01	0.00	1.20	0.00	227.80	
Jul-22	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	44.40	
Aug-22	0.00	0.00	0.20	0.00	0.01	0.00	0.00	0.00	113.10	
Sep-22										
Oct-22										
Nov-22										
Dec-22										
Total	0.00	0.00	2.30	0.00	0.02	0.00	1.20	0.00	385.30	
2018	28.40	0.00	0.00	0.00	0.00	0.00	2.00	0.00	434.50	
2019	0.00	9.10	3.40	6.80	0.00	0.00	5.20	0.00	927.30	
2020	69.20	0.00	3.30	0.00	0.02	0.00	25.30	0.00	1275.10	
2021	30.20	0.00	4.80	0.00	0.02	0.00	25.50	0.00	1125.70	
Accumulated Total	127.80	9.10	13.80	6.80	0.06	0.00	59.20	0.00	4147.90	



Appendix O
Statistics on Complaint, Notifications of
Summons and Successful Prosecutions

Statistical Summary of Exceedances

	Air Quality							
Reporting Period	Action Level	Limit Level						
1 August 2022-	0	0						
31 August 2022	U	U						
	Noise							
Reporting Period	Action Level	Limit Level						
1 August 2022-	1	0						
31 August 2022	1	U						

Statistical Summary of Environmental Complaints

Donauting David		Environmental Complaint Statistics			
Reporting Period	Frequency	Cumulative	Complaint Nature		
1 August 2022-	2	40	Construction Noise, Dust and		
31 August 2022	3	40	Water seepage		

Statistical Summary of Environmental Non-compliance


Donauting David	Environmental Non-compliance Statistics						
Reporting Period	Frequency	Cumulative	Details				
1 August 2022-	0	1	NI/A				
31 August 2022	U	1	N/A				

Statistical Summary of Environmental Summons


Donouting Donied	Environmental Summons Statistics					
Reporting Period	Frequency	Cumulative	Details			
1 August 2022-	0	1	N/A			
31 August 2022	U	1	IN/A			

Statistical Summary of Environmental Prosecution

Donarting Daried	Environmental Prosecution Statistics			
Reporting Period	Frequency	Cumulative	Details	
1 August 2022- 31 August 2022	0	0	N/A	

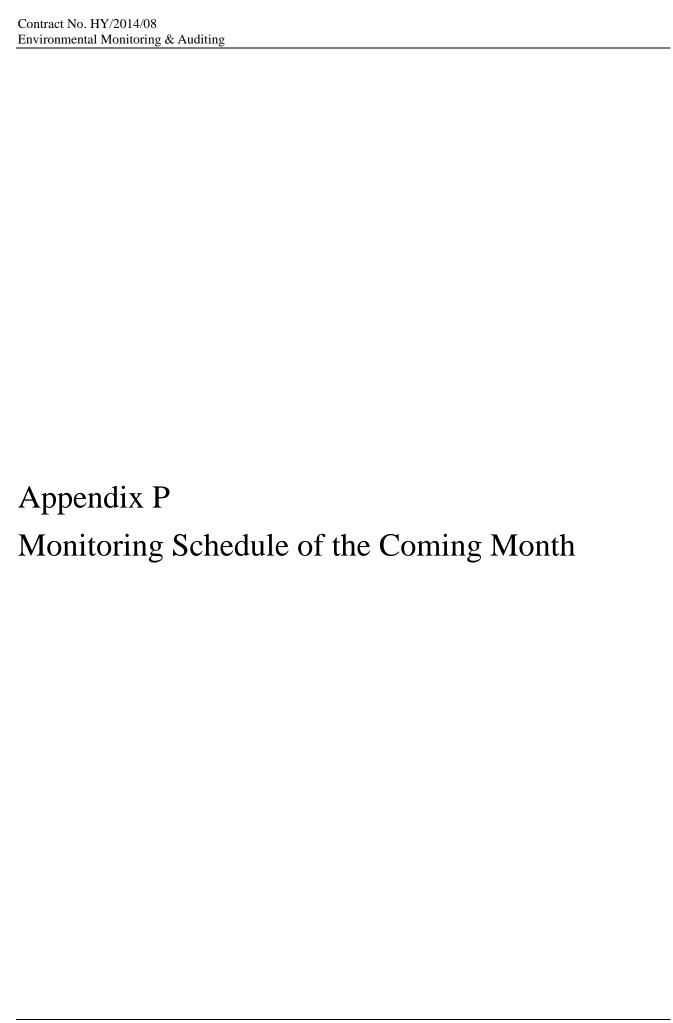

Impact Monitoring Schedule for YMTE						
Sep-22						
Sun	Mon	Tue	Wed	Thur	Fel	Set
				1	2	3
4	5	6	7	8	9	10
	Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N23A					Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A
11	12	13	14	15	16	17
					Impact Air monitoring for W-A5 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N25A	
18	19	20	21	22	23	24
				Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N23A		
25	26	27	28	29	30	
			Impact Air monitoring for W-A6 &W-A1 Noise monitoring for W-N1A, W-P11,W-N18 & W-N23A			

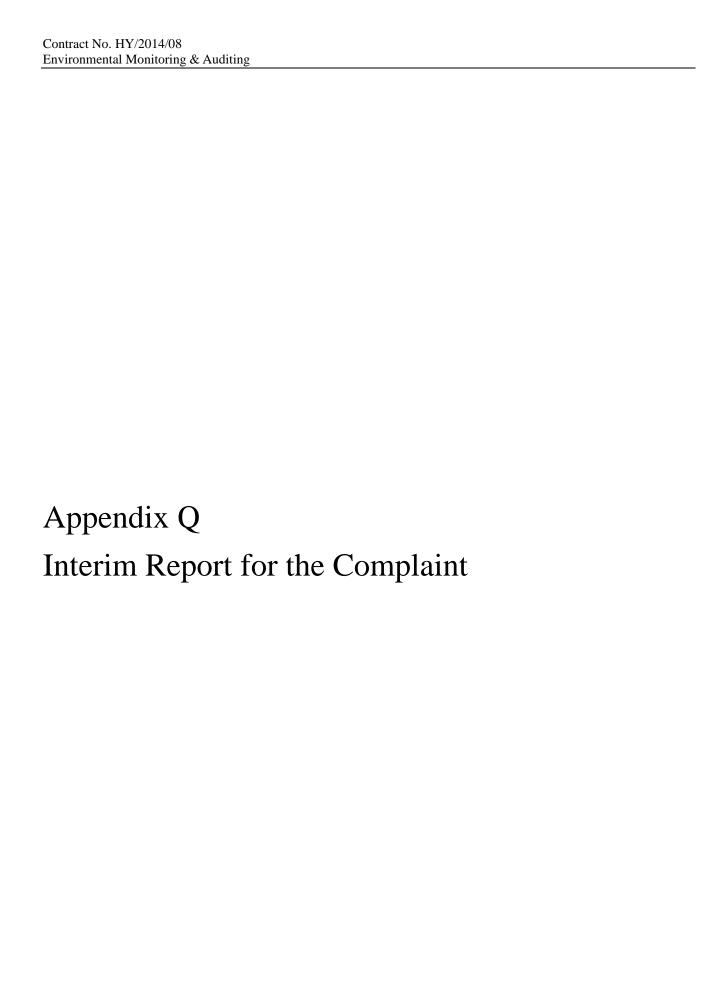


Interim Report on Environmental Complaint

Project	Central Kowloon Route, Yau Ma Tei East Section		
Complaint Code	EC039-CKRYMTE20220804_001		
Complaint description	The complainant complained that the smoke or dust has blocked the driving eyesight at Gascoigne Road Flyover at 9:22AM. The construction sites of Highways Department were under the flyover. The complainant requested to follow up.		
	"我在9時22分時駕駛車經過加士居道天橋時發現大量不知道是煙定塵埃大量湧上 行車天橋,阻礙行車視線。橋下有地盤是屬路政署。請當局正視問題。"		
Parameter	Dust		
Investigation finding	The complainant made the complaint on 4 August 2022 and was concerned about the dust impacts from Zone D.		
	As noted from the Contractor, the drilling rig at Zone D functioned abnormally at concerned time on 4 August 2022. The drilling rig was confirmed as malfunctioning after checking and had been removed from the site immediately. Therefore, it is suspected that the smoke was generated from the malfunctioned drilling rig at Zone D which is nearest to Gascoigne Road Flyover.		
	The nearest dust monitoring point to the concerned areas is Man Cheong Building (W-A6) where similar works activities at Zone D were conducted. Impact dust monitoring had been carried out on 1 and 6 August 2022 and the monitoring results at W-A6 were 69 $\mu g/m^3$ and 64 $\mu g/m^3$ for TSP-1hr and 26 $\mu g/m^3$ and 17 $\mu g/m^3$ for TSP-24hr which were all below the action levels for the monitoring location at 166 $\mu g/m^3$ for TSP-24hr and 306 $\mu g/m^3$ for TSP-1hr. It was believed that the construction dust generated during daytime from 1 to 6 August 2022 did not exceed the dust limit level as stipulated under EM&A manual. In addition, no environmental deficiency regarding construction dust at Zone D was observed during weekly site inspection conducted on 4 August 2022.		
	As the construction dust generated during daytime from 1 to 6 August 2022 did not exceed the dust limit level as stipulated under EM&A manual, it is concluded that no non-compliance to the EM&A requirement of the Project regarding dust impacts from construction works.		
Actions taken / to be taken	The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize nuisance to the public. Stockpile of dusty material had been covered with impervious sheeting and concerned site areas had been watering regularly.		
Remarks	PME used in Zone D on 4 August 2022 at daytime: ■ Drilling rig x 1 ■ Air compressor x 1		
	Construction works carried out in Zone D on 4 August 2022 at daytime: Water well drilling Works locations: (Page 3)		

Prepared by ET (Acuity Sustainability Consulting Limited)	Katrina Chui	f.V
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K;
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy2.
Date	9 August 2022	


Works locations:

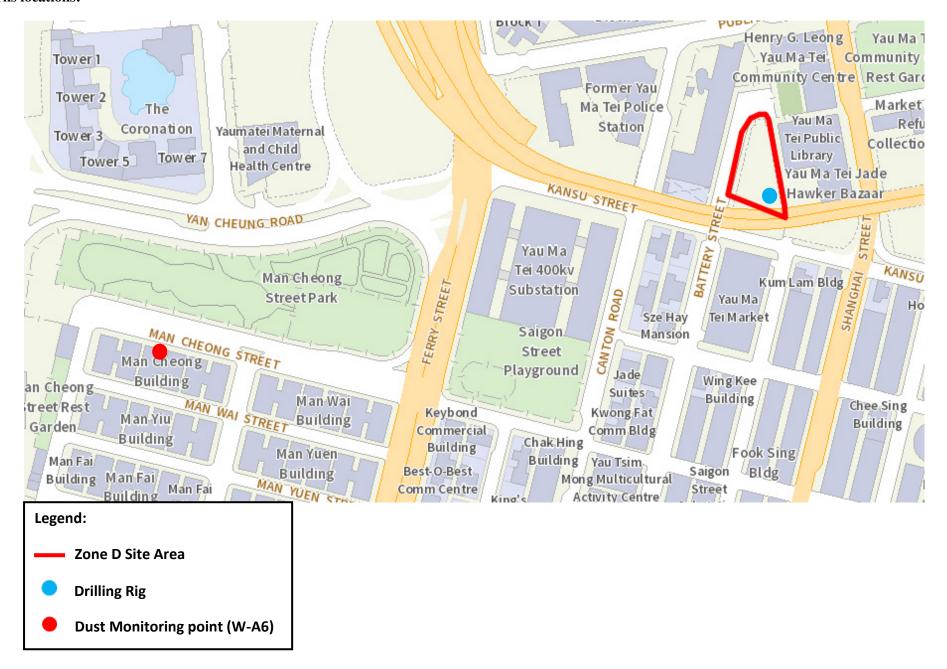

Interim Report on Environmental Complaint

Project	Central Kowloon Route, Yau Ma Tei East Section			
Complaint Code	EC040-CKRYMTE20220812_001			
Complaint description	The complainant complained that the dripping water was found at the pedestrian zone near the construction site between Temple Street and Market Street. The complainant concerned about if the dripping water was contaminated and unsanitary. The complainant wanted to know whether the construction works have safety assessment and management.			
	方,不停滴水, 有味道,十分之 分之有問題,是 路政署管轄的利	不知是什麼水,是污 不衛生,想請問路政 否沒有安全人員評估	诗,發現有路政署的地盤的建築物在行人路上 5染嗎? 經過時不停滴水,令到成身濕晒,和 故署管轄的地盤利基沒有人管理?安全方面十 5.国險?每天都有不同的問題滋擾我地居民, 分之不知所謂,完全有管理制度,安全方面對 5.行過嚟避開。"	
Parameter	Water Seepage			
Investigation finding	The complainant made the complaint on 12 August 2022 and was concerned about the dripping water from P6 site area to public area.			
	As noted from the Contractor, the heavy rain on 11 and 12 August 2022 caused the water dripping from the protection screen of the overhead bridge. During the weekly site inspection carried out on 11 August 2022, similar situation was observed at P6 site area because of the heavy rain. Since the bridge structure did not contain any contaminates and suspended solids, the dripping water was classified as rainwater.			
Actions taken / to be taken	The Contractor had followed EM&A Manual strictly to implement mitigation measures in order to minimize nuisance to the public. The Contractor had added the impervious sheeting at the base of bridge to block the water dripping from the bridge and the rainwater will be diverted to the site for treatment. Supporting photo are provided in Appendix A.			
Remarks	Works locations: (Page 3)			
Prepared by ET (Acuity Sustainability Consulting Limited)	Katrina Chui	fil		
Reviewed by ETL (Acuity Sustainability Consulting Limited)	Kevin Li	K		
Verified by IEC (ERM-Hong Kong, Limited)	Mandy To	Mandy 2.		
Date	16 Aug	gust 2022		

Works locations:

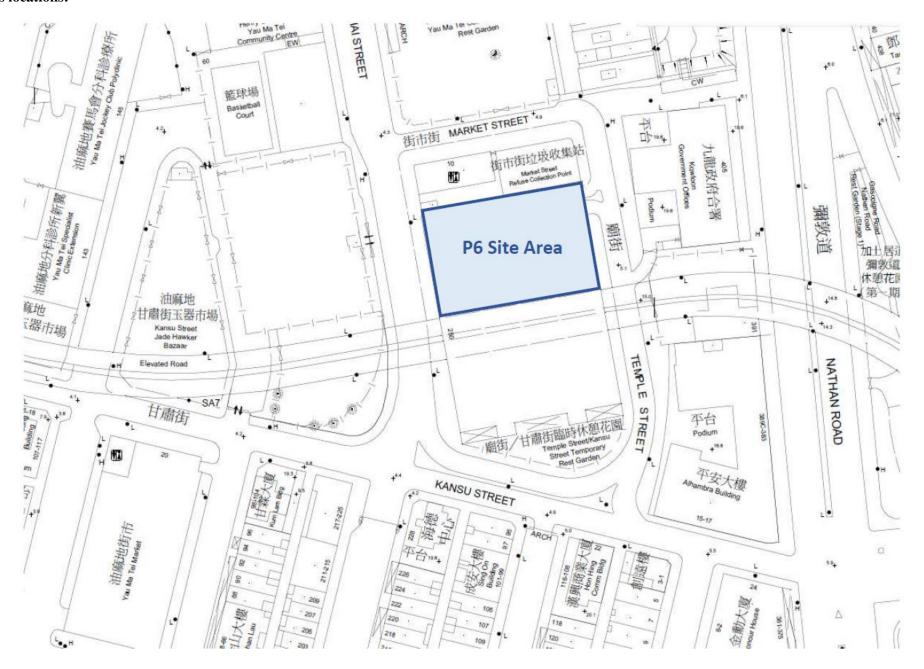

Page 2 of 3

Appendix A



Figure A1: Impervious sheeting was added at the base of bridge at P6 site area.

Interim Report on Environmental Complaint

Project	Central Kowloon Route, Yau Ma Tei East Section		
Complaint Code	EC041-CKRYMTE20220815_001		
Complaint description	The complainant complained about the construction noise from the site area near		
	Yau Ma Tei Police Station at 11:30 PM on 10 August 2022.		
	"10-8-22 晚上 11 時 30 分在油麻地舊警署對出仍有工程進行並發出噪音,影響		
	居民。"		
Parameter	Construction Noise		
Investigation finding	The complainant made the complaint on 12 August 2022 and was concerned about the construction noise generated from the Zone B2 and C at 11:30 PM on 10 August 2022.		
	As noted from the contractor, no prescribed construction works were carried out during the restricted hours (7:00 PM – 7:00 AM) from 10 to 11 August 2022 in Zone B2 and C.		
			stalled at Zone C during the concerned time. The
			ton Road between Public Square Street and Kansu
	Street, Yau Ma Tei, Kowloon (Permit No.: GE-RE0643-22) was issued by the EPD but		
	no PME was used during the investigation period.		
	Considering the fulfillment of stipulated requirements by the Contractor for CNP		
	(Permit No.: GE-RE0643-22) and EM&A manual, it is concluded that there was no non-		
	compliance to the EM&A requirement of the Project regarding noise pollution impact		
Actions taken / to be taken	from construction site. The Contractor had followed EM&A Manual strictly to implement mitigation measures		
Actions taken / to be taken	in order to minimize nuisance to the public.		
Remarks	Works locations:		
	(next page.)		
Prepared by ET	-	1	
(Acuity Sustainability	Janice Lee	h	
Consulting Limited)	V W M M M M M M M M M M M M M M M M M M	9	
		а	
Reviewed by ETL		^	
(Acuity Sustainability	Kelvin Li	/X	
Consulting Limited)			
Verified by IEC		Mandyto.	
(ERM-Hong Kong,	Mandy To	1. Manolyto.	
Limited)		/W 0000 /	
Date	23 Augi	ıst 2022	
			-

Works location:

